CTAF 127.15

ADDITIONAL INFORMATION

Animal hazard exists on the AD.


CHARTS RELATED TO THE AERODROME

WAC 3110.

LAKE KEEPIT

ELEV 1150

FULL NOTAM SERVICE NOT AVBL

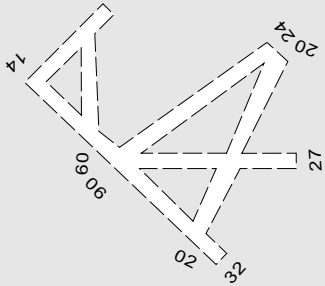

NSW		UTC +10	YKEP
305324S	1503136E	VAR 11 DEG E	UNCR

AD OPR Lake Keepit Soaring Club, 234 Keepit Dam Rd, Keepit, NSW, 2340. Email: manager@keepitsoaring.com. PH 02 6769 7514. Website: www.keepitsoaring.com.

PASSENGER FACILITIES

Drinkable water/TX 02 6742 0069/AC

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	127.1

CTAF 132.25

ADDITIONAL INFORMATION

1. To maintain communications with other ACFT, please call 132.25 - callsign “Keepit Base”.
2. Kangaroo hazard exists.
3. Gliding OPS - Winch Launching.

CHARTS RELATED TO THE AERODROME

WAC 3357.

LAKE MACQUARIE AIRPORT

AVFAX CODE 2090

ELEV 5

FULL NOTAM SERVICE NOT AVBL



NSW		UTC +10	YLMQ
330358S	1513853E	VAR 13 DEG E	UNCR

AD OPR Lake Macquarie Airport Pty Ltd, PO Box 988, Warners Bay, NSW, 2282. Email: contact@lakemacquarieairport.com.au. ARO 0408 449 198 or 0458 301 366. Website: www.lakemacquarieairport.com.au.

REMARKS

1. PPR in writing to ARO.
2. Rescue HEL Service EMERG OPS take precedence. Response time 10MIN.
3. Airfield status subject to change without notice.
4. AD Charges and landing fee apply.

PHYSICAL CHARACTERISTICS

07/25 27c Unrated. Central 11 sealed. WID 18 RWS 90
Length 880M.
Displaced thresholds for landing due to possible obstructions - PPR.

OTHER LIGHTING

Runway lighting not available.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	125.7 On ground

LOCAL TRAFFIC REGULATIONS

Carriage and use of radio is required by AD OPR.

CTAF 132.1

NOISE ABATEMENT PROCEDURES

1. Noise sensitive area.
2. All ACFT required to be familiar with YLMQ procedure document on website.
3. Avoid all built up areas.
4. Avoid golf course to east.
5. No flight below 1,000FT AMSL.

ADDITIONAL INFORMATION

1. HEL OPS.
2. Frequent EMERG service OPS.
3. Microlight and gyrocopters operate from this AD. Gyrocopters may occupy RWY for longer than normal due to building up rotor speed.
4. PJE occur HJ on airfield from FL150, Pilots advised to monitor CTAF and BN CEN for DZ status.
5. Refer to YLMQ Westpac Rescue Helicopter for Helicopter Emergency Medical Service OPS.

CHARTS RELATED TO THE AERODROME

1. WAC 3456.
2. Also refer AIP Departure and Approach Procedures.

LAKELAND DOWNS

ELEV 935

FULL NOTAM SERVICE NOT AVBL



QLD		UTC +10	YLND
155009S	1445051E	VAR 6 DEG E	UNCR

AD OPR Cook Shire Council, PO Box 3, Cooktown, QLD, 4895.
Email: cooktownap@cook.qld.gov.au. PH 07 4069 5360. Mobile 0417 628 080.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	134.65

FLIGHT PROCEDURES

Right hand circuits operating on RWY 34 due to wind turbines located to the NW, as close as 2.3NM to a height of 700FT AGL.

CTAF 126.7


CHARTS RELATED TO THE AERODROME

WAC 3112.

LAKES ENTRANCE

ELEV 220

FULL NOTAM SERVICE NOT AVBL



VIC		UTC +10	YLKE
375108S	1475655E	VAR 13 DEG E	UNCR

AD OPR Victoria Helicopters Pty Ltd, PO Box 834 Bairnsdale, VIC, 3875.
Email: info@ylke.com.au. PH 0419 567 590. Website: https://ylke.com.au/.

REMARKS

1. PPR FM AD OPR via website.
2. LDG fees apply, refer to website.

PASSENGER FACILITIES

WC.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	124.0 Circuit Area

Information may be continued on the next page: PTO