

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

FAO The Court
C/o Kerr Brown Partnership
50 Wellington Street
Glasgow
G26HJ

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: Mr Steven Millar: 13/06/2025

In accordance with your instructions received on 20/06/2025 requesting us to provide an independent accident damage report, we assessed the damage on 20/06/2025. Vehicle located at Premier 1 Accident Repair Centre, 45 Boundary Road, Heathfield Industrial Estate, Ayr, KA8 9DJ. Our findings are as detailed below.


Make	AUDI	Registration	GX18XEB
Model	S3 TFSI QUATTRO S-A	Status	T/Loss
Category	S	Salvage Value	£1,628.60
Repair Cost	£17,145.97	Legal Status	Unroadworthy
Engineer Value	£16,286.00	Impact Magnitude	Moderate



Impact Area

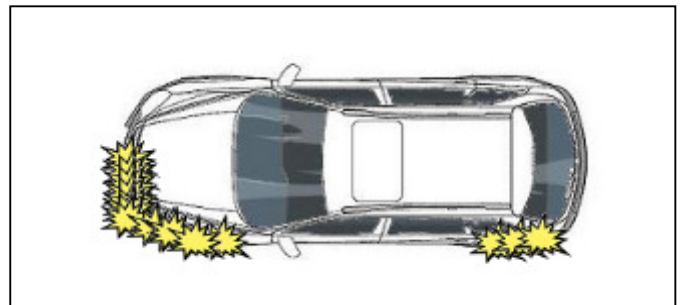

Document produced
using the EVA system

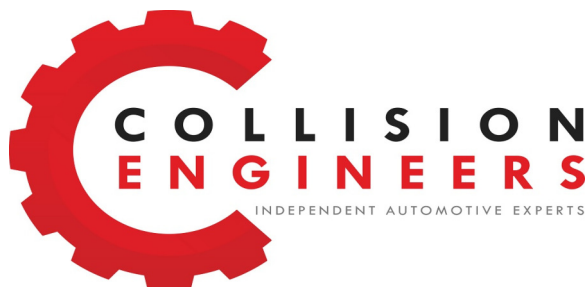

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the front, and moderate to heavy collision/impact to the left hand side.

ENGINEER'S COMMENTS

Valuation based on CAP.

20/06/2025 - Please note the vehicle is unroadworthy due to the extent of panel distortion sustained to the nearside

VEHICLE HISTORY CHECK

According to the Experian database; there is a plate change on record

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT


We consider that an equitable settlement would be £14,657.40 which represents the pre-accident engineer value of the vehicle of £16,286.00 less the value of the salvage of £1,628.60.

SALVAGE

Under the current salvage categorisation matrix, **within the scope of our inspection**, we consider that this is Category S, (Structural damage) and can be sold as repairable salvage. Further information is available www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £1,628.60. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	
Trade Value	
Engineer's Value	£16,286.00
Glass's Code	
VIN	WAUZZZ8V7JA059220
Odometer	61873
Engine	1984
Fuel	Petrol
Extras	
Condition	Good
Unrelated Damage	

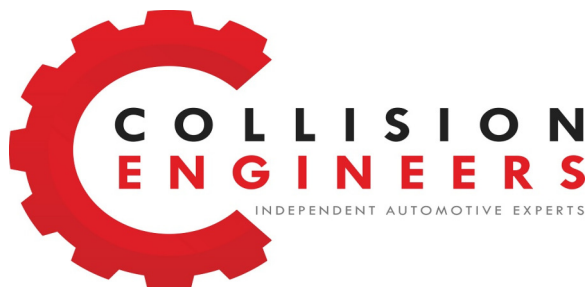

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

Main new parts required

Front Bumper Lining
Front Bumper Reinforcement
Front Bumper Side Rear Bracket (L)
Front Bumper Grille
Xenon Headlamp (with Indicator) (L)
Front Wing (L)
Front Wing Bracket (L)
Front Grille
Front Grille Screw
Front Door Membrane (L)
Rear Lamp LED Outer (L)
Rear Side Panel Bonding Kit (L)
Rear Side Glass Primer (L)
Rear Side Glass Activator (L)
Rear Wheelarch, Outer (R)
Front Suspension Lower Lever Joint (L)
Rear Shock Absorber (L)
Rear Wheel Hub with Bearing (L)
Auxiliary Radiator (L)
Quattro badge

Front Bumper Impact Absorber/Filler
Front Bumper Stoneguard
Front Bumper Auxiliary Lamp Cover (L)
Front Bumper Repair kit
Headlamp Washer Jet (Lifting) (L)
Front Wing Bracket (Front) (L)
Front Wing Repair Kit (L)
Front Grille Repair/Fastening Kit
Front Door Covering Sheet (Skin) (L)
Exterior Mirror Side Repeater Lamp (L)
Rear Side Panel (L)
Side Glass Repair/Bonding Kit (L)
Rear Side Glass Applicator (L)
Side Panel Insulation (L)
Side Panel Liner (L)
Rear Susp Longitudinal Arm with Bearing (L)
Rear Steering Knuckle (L)
Rear Wheel (Aluminium) (L)
Front Auxiliary Radiator Cover (L)

Repairs required


Bonnet
Rear Bumper Lining

Sill Panel Cover (Plastic) (L)

Additional operations

Alloy Wheel Refurbish NSF
Boron Drill
De-nib/ polish Additional work (21.00): ..
Environmental Charge
NSF tyre
Pre repair cleaning charge (including sa
Repair method research charge
Sill dressing (per side) Additional work (7.00): ...
System Diagnostic Check (Post Repair)
Touch up bolts
Wash/Clean
Wheel Alignment (4 wheel)
Paint Front Wing, Complete (L)
Blend A-Post, Upper (L)
Blend Front Door Exterior Mirror Cover (L)
Paint Sill Panel Protective Moulding (L)
Paint Rear Bumper k/e
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)

Assessment Damage Appraisal Charge
Corrosion Protection Additional work (2.00): ...
Energy cost supplement
Jig, clamp and pull
NSR tyre
QC & Road Test
Seam Sealant
Standard shutdown
System Diagnostic Check (Pre Repair)
Vehicle Care Kit
Welded / bonded panel (materials)
Paint Front Bumper k
Paint Bonnet
Paint Front Door, Complete K (L)
Blend Front Door Outer Handle (L)
Paint Rear Side Panel, Complete K (L)
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)

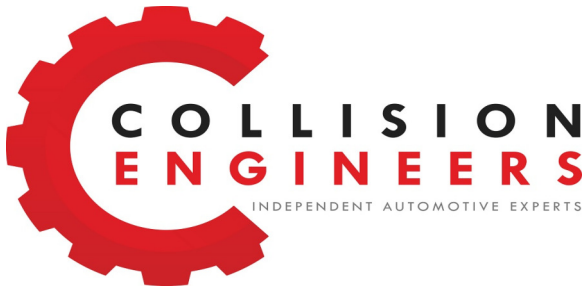

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

Repair Cost Calculations

Hours	64.62
Hourly Rate	£80.00
Total Labour	£5,169.60
Parts	£6,112.69
Paint/Materials	£1,911.02
Specialist/Other	£1,095.00
Sub total	£14,288.31
Vat	£2,857.66
Total Estimated Cost	£17,145.97

