

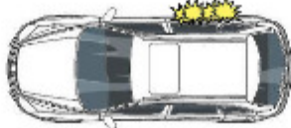
QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 06/05/2026
Our Ref: 00035775/MATTG
Your Ref: 45143

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Ms. Angela Feetham**

We refer to your instructions received on **06 May 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: NISSAN JUKE TEKNA + DIG-T		Colour: WHITE	Speedo: 20558 Miles	
Reg No: NG22FVH	Registered: Jul 2022	Type: 5 Door Hatchback	Trans: Manual	
Vin No: SJNFAAF16U1186558	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Very Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manfd: 2022			
Brakes: Not Known	Tax Exp:			Spare Tyre Not Known
Steering: Not Known	Fuel: Petrol			Centre Belt Not Tested
Extras: Not Seen	C.C.: 999			L/H/F Belt Not Tested
Air Bags Deployed: Not Known	BHP: 112.	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Damage: Moderate Collision/Impact RH Rear Door	Incident: 02/05/2026			
Vehicle Value: £15,019.00		Repair Cost: £3,861.70 inc VAT (25.71% of PAV)	Roadworthy: Yes	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand rear door.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

VEHICLE HISTORY CHECK

06/05/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:- R/R Door, R/R Door Seal, R/R Door Clamp Kit, R/R Door Front Strip, Panel Sundries, Car Care Kit, Glass Lifting Tape, Sundry Parts



Repaint only parts:-Two Coat Metallic, R/R Door New Part Painting, De Nib & Polish. Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Adas Methods, Geometry Check, Epa, Corrosion Protection Materials External

Blend only parts:-R/F Door Out Handle Surface Paint Plast., R/Door Mirror Hsg Surface Paint Plast., R/F Door Lower Sect Surface Paint, R/R S-Panel Lwr Pr Surface Paint, Fuel Filler Flap Surface Paint Plast.

Remove And Refit parts:-Description, Right Front Door Trim, Right Front Door Outer Handle, Right Mirror, R/F Lower Door Moulding, Renew R/R Door, Rear Wheelhouse Mldg Remove And Refit, Fuel Flap, Corrosion Prote To 1St Panel

Parts to check:-R/R Wheel, R/R Tyre, Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Est Pre Wash

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,199.23. The cost of the paint and materials would be £799.50, The cost of the replacement parts would be approximately £980.45, The specialist/sundry charges would be £238.90, and the VAT liability on the total would amount to some £643.62 giving a total repair cost of £3,861.70 including VAT **subject to undisclosed damage**. The labour charge is based on 14.4 hours at a rate of £83.28 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in very good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 26/07/2022. The corresponding Cazana Guide (model code: 6023571) adjusted retail value for vehicles of this type and age in the May 2026 guide is £15,019.00 at 20558 Miles, trade value is £11,565.00 and mid value is £13,292.00. We place the pre-accident value of this particular vehicle at £15,019.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £3,875.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy.

The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

DR .

Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors



1_CLVFront-V1.jpg



2_CLVRear-V1.jpg



2_VIN-V1.jpg



3_CLVDamage-V1.jpg



Mileage-V1.jpg



4_CLVDamage2jff-V1.jpg



5_CLVDamage3jff-V1.jpg



6_CLVDamagejff-V1.jpg

