

TABLE OF CONTENTS

TABLE OF CONTENTS 1

1- TEST EQUIPMENT REQUIRED 2

2- HARDWARE SETUP 2

3- VOLTAGE ADJUSTMENT 2

4- TROUBLESHOOTING 3

5- SYSTEM RESTORATION 3

REVISION HISTORY 4

Description- Contains adjustment procedure for the Backplane Power Supply.

1- TEST EQUIPMENT REQUIRED


1. Digital Multimeter

2- HARDWARE SETUP

1. Remove the front and rear cover to the System Cabinet.

3- VOLTAGE ADJUSTMENT

1. Using a DMM (Digital Multimeter), connect the leads to the appropriate TYME II Module front panel test points (see Illustration L4759a).

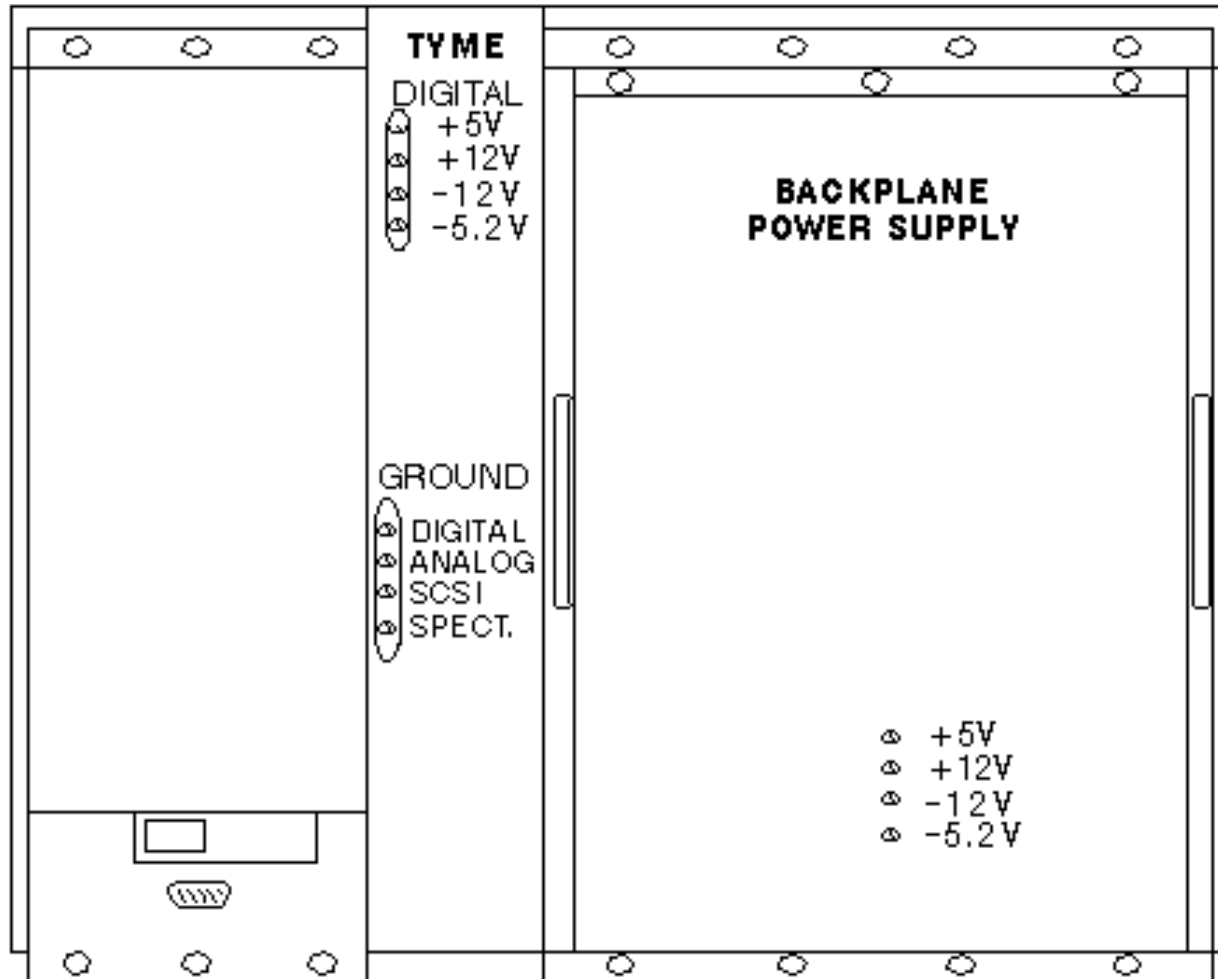

L4759A

BACKPLANE TEST POINTS AND ADJUSTMENT LOCATIONS
ILLUSTRATION L4759A

Adjust voltage with appropriate potentiometer per specifications (refer to Table 1).

TABLE 1
ISE CHASSIS/BACKPLANE POWER SUPPLY ADJUSTMENT

	<u>Adjustment Location</u>	<u>Magnitude</u>	<u>Limits</u>	
<u>Voltage</u>	<u>Measurement Location</u>	<u>Tolerance</u>	<u>High</u>	<u>Low</u>
+5V	ISE Chassis Rear (see Note 2) TYME II "Digital +5V" to " Digital GND"	+5%/–2.5%	+5.25	+4.875
–5.2V	ISE Chassis Rear TYME II " Digital –5.2V" to " Digital GND"	+5%/–2.5%	–5.46	–5.07
+12V	ISE Chassis Rear TYME II " Digital +12V" to " Digital GND"	+5%/–3%	+12.60	+11.64
-12V	ISE Chassis Rear TYME II " Digital –12V" to " Digital GND"	+5%/–3%	–12.60	-11.64
1.All measurements to be performed with CB1 (Main), CB2 (TPS), and CB3 (HOST–CPU SCSI) breakers in the On position.				
2. On rear of Backboard Power Supply.				

4- TROUBLESHOOTING

If the ISE Backplane power supply needs to be changed out, and power is applied to the ISE Chassis, a TPS Reset is required. On occasion, this reset fails, and an error message will be generated indicating that the CERD is not present. If the CERD is present when this error occurs, try powering down the chassis, and reset the CERD and IPG board, even if it appears that the board is seated properly. In most cases, this will eliminate the error.

5- SYSTEM RESTORATION

1. Remove DMM leads from TYME II Module front panel test points.
2. Install the front and rear cover to the System Cabinet.

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
0	June 2, 1998	J. Saperstein	Initial Conversion from Toolbook to Word.