

TABLE OF CONTENTS

TABLE OF CONTENTS 1

1- FRONT END BELL REMOVAL 2

 1-1 Front End Bell Removal 2

REVISION HISTORY 5

Description - Procedures for removing the front end bell.

1- FRONT END BELL REMOVAL

1-1 Front End Bell Removal

1. Lock out and tag out circuit breaker MR1 A14 CB6 at rear of RF/Pen Cabinet (MR1) on magnet enclosure power supply (MEPS) module.

For **RF/Pen II** and **RF/PDU Cabinet**: Lock out and tag out circuit breaker MR1 A20 CB4 at rear of RF/Pen II and RF/PDU Cabinet on System Support Module (SSM).


(Refer to CD-ROM *Dir. 2187583-3 [or -2], MR Release Signa 5x/8x Service Methods, Renewal Parts and Service Tools*, Procedure for Safety, Section 6, OSHA LOCKOUT/TAGOUT REQUIREMENTS.)

2. Verify that voltage between MR1 A14 TP4 (+) and TP13 (–) is 0 Vdc.

For **RF/Pen II** and **RF/PDU Cabinet**, verify that voltage between MR1 A20 TP4 (+) (SRI+24V) and TP13 (–) (SRI RTN) is 0 Vdc.


3. Remove bridge. See procedure for Bridge Removal Open Enclosure (ME2REA7.DOC).
4. Remove control panels. See procedure for Control Panel Replacement Open Enclosure (ME2REA10.DOC) steps 1-1-3 through 1-1-4.

5. Remove front enclosure covers. See Illustration 1-1.

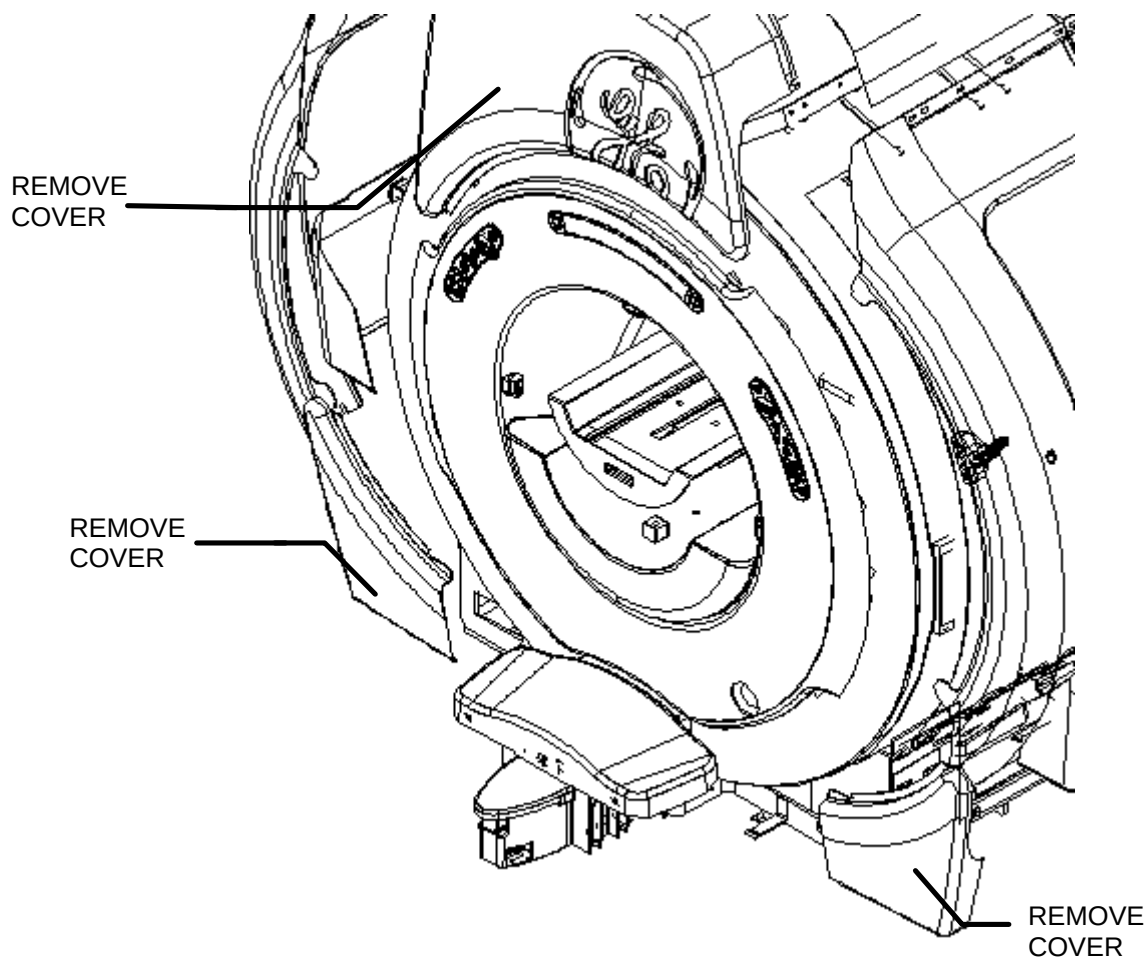

FRONT VIEW ENCLOSURE
ILLUSTRATION 1-1

6. Lift open (2) two latches connecting front end bell and rf tube. See Illustration 1-2.
7. Remove M6 allen cap screw and phenolic spacer. See Illustration 1-2.

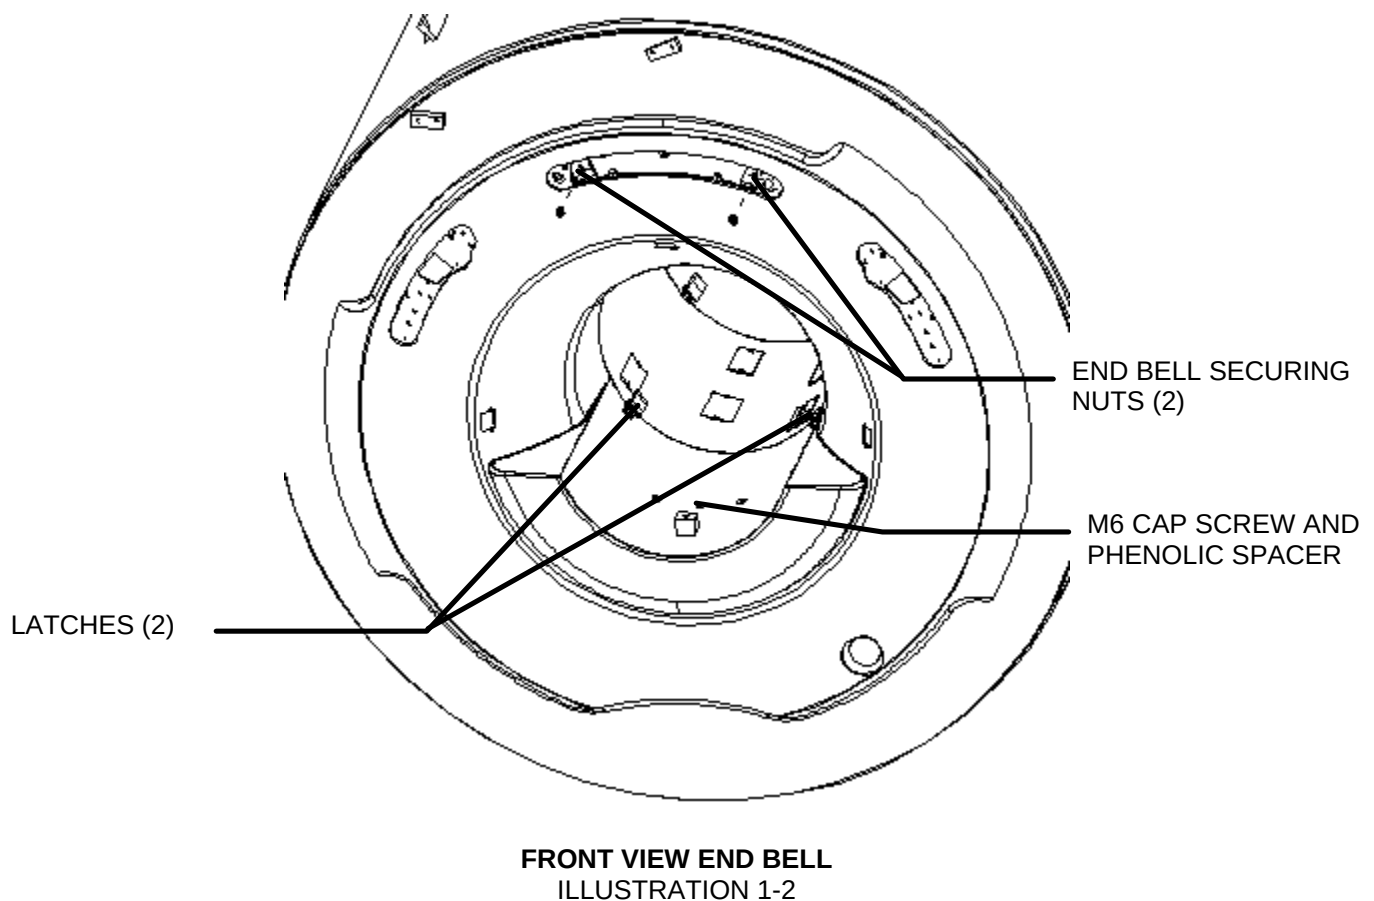

7. Remove (2) two 17mm nuts holding front end bell on. See illustration 1-2.
8. Remove front end bell by pulling top out past studs, then lifting vertically to clear end bell inserts, then pulling out the rest of the way.
9. Reverse procedure to reinstall new endbell. Be sure to follow gap specifications in step 10.
10. All enclosure component seams and gaps visible to the operator and patient shall be less than 0.25 inches (6.35 mm). Exceptions may be made in areas where esthetic visual enhancement of the component gap is required by industrial design.
The gap at the seam between the enclosure and RF coil shall not exceed 0.125 inches (3.175 mm).
Gap uniformity along any continuous seam shall be + - 0.0625 inch (1.59mm)

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
A	Nov 1, 1998	W. Pasciak	Initial revision
0	Feb 4, 1999	W. Pasciak	Final release
1	Mar 1, 1999	W. Pasciak	Added gap specification