

TABLE OF CONTENTS

TABLE OF CONTENTS	1
1- TEST EQUIPMENT REQUIRED	2
2- HARDWARE SETUP	2
3- VOLTAGE ADJUSTMENT	2
4- TROUBLESHOOTING	4
5- SYSTEM RESTORATION	4
REVISION HISTORY	5

Description- Contains adjustment procedure for the CERD Power Supply.

1- TEST EQUIPMENT REQUIRED

1. Digital Multimeter

2- HARDWARE SETUP


1. Remove the front and rear cover to the System Cabinet.

3- VOLTAGE ADJUSTMENT



Normally, turning the adjustment of a potentiometer clockwise (cw) will increase the power from a power supply; however, if the potentiometer is adjusted cw, the power actually decreases. If the pot is turned all the way cw, the power supply goes down to a minimum level, and then drops out. The only way to fix this is to remove power to the cabinet, adjust the pot to the midway point, and then reapply the power.

1. Using a DMM (Digital Multimeter), connect the leads to the appropriate TYME II Module front panel test points (see Illustration L4758A).

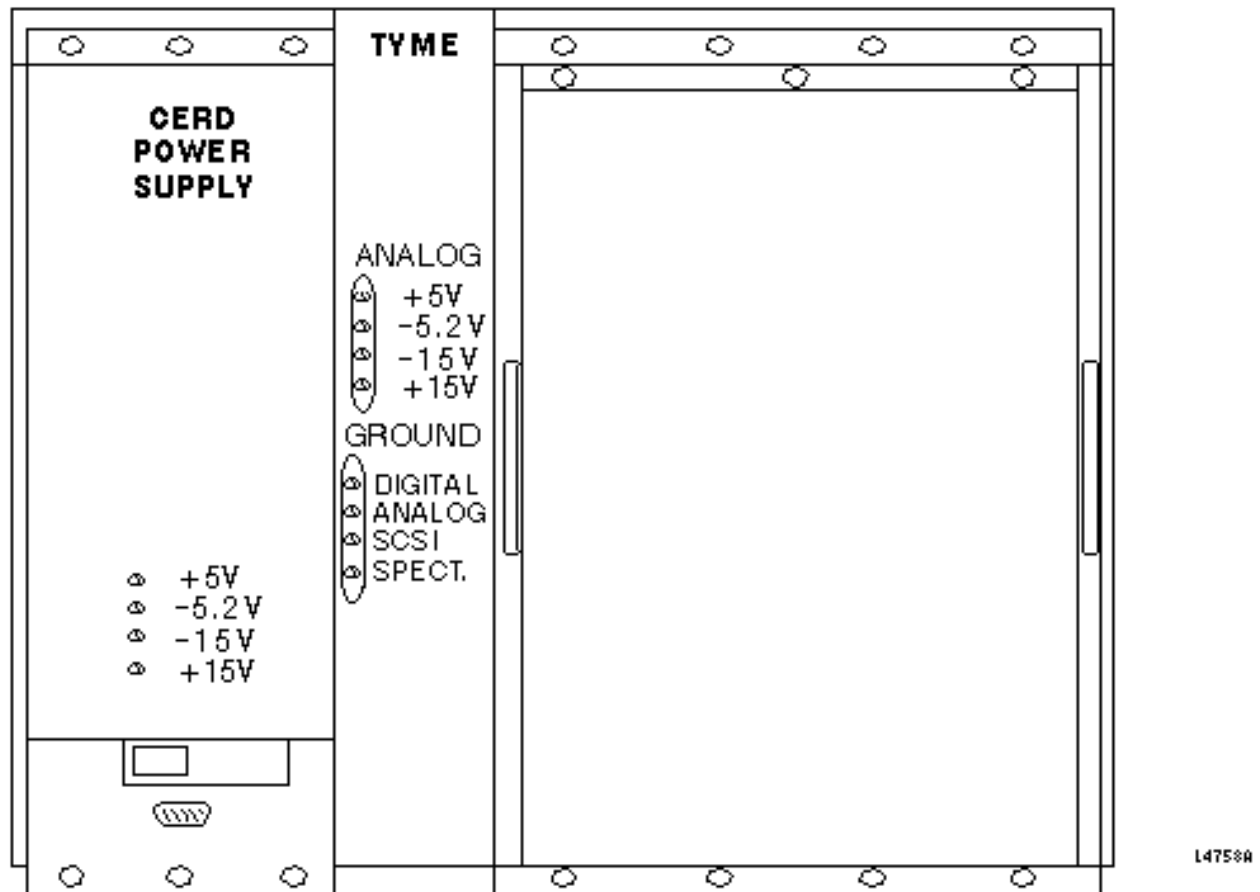

CERD POWER SUPPLY TEST POINT AND ADJUSTMENT LOCATIONS
ILLUSTRATION L4758A

Adjust voltage with appropriate potentiometer per specifications (refer to Table 1).

TABLE 1
ISE CHASSIS/CERD POWER SUPPLY ADJUSTMENT

	Adjustment Location	Magnitude	Limits	
Voltage	Measurement Location	Tolerance	High	Low
+5V	ISE Chassis Rear (see Note 2) TYME II "Analog +5V" to "Analog GND"	+5%/-2.5%	+5.25	+4.875
-5.2V	ISE Chassis Rear TYME II "Analog -5.2V" to "Analog GND"	+5%/-2.5%	-5.46	-5.07
+15V	ISE Chassis Rear TYME II "Analog +15V" to "Analog GND"	+5%/-3%	+15.75	+14.55
-15V	ISE Chassis Rear TYME II "Analog -15V" to "Analog GND"	+5%/-3%	-15.75	-14.55
1.All measurements to be performed with CB1 (Main), CB2 (TPS), and CB3 (HOST-CPU SCSI) breakers in the On position.				
2. On rear of CERD Power Supply.				

4- TROUBLESHOOTING

If the ISE Backplane power supply needs to be changed out, and power is applied to the ISE Chassis, a Reset TPS is required. On occasion, this reset fails, and an error message will be generated indicating that the CERD is not present. If the CERD is present when this error occurs, try powering down the chassis, and reset the CERD and IPG board, even if it appears that the board is seated properly. In most cases, this will eliminate the error.

5- SYSTEM RESTORATION

1. Remove DMM leads from TYME II Module front panel test points.
2. Install the front and rear cover to the System Cabinet.

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
0	June 2, 1998	J. Saperstein	Initial Conversion from Toolbook to Word.