

TECHNICAL BULLETIN



MODEL/DERIVATIVE:

All Models

Bull. N°: **0009**

CDS. ref: **R5424bu**

Issue: **1**

Date: **10.08.94**

AFFECTED RANGE:

All petrol engined vehicles fitted with MEMS E.C.U's.

PROBLEM:


E.C.U. FAILURE - WATER INGRESS

E.C.U. failure, either permanent or for a short period of time.

CAUSE:

Water ingress into E.C.U. due to various power wash operations.

The E.C.U. is designed to be splash proof only, therefore it is possible under an extreme power wash situation to force water into the E.C.U. via the casing or drain holes.

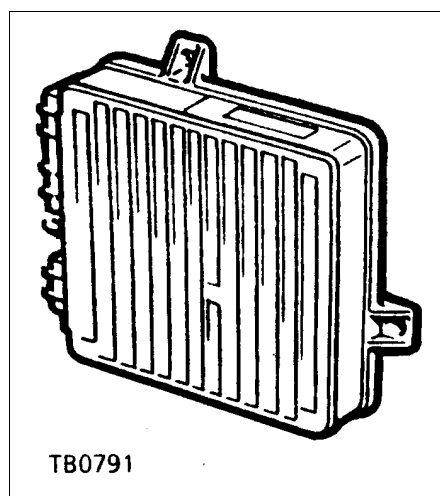

ACTION:

Inform all relevant service staff of this possibility and ensure adequate protection for the E.C.U. is provided if a power wash is used in the engine compartment.

PARTS INFORMATION:

Not Applicable

WARRANTY CLAIMS:

Not Applicable