

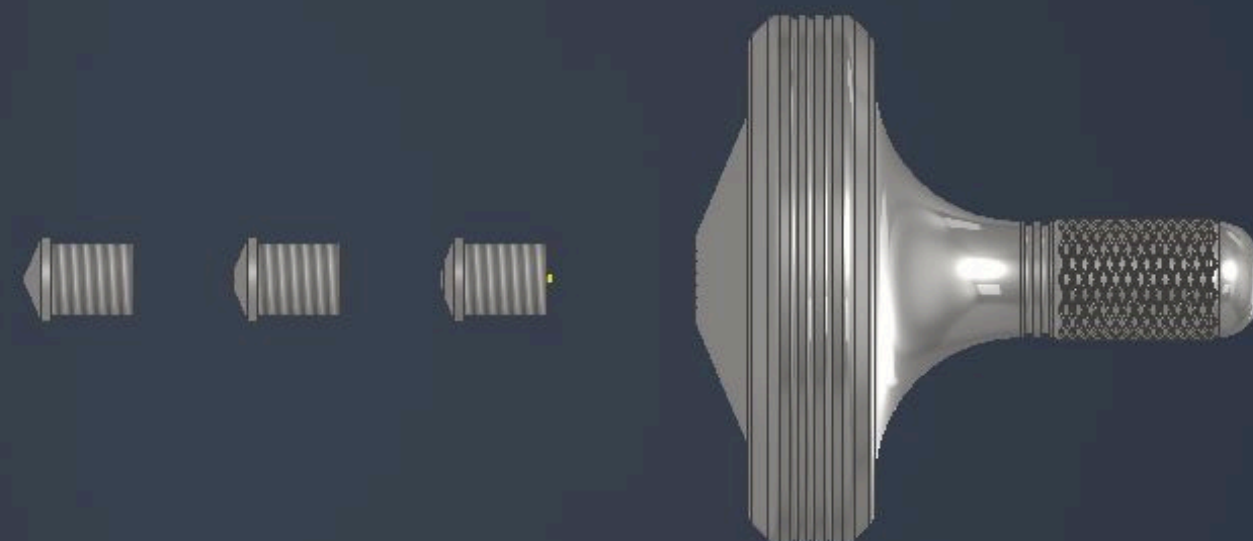
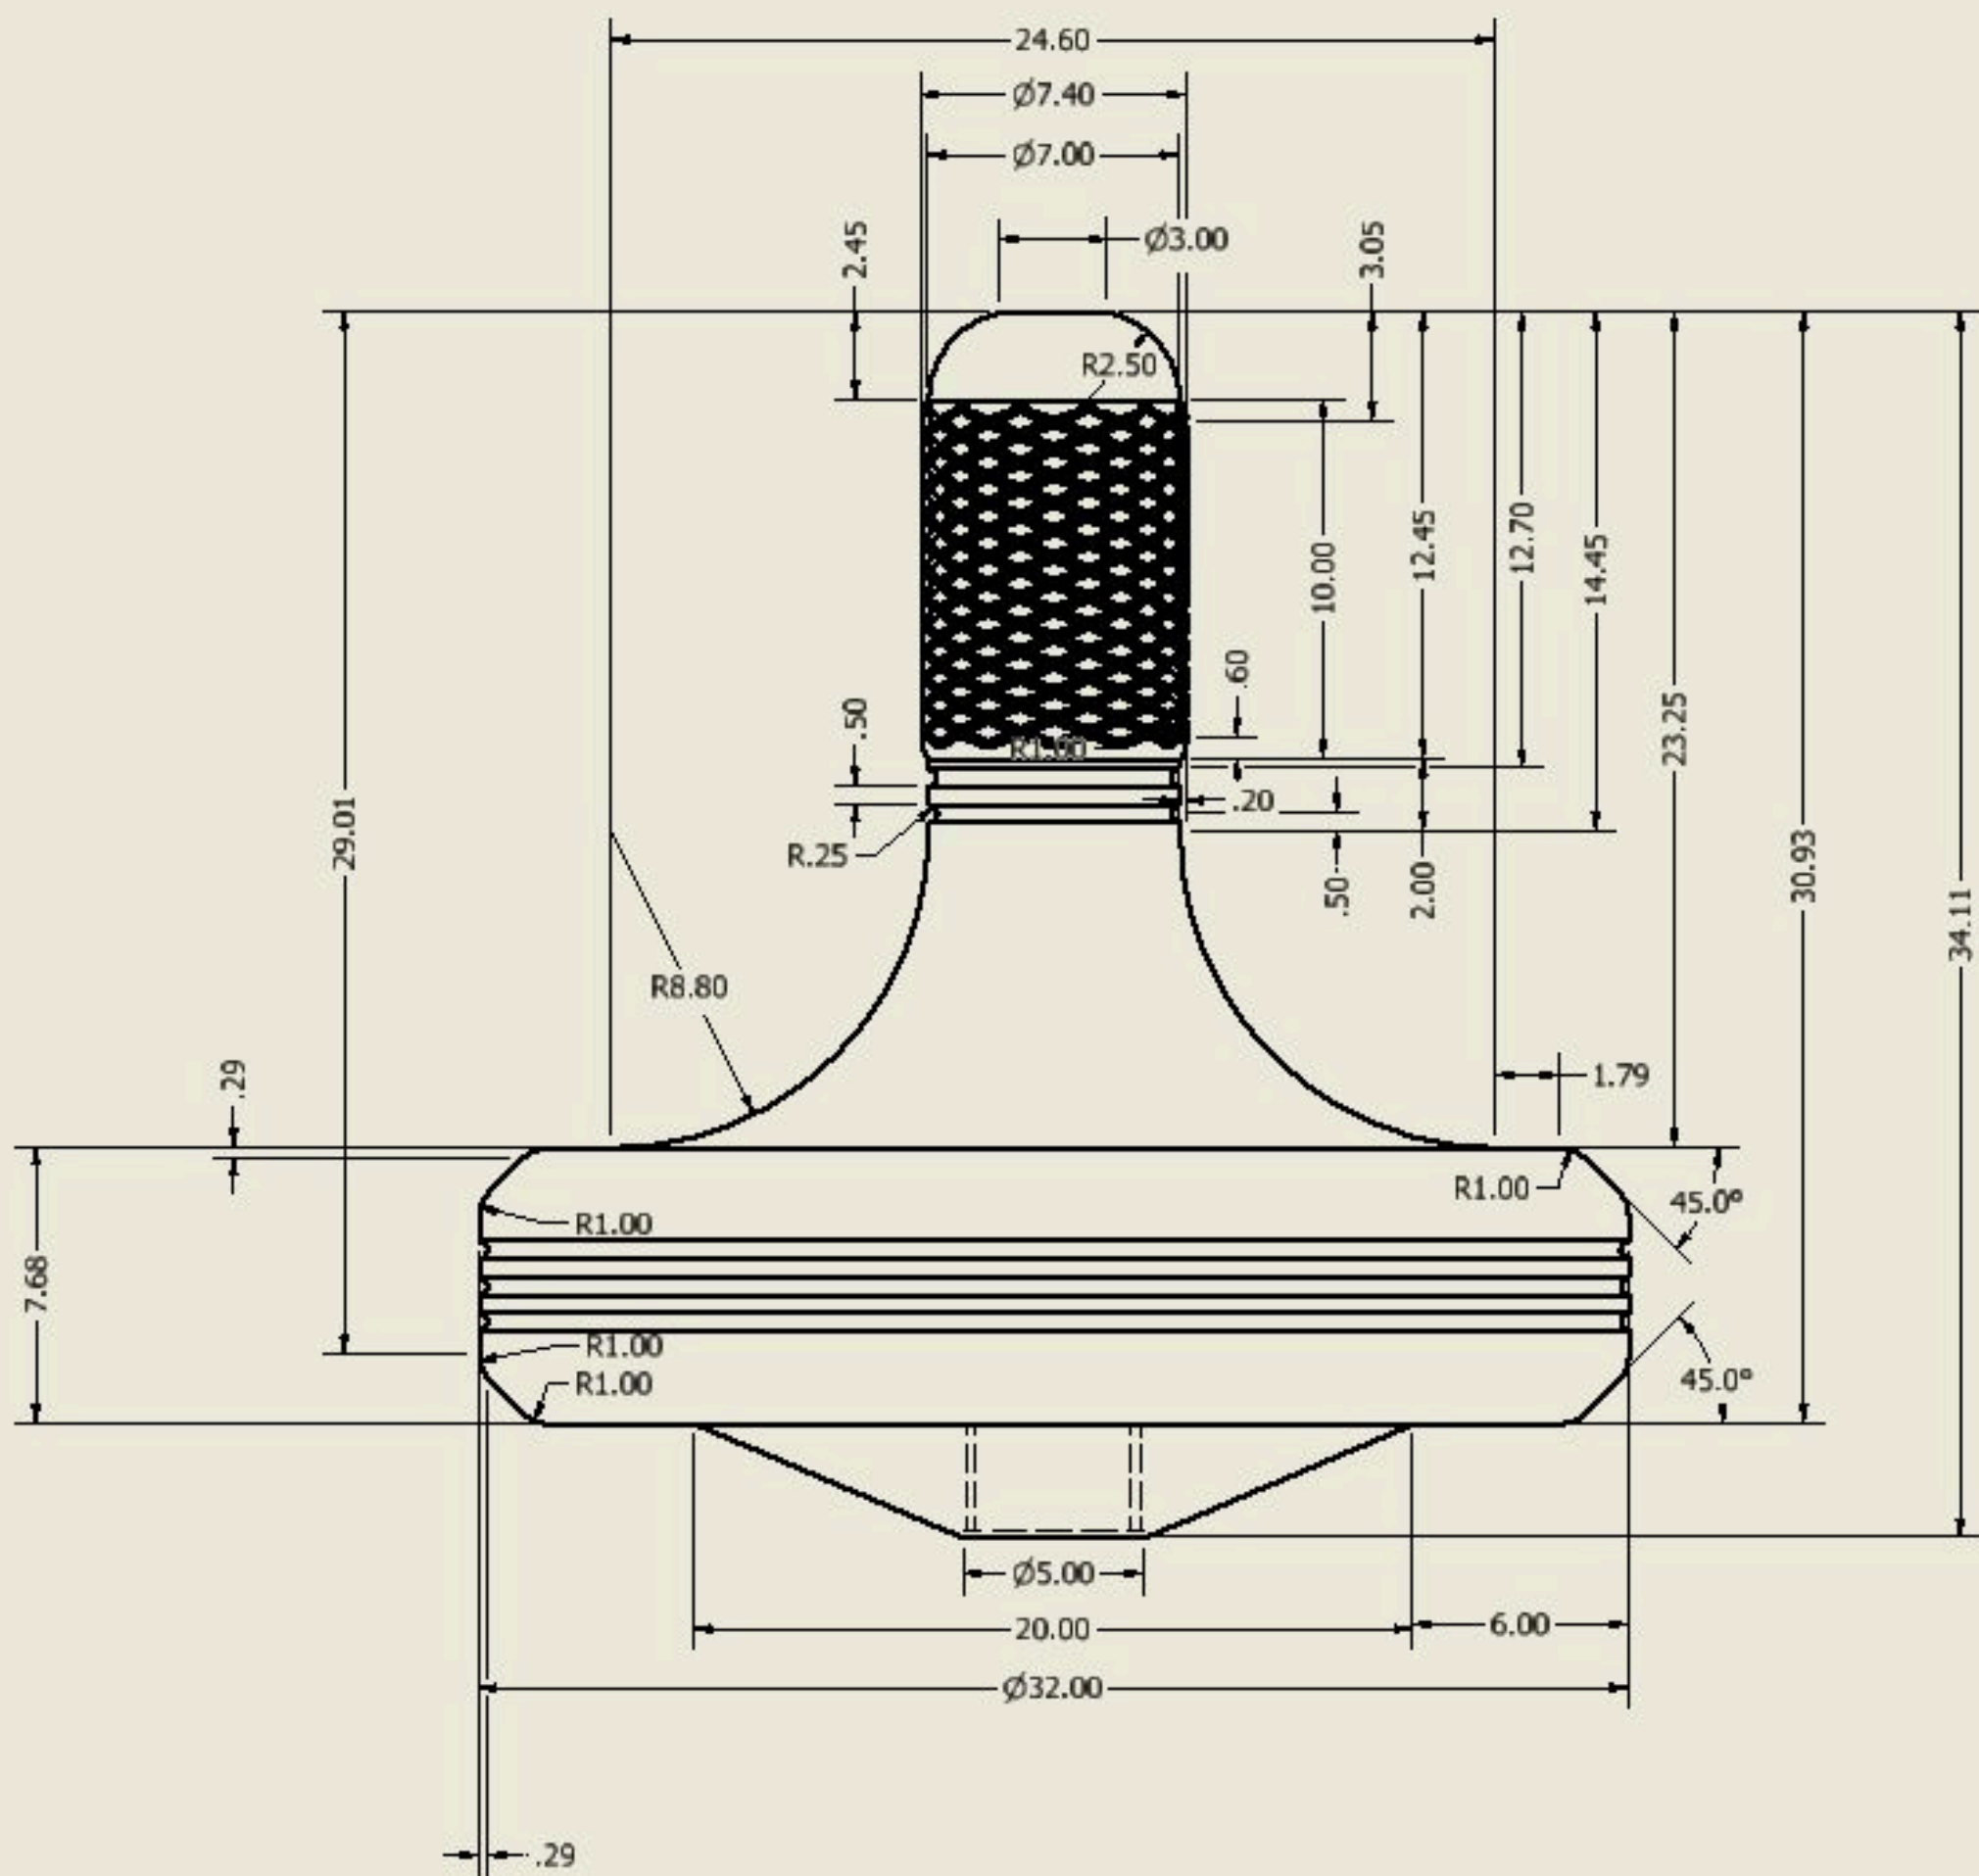


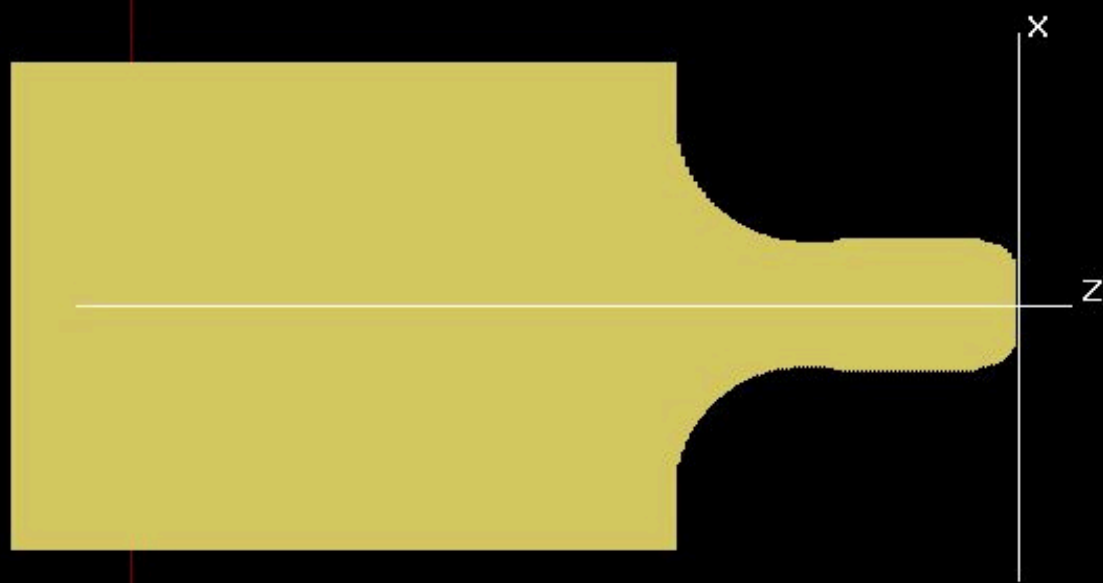

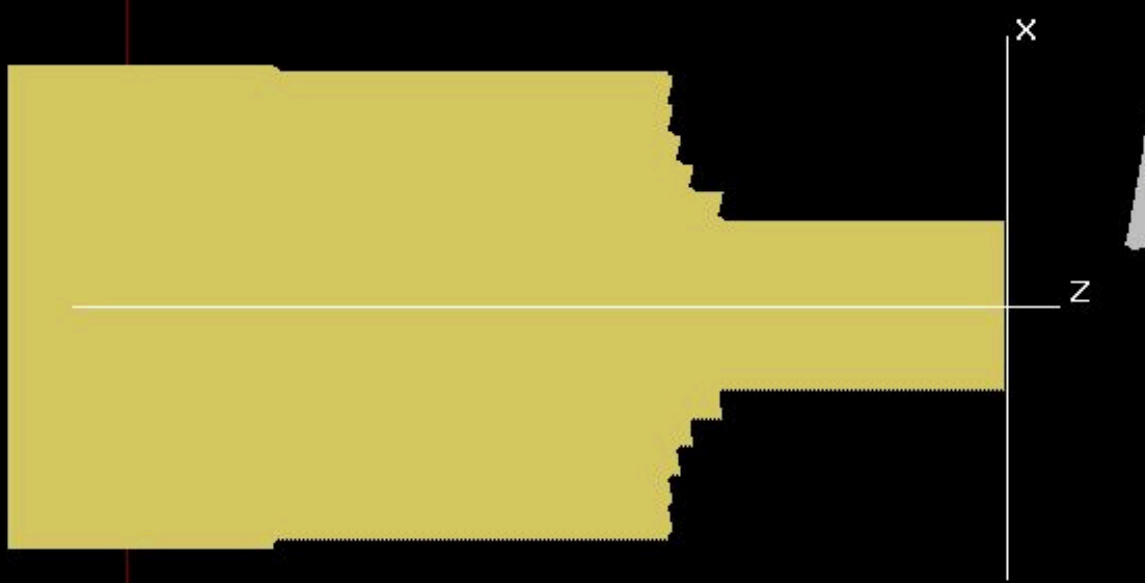

FAGOR

FAGOR AUTOMATION

IN EXECUTION

PEONZA FAO

N120

Auto 2/2

11:05:49

M3 M41

G1 G18 G95 G151

T 13 D 1

F real 0.00

F prog 0.12

Dyn 100 % 2 %

S real 350.0

S prog 350.0

100 %

Cy Time 3:22:41.23

Select program

Tool inspection

Prg being simulated

33 X-1.42 Z-0.29 R1; REDONDEO 4

390 G1 Z-30.93; COOR ABSOLUTAS

20

5 Z-34.11

5-38

30 X40

150 Z30

Command

Actual

5.000 14.663

-34.110 -32.061

Graphics type


Zoom

Dimensions

Measure

Clear screen

Colors

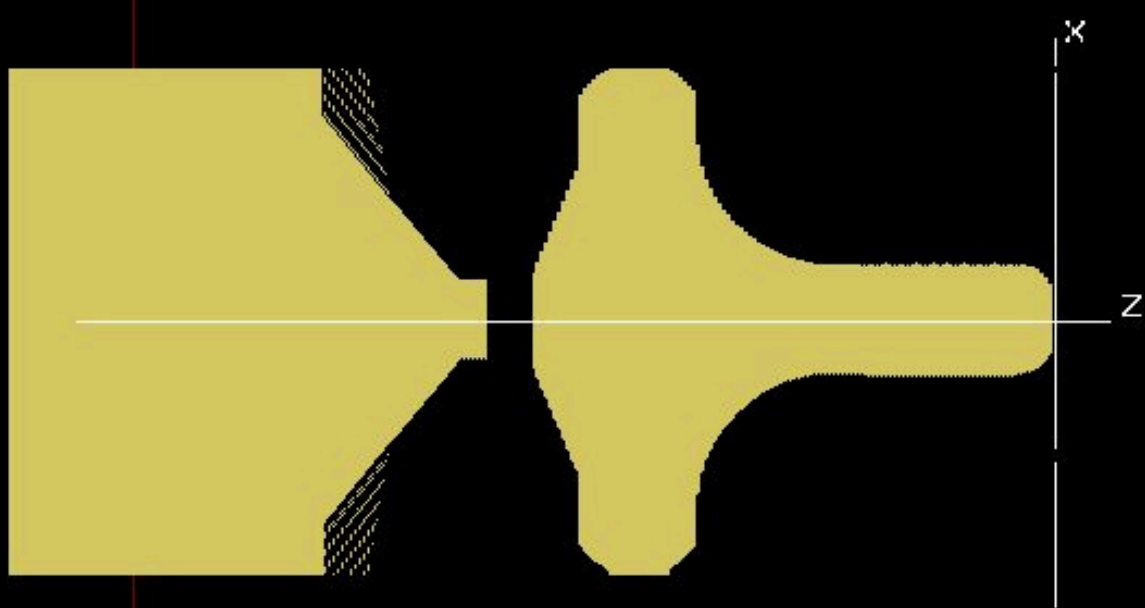

Virtual Keyboard [User: Mario] [Model: PEONZA FAO]

Keyboard

A	B	C	D	E	F
G	H	I	J	K	L
M	N	ñ	O	P	Q
R	S	T	U	V	W
X	Y	Z	< #	> \$	! ,
ESC	` =	\ 7	(8	) 9	
←	´ /	ç 4	% 5	& 6	
→	¨ *	^ 1	" 2	@ 3	
CAPS	' +	~ -	0	? .	
SHIFT	↑				
CTRL	HOME	⌂	↑	⌂	
ALT	END	←	↓	→	
CNC OFF	CALC	HELP	NEXT	FOCUS	

Virtual Jog [User: Mario] [Model: PEONZA FAO]

Jog

X+

Z+

+

↺

ZERO

WAVE

STOP

START

AUTO

MANUAL

EDIT

MDI

TABLES

TOOLS

```

#DGWZ[-60,0,0,33] ; define el bruto, así: [Z_min, Z_max, X_min, X_max]
G90 G0 G94 G97 G41 F300 S3000 X50 Z30 T1 D1 M3;F=vavance mm/min S=vcorte rpm
X38 Z0
G1 X0; REFRENTADO
G42 X32 Z2;NORMALIZAMOS LA DIMENSION RADIAL
Z-50
X35
G0 X50 Z30
G68 X3 Z0 C2 D1 L0.8 M0.1 F200 H0 S100 E200; Ciclo fijo desbaste exterior. Parte dcha.
G0 X50 Z30 T2 D1; Cambio de herramienta

X33 Z-30.93; Vamos a la posicion del ciclo fijo
;G68 X32 Z-30.93 C2 D1 L0.8 M0.1 F200 H0 S300 E400; Ciclo fijo desbaste exterior. Parte
Izda.

G0 G95 X60 Z40 F0.12 S350 T3 D1; Acabado exterior derecha (T3 D1)
X3 Z0
#RPT [N100,N120,1]
G1 Z-12.45
G03 G91 X-0.4 Z-0.6 R1; COOR INCREMENTALES
G1 Z-2
G90 G2 X24.6 Z-23.25 R8.8; COOR ABSOLUTAS, ARCO SENTIDO HORARIO
G91 X3.58; COOR INCREMENTALES
G03 X1.42 Z-0.29 R1; REDONDEO 1
G01 X1.82 Z-0.91; CHAFLAN 1
G03 X0.58 Z-0.71 R1; REDONDEO 2
G90 G1 X50
G0 Z30
G0 X50 Z30 T13 D1; CAMBIO DE HERRAMIENTA
Z-29.01; ACABADO PARTE IZQDA
G1 X32
G91 G3 X-0.58 Z-0.71 R1; INCREMENTALES, REDONDEO 3
G1 X-1.82 Z-0.91; CHAFLAN 2
G3 X-1.42 Z-0.29 R1; REDONDEO 4
G90 G1 Z-30.93; COOR ABSOLUTAS

```

```

X20
X5 Z-34.11
Z-38
G0 X40
X50 Z30
G95 G97 X10 Z-2 F0.08 S500 T7 D1; OPERACION DE MOLETEADO
G86 X7.4 Z-2.45 Q7.4 R-12.45 I0.15 B0.1 E0.01 D1 L0.01 C1 J0 A0; CICLO FIJO
ROSCADO DCHA
G1 X7.4
Z-12.45
G86 X7.4 Z-12.45 Q7.4 R-2.45 I0.15 B0.1 E0.01 D1 L0.01 C1 J0 A0; CICLO FIJO
ROSCADO IZQDA
G0 X10
X50 Z30
G90 G0 G95 G96 X50 Z30 F0.08 S150 T8 D1; CAMBIO DE HERRAMIENTA
Z-34.11
G1 G88 X5 Z-34.11 Q0 R-37 C1.5 D1 K2; REFRENTADO FINAL
Z30
G0 X50 Z30
M30
N100: G90 G03 X7 Z-2.45 R2.5; TRAYECTORIA QUE SIGUE EL CICLO FIJO
X7.4 Z-3.05 R1
N120:
G1 Z-12.45
X7 Z-13
Z-14.45
G2 X24.6 Z-23.25 R8.8
G1 X32
N150:
G0 X40
X50 Z30
N200:
N300: G90 G1 X20 Z-30.93;
X5 Z-34.11
Z-50
X50
G0 Z30
N400:

```