Mobil™

Alert

Unit ID: **5-BM-1**

Asset ID: **50074775**

Description: **Kiln 2 Ball Mil Discharge End Bearing**

Account Information

ID: **402009**

Name: **Greer Lime**

Address: **1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US**

Parent Account: **MATTHEWS LUBRICANTS, INC.**

Sample Information

Sample ID: **25147132038**

Service Level: **Essential**

Bottle ID: **a003619226**

Tested Lubricant: **MOBIL VACUOLINE 537**

Equipment Information

Asset Class: **Circulating System**

Manufacturer:

Model:

Lubricant: **MOBIL VACUOLINE 537**

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	24162579016	24330183006	25044280018	25069424007	25147132038
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a029207120	a033578292	a033584855	a003615680	a003619226
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	03 Jun 2024	13 Nov 2024	03 Feb 2025	04 Mar 2025	09 May 2025
	Reported	18 Jun 2024	27 Nov 2024	18 Feb 2025	12 Mar 2025	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed			Yes		
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	320.3	322.6	322.1	320.4	331.9
	Oxidation (Abs/cm) D7414	4	5	5	3	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	1
	Al (Aluminum)	0	0	4	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	35	32	40	14	18
	Fe (Iron)	47	46	54	16	16
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	1	1	0	0	0
	Pb (Lead)	8	7	7	3	5
	Sn (Tin)	409	360	427	112	103
Contaminant (ppm)	K (Potassium)	1	1	1	0	0
	Na (Sodium)	0	0	1	0	0
	Si (Silicon)	2	2	8	2	2
Additive (ppm)	B (Boron)	19	10	13	4	3
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	75	97	100	118	140
	Mg (Magnesium)	2	1	2	1	1
	P (Phosphorus)	293	241	282	396	393
	Zn (Zinc)	3	5	3	383	398

Viscosity

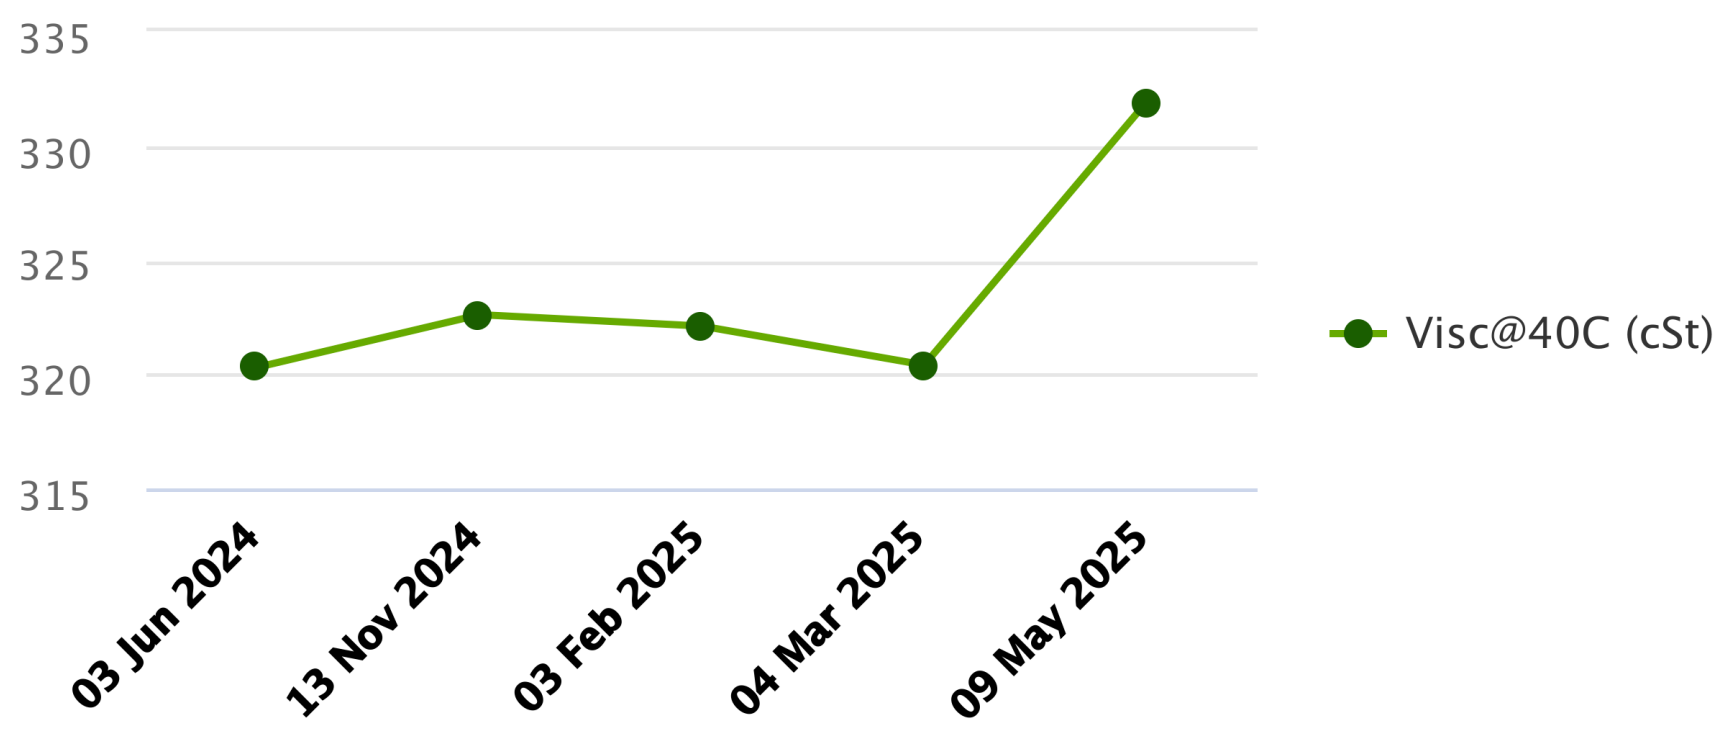

Wear

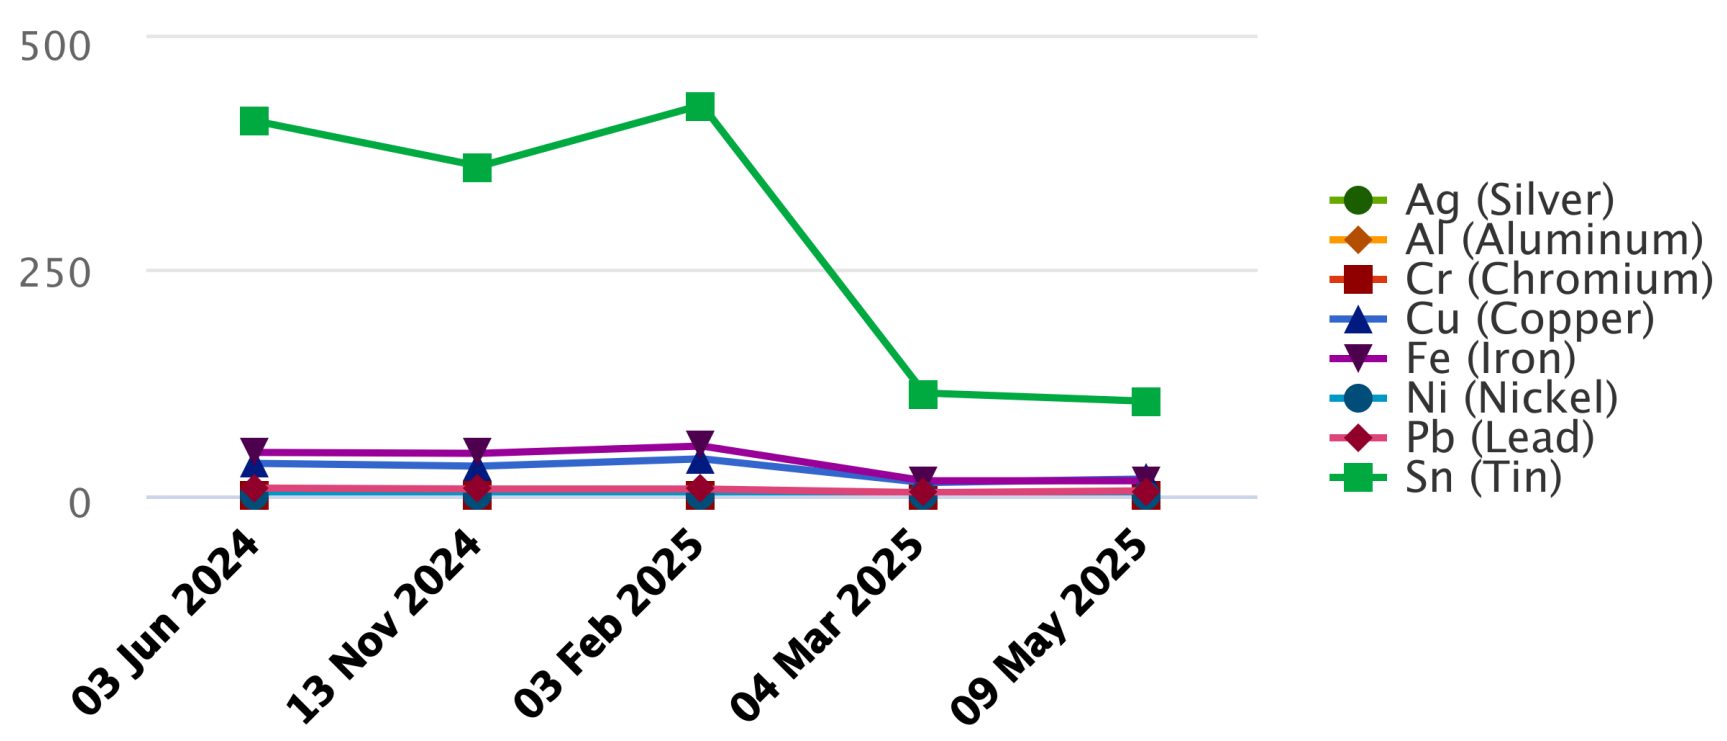

Contaminants

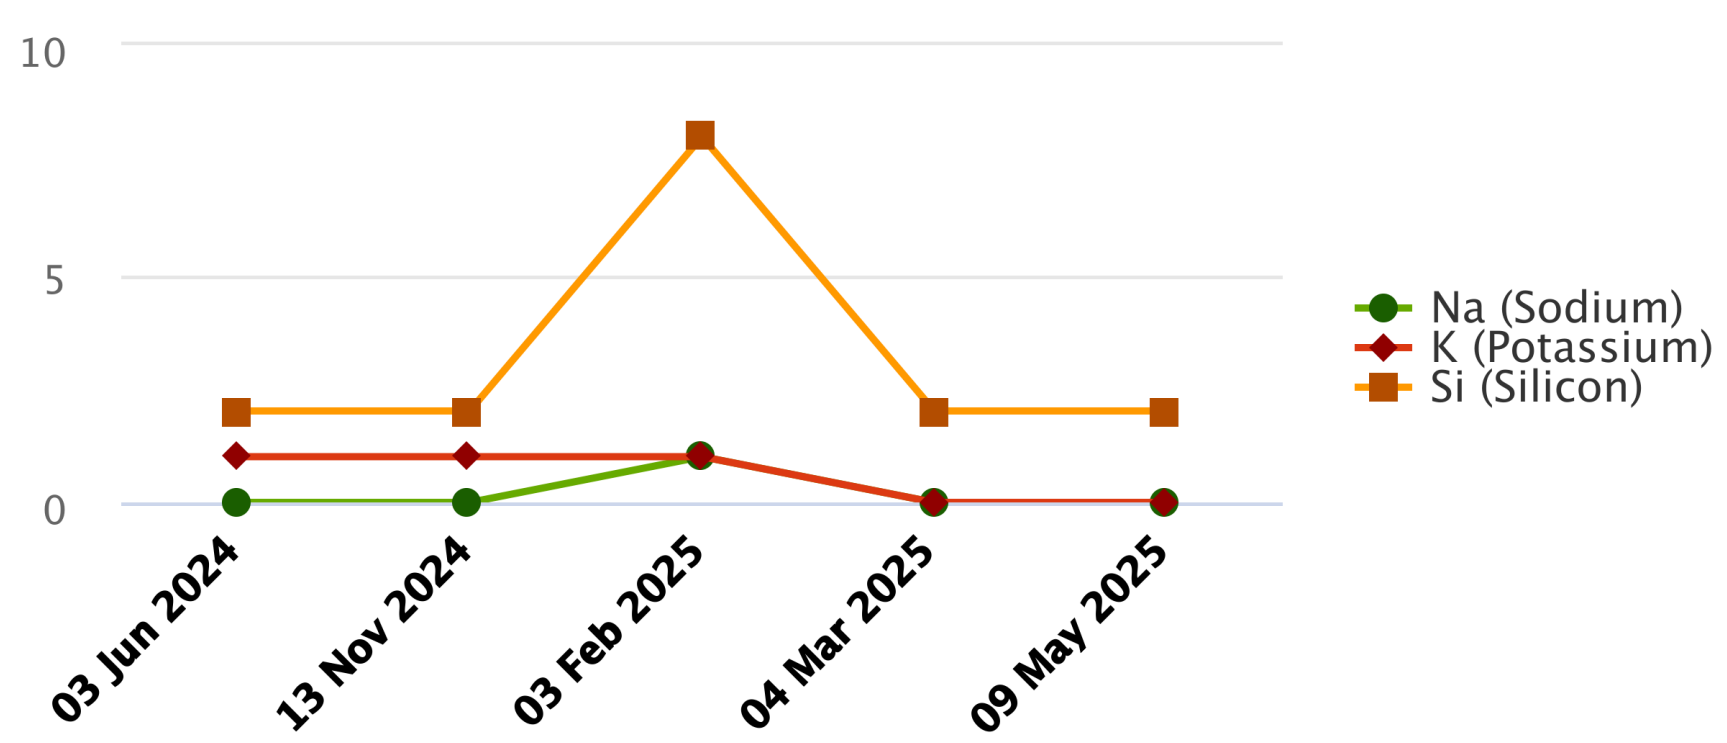

Physical Properties

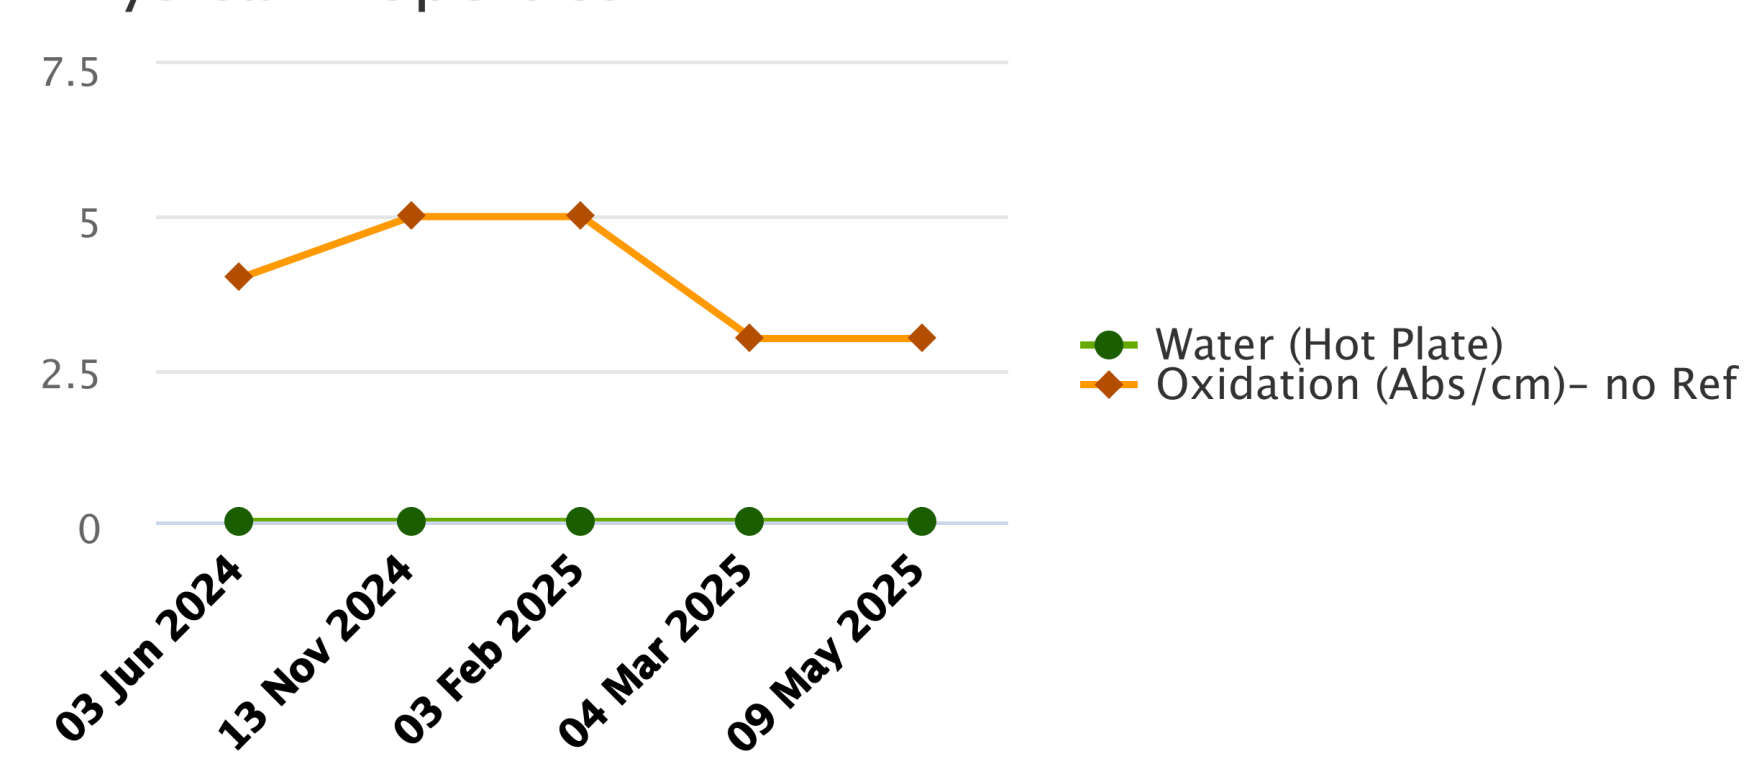

Alert	
Unit ID: **5-BM-1**	Asset ID: **50074775**
Description: **Kiln 2 Ball Mil Discharge End Bearing**	

Account Information	Sample Information	Equipment Information
ID: **402009**	Sample ID: **25147132038**	Asset Class: **Circulating System**
Name: **Greer Lime**	Service Level: **Essential**	Manufacturer:
Address: **1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US**	Bottle ID: **a003619226**	Model:
Parent Account: **MATTHEWS LUBRICANTS, INC.**	Tested Lubricant: **MOBIL VACUOLINE 537**	Lubricant: **MOBIL VACUOLINE 537**

Continued

Recommendation/Comments

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 10 May 2025 1:12 AM UTC - Brad Roy - In Service Oil Sample   Comments: Photo: