



Alert

Unit ID: 343 Asset ID: 50070646

Description: 1986 CAT LLAR 769 Truck Engine

Account Information

ID: 402009

Name: **Greer Lime**

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000
US

Parent Account: **MATTHEWS LUBRICANTS, INC.**

Sample Information

Sample ID: 25296455018

Service Level: **Essential**

Bottle ID: a037062329

Tested Lubricant: **MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)**

Equipment Information

Asset Class: **Engine**





Manufacturer: **CATERPILLAR**

Model: LLA5 769

Lubricant: **MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)**

Sample Data & Trends

Sample Info	Report Status	Alert	Normal	Alert	Alert	Alert	
	Sample ID	23264255053	24122429060	24282210043	25111104048	25296455018	
	Service Level	Essential	Essential	Essential	Essential	Essential	
	Bottle ID	a029564454	a029199991	a033554080	A035374548	a037062329	
	Tested Lubricant	MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	
	Sampled	28 Aug 2023	03 Apr 2024	25 Sep 2024	20 Feb 2025	13 Oct 2025	
	Reported	26 Sep 2023	08 May 2024	10 Oct 2024	23 Apr 2025	24 Oct 2025	
	Equipment Age	4918	5193	5820	6066	6630	
	Equipment UOM	Hours	Hours	Hours	Hours	Hours	
	Oil Age						
	Make-up Volume						
	Oil Changed	Yes	Yes	Yes	Yes	Yes	
	Filter Changed	Yes	Yes	Yes	Yes	Yes	
	Lubricant	Fuel Dilut. (Vol%)	6.17		5.42	5.55	6.34
		Contamination Rating	Alert	Normal	Alert	Alert	Alert
Equipment Rating		Normal	Normal	Normal	Normal	Normal	
Lubricant Rating		Caution	Normal	Caution	Alert	Alert	
Visc@100C (cSt)		11.3	11.7	11.2	11.0	10.7	
Oxidation (Ab/cm)		11	11	6	8	8	
Soot (Wt%)		0.76	0.79	0.57	0.55	0.69	
Water (Vol.%)		NotDetected	NotDetected	NotDetected	NotDetected	NotDetected	
Coolant Indicator		NotDetected	NotDetected	NotDetected	NotDetected	NotDetected	
Wear (ppm)	Ag (Silver)	0	0	0	0	0	
	Al (Aluminum)	3	2	1	2	2	
	Cr (Chromium)	1	1	0	0	0	
	Cu (Copper)	6	6	2	3	4	
	Fe (Iron)	30	31	11	15	21	
	Mo (Molybdenum)	40	44	37	41	42	
	Ni (Nickel)	0	1	0	0	1	
	Pb (Lead)	15	19	2	3	2	
	Sn (Tin)	1	3	0	0	1	
	Ti (Titanium)	0	1	0	0	0	
Contaminant (ppm)	K (Potassium)	0	0	0	0	0	
	Na (Sodium)	4	5	2	2	3	
	Si (Silicon)	6	5	5	5	5	
	V (Vanadium)	0	0	0	0	0	
Additive (ppm)	B (Boron)	39	51	41	54	50	
	Ba (Barium)	1	1	0	0	0	
	Ca (Calcium)	1664	1997	1634	1560	1649	
	Mg (Magnesium)	460	582	471	507	519	
	P (Phosphorus)	798	908	777	761	792	
	Zn (Zinc)	830	1014	854	857	894	

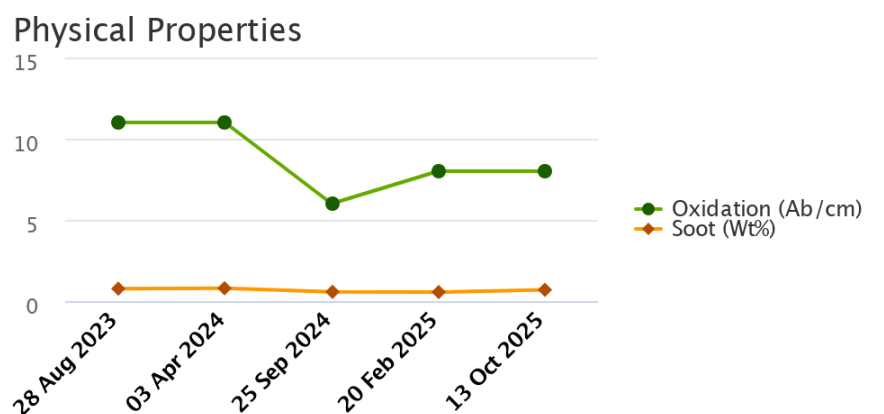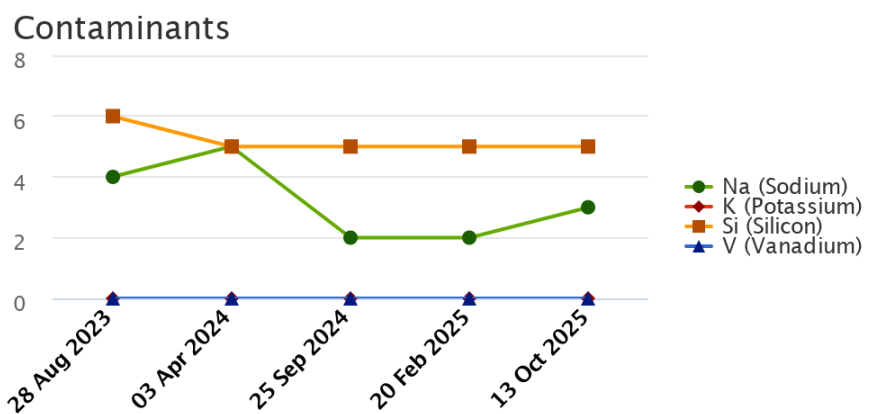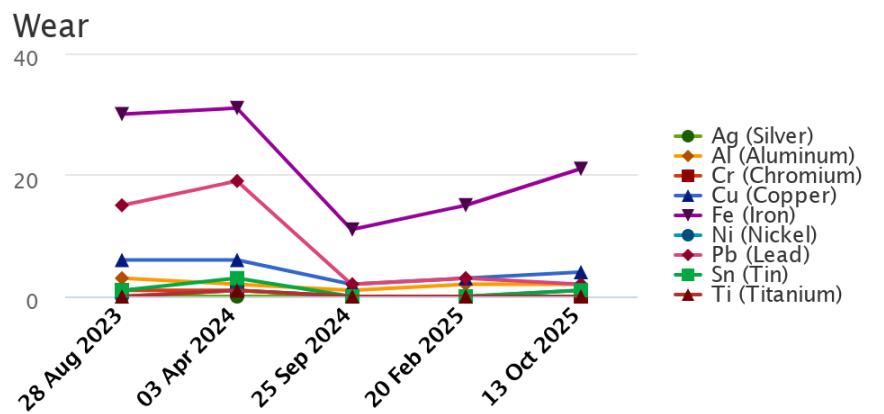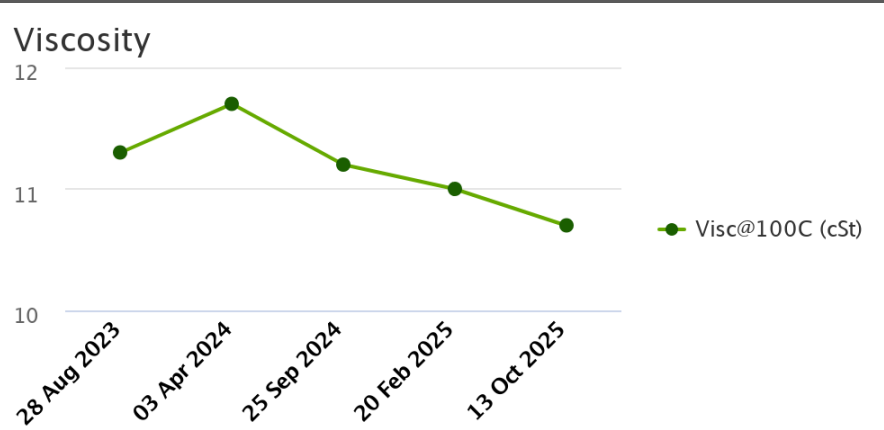

	Alert	
	Unit ID: 343	Asset ID: 50070646
	Description: 1986 CAT LLAR 769 Truck Engine	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25296455018 Service Level: Essential Bottle ID: a037062329 Tested Lubricant: MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)	Asset Class: Engine Manufacturer: CATERPILLAR Model: LLA5 769 Lubricant: MOBIL DELVAC 1300 SUPER 15W-40 (CK-4)
Continued		
Recommendation/Comments		

ACTION REQUIRED - OIL DILUTED WITH FUEL. Determine cause of excess fuel in the oil and take corrective action. If the fuel level in the oil is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Some possible causes of fuel presence in oil for DIESEL engines include: a. Leaking fuel lines; b. Defective spray patterns; c. Dribbling injector; d. Leaking transfer pump seals; e. Worn injection pump; f. Worn injector o-rings. Some possible causes of fuel presence in oil for GASOLINE engines include: a. High float level; b. High pump pressure; c. Faulty choke; d. Worn carburetor jets; e. Leaking fuel pump; f. Faulty ignition. Some possible causes of fuel presence in oil for any engine (DIESEL or GASOLINE) include: a. Poor crankcase ventilation; b. Low engine operating temperatures; c. Excessive idling; f. Low compression. Inspect the system for signs of fuel or coolant ingress. Resample the oil after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - REDUCED OIL VISCOSITY. Determine cause of reduced oil viscosity and take corrective action. Oil contamination with fuel is the most frequent cause of reduced oil viscosity. If fuel is not detected in the oil or if the system is not an engine, possible causes of reduced viscosity include: a. Contact with oil that has a lower viscosity; b. Contamination with a hydraulic fluid or automatic transmission oil; c. Incorrectly labeled sample. Inspect the system for signs of fuel or coolant ingress. Resample the oil after corrective actions have been implemented. If the condition continues or escalates, recharge the system with new oil. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 13 Oct 2025 3:16 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: