

Mobil™

Alert

Unit ID: 4-RK-2

Asset ID: 50074737

Description: Kiln 1Drive Primary Gear Box

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25147288007

Service Level: Essential

Bottle ID: a003618697

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Gear Drive





Manufacturer: FALK (REXNORD)

Model: 2140Y3

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Normal	Alert	Alert
	Sample ID	22179101031	24162579018	24205294024	24330183023	25147288007
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a018016363	a003618093	a030135899	a033564801	a003618697
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	22 Jun 2022	03 Jun 2024	16 Jul 2024	13 Nov 2024	18 May 2025
	Reported	13 Jul 2022	18 Jun 2024	29 Jul 2024	27 Nov 2024	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Alert	Alert
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Alert	Alert
	Visc@40C (cSt)	314.8	324.9	325.8	228.9	224.2
	Oxidation (Ab/cm)	1				
	Oxidation (Abs/cm) D7414		5	5	3	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	1	0	1	0	3
	Fe (Iron)	17	35	44	9	9
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	1	0	0	0
	Pb (Lead)	1	0	0	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	0	3	2	1	0
	Na (Sodium)	2	2	3	0	0
	Si (Silicon)	4	4	7	24	23
Additive (ppm)	B (Boron)	1	1	0	0	3
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	97	102	115	11	19
	Mg (Magnesium)	0	1	1	0	1
	P (Phosphorus)	396	399	422	454	432
	Zn (Zinc)	476	463	475	46	53

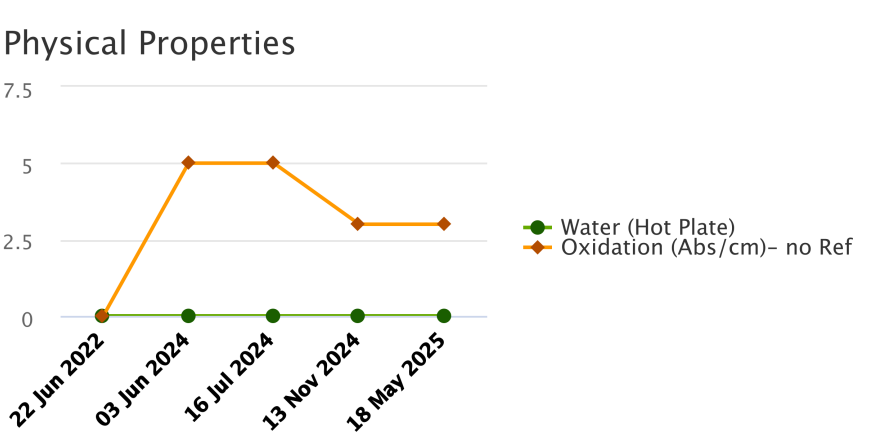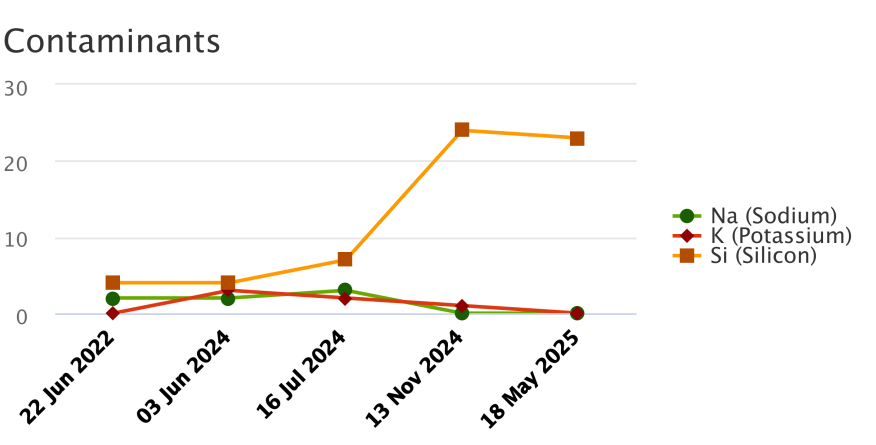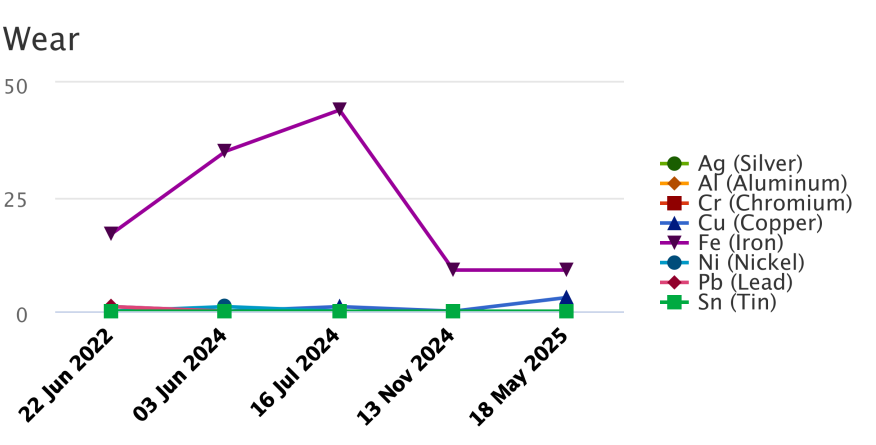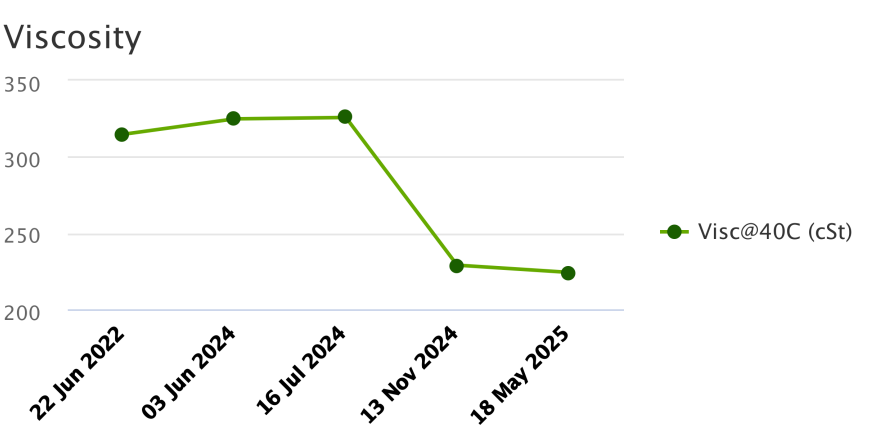

		Alert	
		Unit ID: 4-RK-2	Asset ID: 50074737
		Description: Kiln 1Drive Primary Gear Box	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25147288007	Asset Class: Gear Drive
Name: Greer Lime		Service Level: Essential	Manufacturer: FALK (REXNORD)
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a003618697	Model: 2140Y3
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL VACUOLINE 537	Lubricant: MOBIL VACUOLINE 537
Continued			
Recommendation/Comments			

ACTION REQUIRED - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If the wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metals levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt; b. Contamination from environment during an equipment overhaul or shutdown. Other possible sources of silicon include: a. Inefficient or leaking air intake filters; b. Leaking pipes; c. Clogged oil bath air filter; d. Poor oil filtration; e. Dirty sample containers or improper sampling procedures. In landfill gas applications, silicon can enter the engine as a siloxane. This material is a gas and is not normally abrasive; however, siloxanes can easily mask the presence dirt. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear and change the oil immediately if damage is detected. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - REDUCED OIL VISCOSITY. Determine cause of reduced oil viscosity and take corrective action. Oil contamination with fuel is the most frequent cause of reduced oil viscosity. If fuel is not detected in the oil or if the system is not an engine, possible causes of reduced viscosity include: a. Contact with oil that has a lower viscosity; b. Contamination with a hydraulic fluid or automatic transmission oil; c. Incorrectly labeled sample. Inspect the system for signs of fuel or coolant ingress. Resample the oil after corrective actions have been implemented. If the condition continues or escalates, recharge the system with new oil. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 18 May 2025 5:42 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: