

MobilTM

Unit ID: 4-RK-2

Asset ID: 50074745

Description: Kiln 1 Drive Trunion Bearing 2

Caution

Account Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information

Sample ID: 25147288004

Service Level: Essential

Bottle ID: a003620081

Tested Lubricant: MOBIL SHC 636

Equipment Information

Asset Class: Circulating System





Manufacturer:

Model:

Lubricant: MOBIL SHC 636

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Normal	Caution
	Sample ID	24047458002	24162579024	24205294022	24330183014	25147288004
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a022891544	a003622387	a003617644	a033579090	a003620081
	Tested Lubricant	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636
	Sampled	07 Feb 2024	03 Jun 2024	16 Jul 2024	13 Nov 2024	18 May 2025
	Reported	21 Feb 2024	18 Jun 2024	29 Jul 2024	27 Nov 2024	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed			Yes		
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Alert	Alert	Alert	Normal	Caution
	Visc@40C (cSt)	787.2	786.6	790.2	741.0	755.4
	TAN (mg KOH/g)	0.39	0.40	0.39	0.41	0.40
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	17	10	17	5	10
	Fe (Iron)	4	2	3	1	3
	Mo (Molybdenum)	0	2	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	6	3	4	1	3
	Sn (Tin)	1	0	0	0	1
Contaminant (ppm)	K (Potassium)	1	1	0	0	0
	Na (Sodium)	0	0	1	0	0
	Si (Silicon)	2	2	3	3	4
	B (Boron)	0	1	0	0	2
Additive (ppm)	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	12	7	10	3	8
	Mg (Magnesium)	0	0	0	0	0
	P (Phosphorus)	373	327	347	344	372
	Zn (Zinc)	1	1	0	1	1

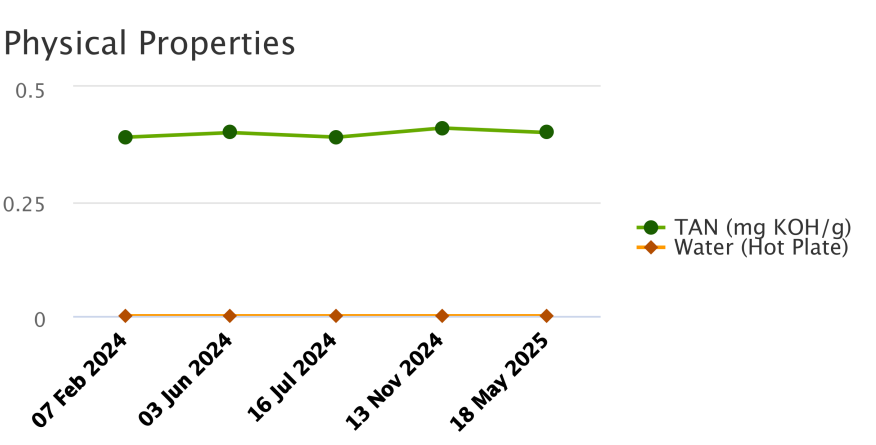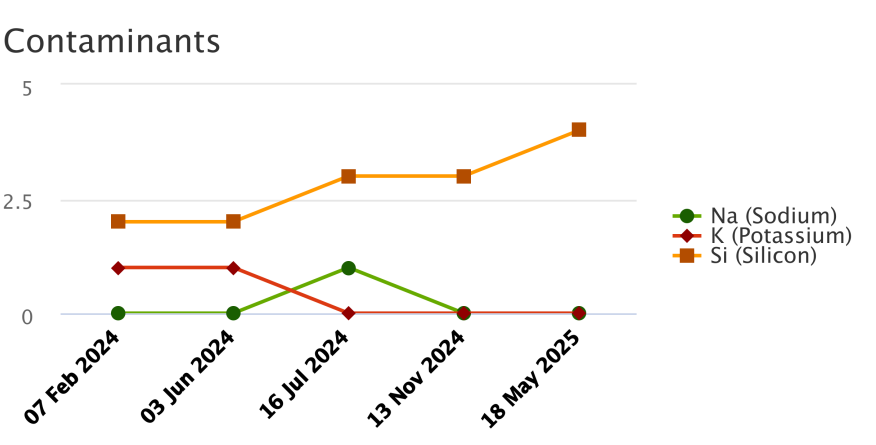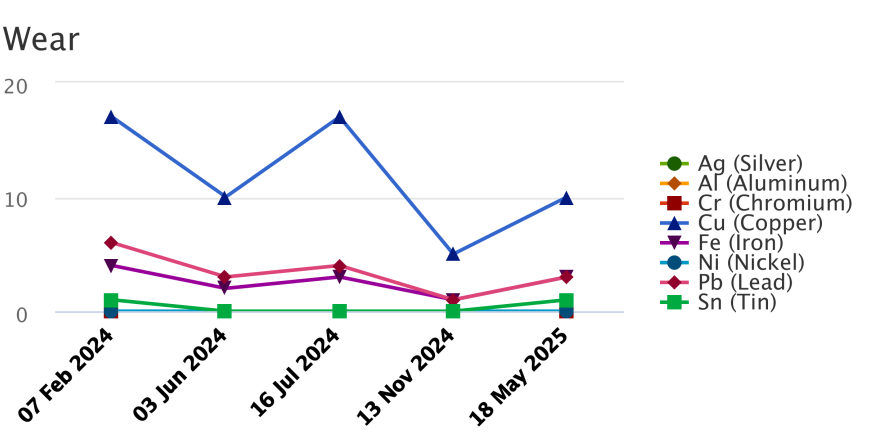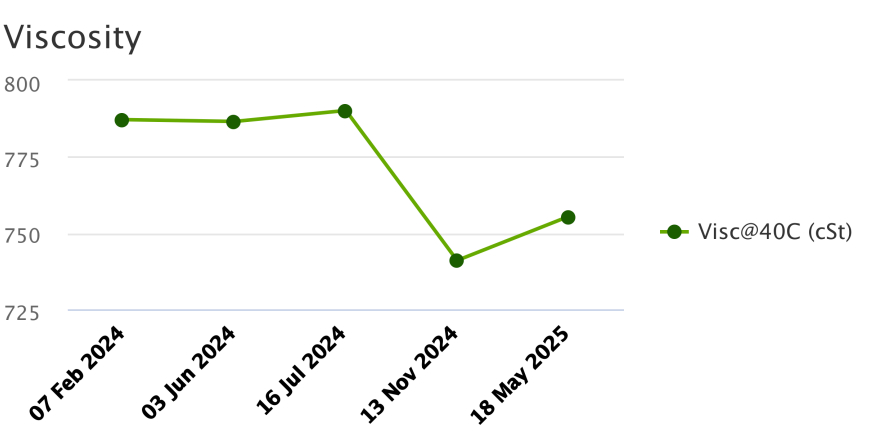

	Caution	
	Unit ID: 4-RK-2	Asset ID: 50074745
	Description: Kiln 1 Drive Trunion Bearing 2	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25147288004 Service Level: Essential Bottle ID: a003620081 Tested Lubricant: MOBIL SHC 636	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL SHC 636
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 18 May 2025 5:37 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: