

Mobil™

Unit ID: 5-BM-2

Asset ID: 50074753

Description: Kiln 1 Ball Mill Gear Box

Caution

Account Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information

Sample ID: 25147288013

Service Level: Essential

Bottle ID: a030135393

Tested Lubricant: MOBIL SHC GEAR 220

Equipment Information

Asset Class: Gear Drive





Manufacturer: FALK (REXNORD)

Model: 1090FC2

Lubricant: MOBIL SHC GEAR 220

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Caution	Normal	Caution
	Sample ID	24047458005	24068404075	24162579019	24330183020	25147288013
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030115409	a022174320	a003623010	a033582515	a030135393
	Tested Lubricant	MOBIL SHC GEAR 220	MOBIL SHC GEAR 220	MOBIL SHC GEAR 220	MOBIL SHC GEAR 220	MOBIL SHC GEAR 220
	Sampled	07 Feb 2024	28 Feb 2024	03 Jun 2024	13 Nov 2024	18 May 2025
	Reported	26 Feb 2024	15 Mar 2024	18 Jun 2024	27 Nov 2024	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Alert	Alert	Caution	Normal	Caution
	Visc@40C (cSt)	351.9	363.5	248.2	235.8	242.2
	TAN (mg KOH/g)	4.27	2.28	0.40	0.10	0.41
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	2	0	1	0	0
	Fe (Iron)	14	13	0	1	0
	Mo (Molybdenum)	2	3	2	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	1	0	1	0	0
	Sn (Tin)	1	0	2	0	0
Contaminant (ppm)	K (Potassium)	0	1	0	0	0
	Na (Sodium)	3	0	0	0	0
	Si (Silicon)	1	1	0	2	0
Additive (ppm)	B (Boron)	1	0	1	0	1
	Ba (Barium)	0	1	0	0	0
	Ca (Calcium)	106	93	3	4	3
	Mg (Magnesium)	1	1	0	0	0
	P (Phosphorus)	484	407	345	378	346
	Zn (Zinc)	471	423	6	1	7

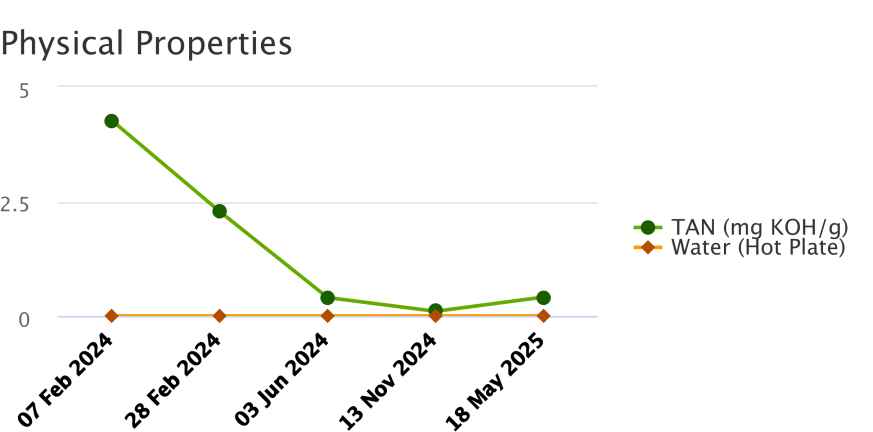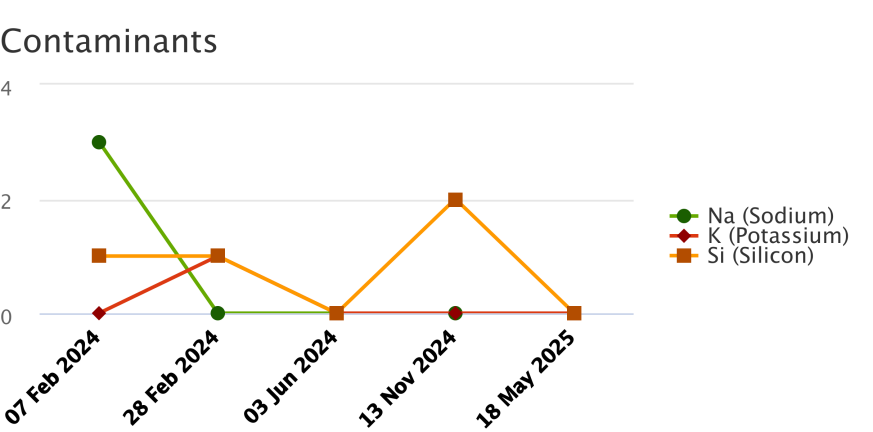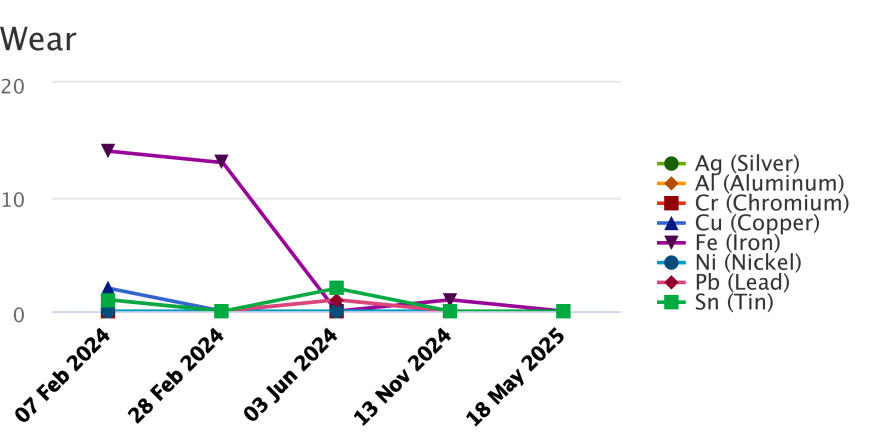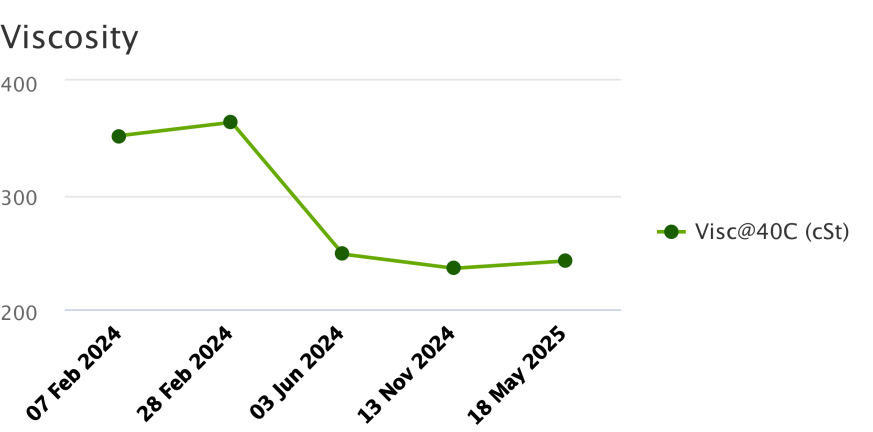

	Caution	
	Unit ID: 5-BM-2	Asset ID: 50074753
	Description: Kiln 1 Ball Mill Gear Box	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25147288013 Service Level: Essential Bottle ID: a030135393 Tested Lubricant: MOBIL SHC GEAR 220	Asset Class: Gear Drive Manufacturer: FALK (REXNORD) Model: 1090FC2 Lubricant: MOBIL SHC GEAR 220
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [18 May 2025 5:43 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: