

Mobil™

Unit ID: 4-phu-1

Asset ID: 50326099

Description: Hyd pump

Alert

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25147427031

Service Level: Essential

Bottle ID: a033685875

Tested Lubricant: QUAKER QUINTOLUBRIC 888-46

Asset Class: Hydraulic





Manufacturer:

Model:

Lubricant: QUAKER QUINTOLUBRIC 888-46

Sample Data & Trends

Sample Info	Report Status	Normal	Alert	Caution	Alert	Alert
	Sample ID	21204331062	23321203011	24162569028	24330410035	25147427031
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a022174914	a030116715	a029201556	a033578997	a033685875
	Tested Lubricant	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46
	Sampled	14 Jul 2021	09 Nov 2023	03 Jun 2024	13 Nov 2024	18 May 2025
	Reported	28 Jul 2021	21 Nov 2023	19 Jun 2024	27 Nov 2024	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Alert	Caution	Alert	Alert
	Visc@40C (cSt)	48.7	64.1	55.5	58.0	58.8
	TAN (mg KOH/g)	1.12	1.64	1.27	1.42	1.34
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	1	0	1	0	0
	Cu (Copper)	3	1	1	3	3
	Fe (Iron)	34	28	13	12	11
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	1	0	0
	Pb (Lead)	1	0	0	1	1
	Sn (Tin)	305	327	281	277	268
Contaminant (ppm)	K (Potassium)	2	0	2	2	3
	Na (Sodium)	1	2	2	2	1
	Si (Silicon)	3	3	2	2	2
Additive (ppm)	B (Boron)	0	1	1	1	2
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	13	8	6	7	65
	Mg (Magnesium)	1	0	0	0	1
	P (Phosphorus)	110	112	109	134	116
	Zn (Zinc)	12	11	6	41	38

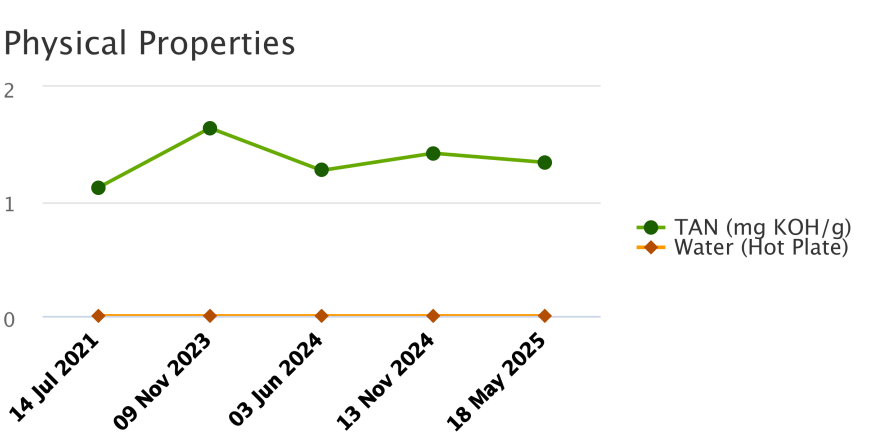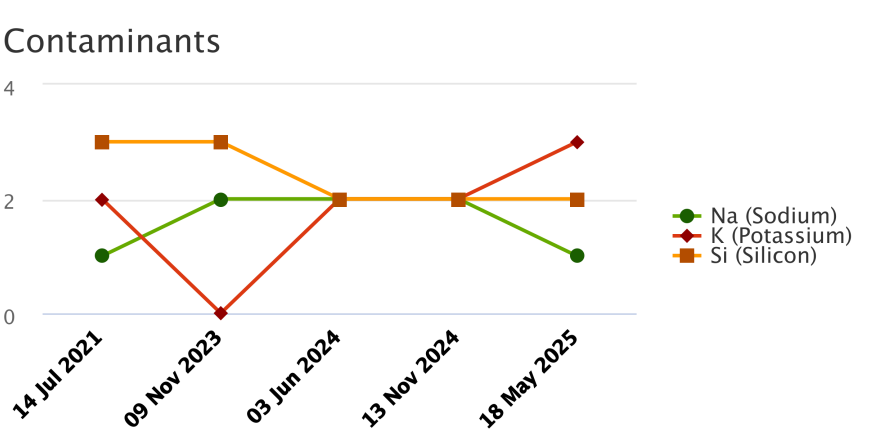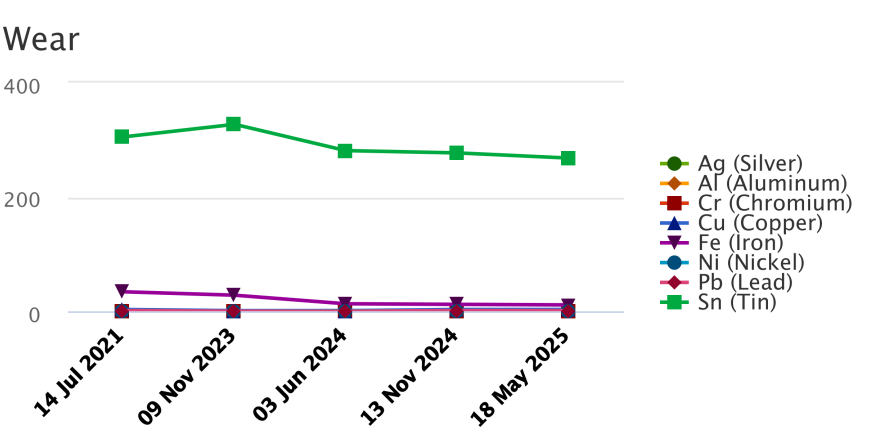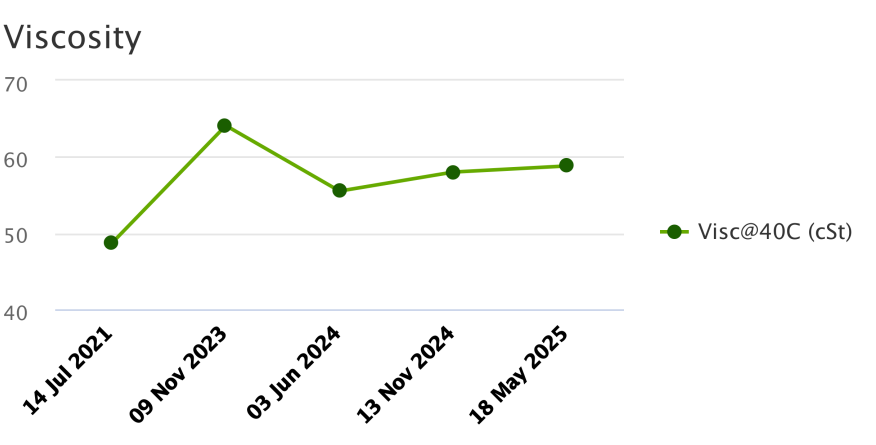

	Alert	
	Unit ID: 4-phu-1	Asset ID: 50326099
	Description: Hyd pump	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25147427031 Service Level: Essential Bottle ID: a033685875 Tested Lubricant: QUAKER QUINTOLUBRIC 888-46	Asset Class: Hydraulic Manufacturer: Model: Lubricant: QUAKER QUINTOLUBRIC 888-46
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [18 May 2025 6:01 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: