

Mobil™

Unit ID: 4-PHU-2

Asset ID: 50326105

Description: Hyd pump

Alert

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25147349010

Service Level: Essential

Bottle ID: a033684080

Tested Lubricant: QUAKER QUINTOLUBRIC 888-46

Asset Class: Hydraulic


Manufacturer:

Model:

Lubricant: QUAKER QUINTOLUBRIC 888-46

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Caution	Alert	Alert
	Sample ID	24162569015	24205472055	24205983055	24330410036	25147349010
	Service Level	Essential	Essential	Enhanced	Essential	Essential
	Bottle ID	a003624560	a030135884	b046769977	a033582868	a033684080
	Tested Lubricant	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46	QUAKER QUINTOLUBRIC 888-46
	Sampled	03 Jun 2024	16 Jul 2024	16 Jul 2024	13 Nov 2024	18 May 2025
	Reported	19 Jun 2024	29 Jul 2024	26 Jul 2024	27 Nov 2024	29 May 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed		Yes	Yes		
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Caution	Normal	Normal
	Equipment Rating	Alert	Alert	Normal	Alert	Alert
	Lubricant Rating	Caution	Caution	Normal	Alert	Alert
	Visc@40C (cSt)	55.0	54.7		61.3	60.1
	TAN (mg KOH/g)	2.10	2.28		1.68	1.60
Wear (ppm)	Water (Hot Plate)	NotDetected	NotDetected		NotDetected	NotDetected
	Ag (Silver)	0	0		0	0
	Al (Aluminum)	0	1		0	0
	Cr (Chromium)	2	1		1	1
	Cu (Copper)	2	2		2	5
	Fe (Iron)	155	165		79	56
	Mo (Molybdenum)	0	0		0	0
	Ni (Nickel)	1	0		0	0
	Pb (Lead)	2	2		1	2
Contaminant (ppm)	Sn (Tin)	307	314		325	315
	K (Potassium)	1	1		2	1
	Na (Sodium)	2	3		3	3
	Si (Silicon)	3	4		3	2
Additive (ppm)	B (Boron)	1	0		1	4
	Ba (Barium)	0	0		0	0
	Ca (Calcium)	33	36		15	14
	Mg (Magnesium)	1	1		0	0
	P (Phosphorus)	113	118		117	108
	Zn (Zinc)	17	25		8	12

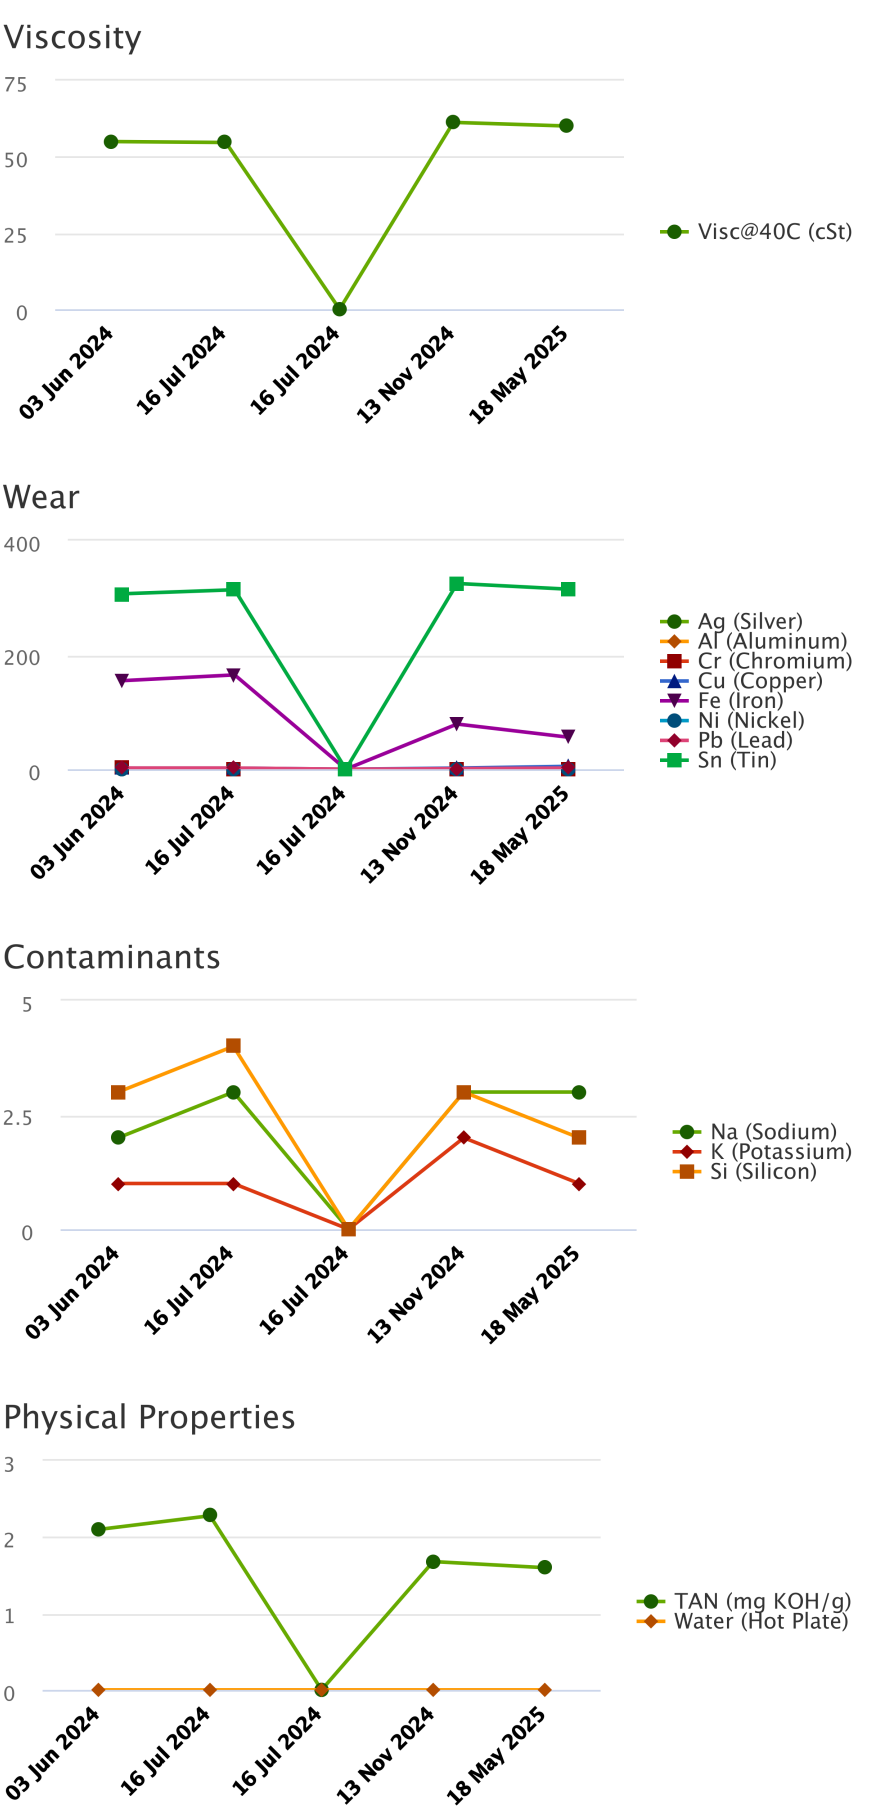

		Alert	
		Unit ID: 4-PHU-2	Asset ID: 50326105
		Description: Hyd pump	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25147349010	Asset Class: Hydraulic
Name: Greer Lime		Service Level: Essential	Manufacturer:
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a033684080	Model:
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: QUAKER QUINTOLUBRIC 888-46	Lubricant: QUAKER QUINTOLUBRIC 888-46
Continued Recommendation/Comments			

ACTION REQUIRED - ELEVATED IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible sources of iron include: a. Machinery component wear; b. Metal-to-metal contact; c. Corrosion; d. Abrasive dirt contamination. The oil may be unfit for continued use and should be closely monitored for further condition regressions. Inspect the equipment for signs of damage. Change the oil after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is excessive for the first time with no history of an increasing trend, then resample immediately to confirm condition. The oil and filter are unfit for continued use. Change the filter immediately and either centrifuge or change the oil. Prolonged usage of oil with excessive iron levels can adversely affect product performance and damage the equipment. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 18 May 2025 5:49 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: