

Mobil™

Unit ID: 1212

Asset ID: 51414377

Description: right rear final drive

Alert

Account Information

ID: 402009
Name: Greer Lime
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US
Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information


Sample ID: 25296320031
Service Level: Essential
Bottle ID: a037323013
Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Equipment Information

Asset Class: Gear Drive
Manufacturer: CATERPILLAR
Model:
Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Caution	Alert	Alert	Alert	Alert
	Sample ID	24010131057	24122146005	25059237018	25111107051	25296320031
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030115776	a029202511	a033578655	a033668516	a037323013
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	04 Jan 2024	25 Apr 2024	11 Dec 2024	02 Apr 2025	13 Oct 2025
	Reported	15 Jan 2024	08 May 2024	05 Mar 2025	23 Apr 2025	24 Oct 2025
	Equipment Age	10738		13366	14245	
	Equipment UOM	Hours		Hours	Hours	
	Oil Age					
	Make-up Volume					
	Oil Changed	No	Yes	Yes	No	No
	Filter Changed	No	No	Yes	No	No
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Caution
	Equipment Rating	Caution	Alert	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@100C (cSt)	17.1	17.1	17.0	17.2	17.1
	Oxidation (Ab/cm)	0	1		1	1
	Water (Vol.%)	NotDetected	NotDetected		NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	2	0	0
	Al (Aluminum)	2	2	4	4	3
	Cr (Chromium)	0	1	1	1	1
	Cu (Copper)	12	15	22	25	17
	Fe (Iron)	218	303	710	878	496
	Mo (Molybdenum)	1	0	1	0	1
	Ni (Nickel)	0	0	1	1	1
	Pb (Lead)	0	0	1	0	1
	Sn (Tin)	1	2	0	1	0
Contaminant (ppm)	K (Potassium)	0	0	1	1	1
	Na (Sodium)	0	2	1	1	1
	Si (Silicon)	10	10	13	12	19
Additive (ppm)	B (Boron)	1	2	2	1	3
	Ba (Barium)	0	1	0	0	0
	Ca (Calcium)	3295	3122	3372	2836	3735
	Mg (Magnesium)	13	11	14	12	19
	P (Phosphorus)	877	866	907	795	1001
	Zn (Zinc)	938	880	836	705	1100

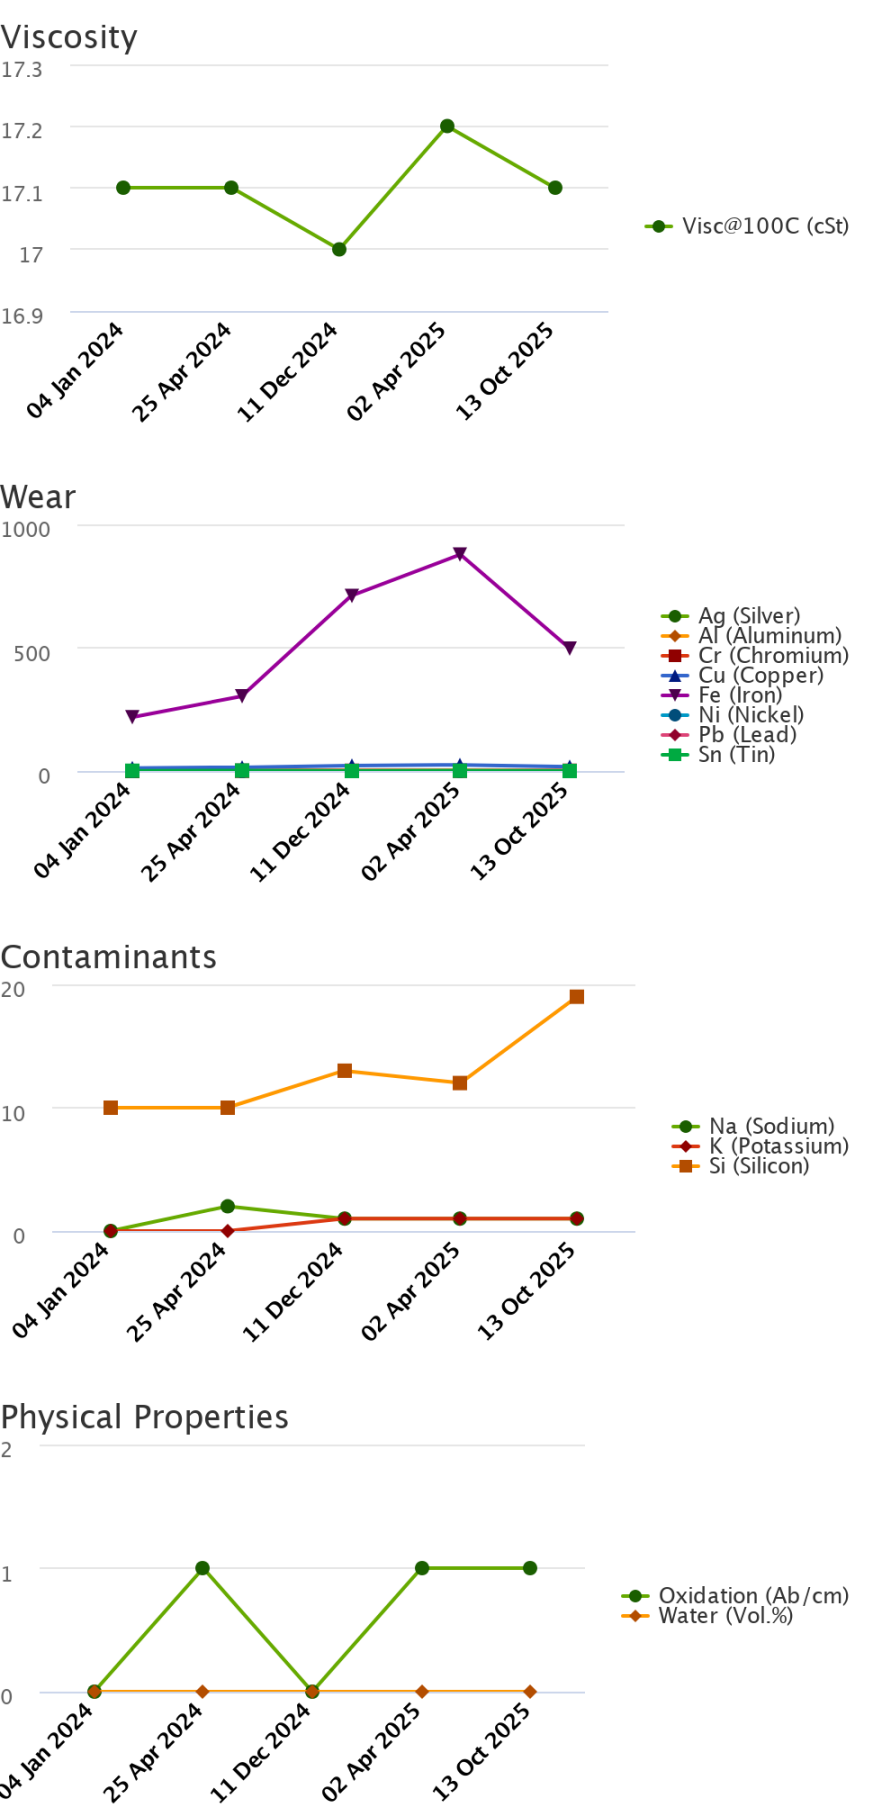

	Alert	
	Unit ID: 1212	Asset ID: 51414377
	Description: right rear final drive	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25296320031 Service Level: Essential Bottle ID: a037323013 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Gear Drive Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible sources of iron include: a. Machinery component wear; b. Metal-to-metal contact; c. Corrosion; d. Abrasive dirt contamination. The oil may be unfit for continued use and should be closely monitored for further condition regressions. Inspect the equipment for signs of damage. Change the oil after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is excessive for the first time with no history of an increasing trend, then resample immediately to confirm condition. The oil and filter are unfit for continued use. Change the filter immediately and either centrifuge or change the oil. Prolonged usage of oil with excessive iron levels can adversely affect product performance and damage the equipment. Contact your ExxonMobil representative for further assistance if necessary.

CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 13 Oct 2025 3:23 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: