

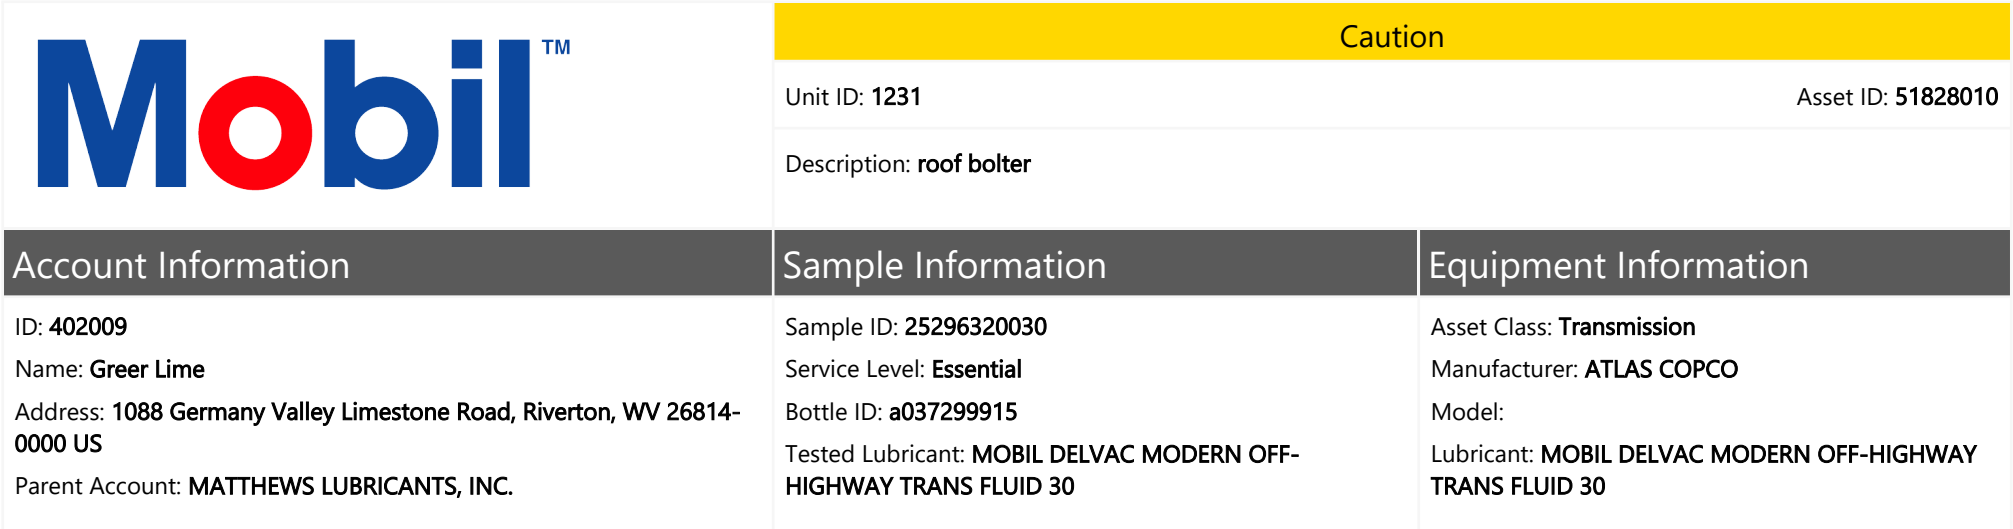
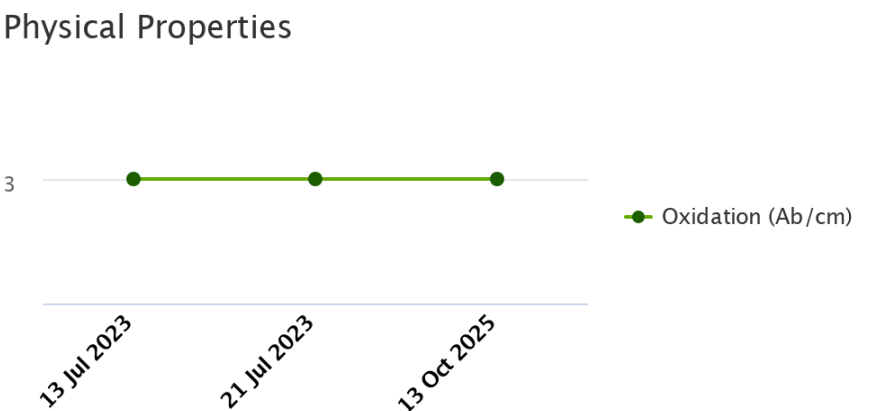
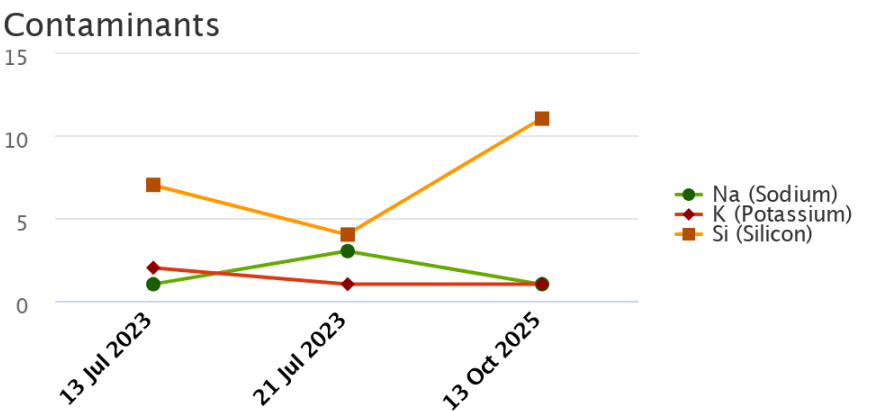


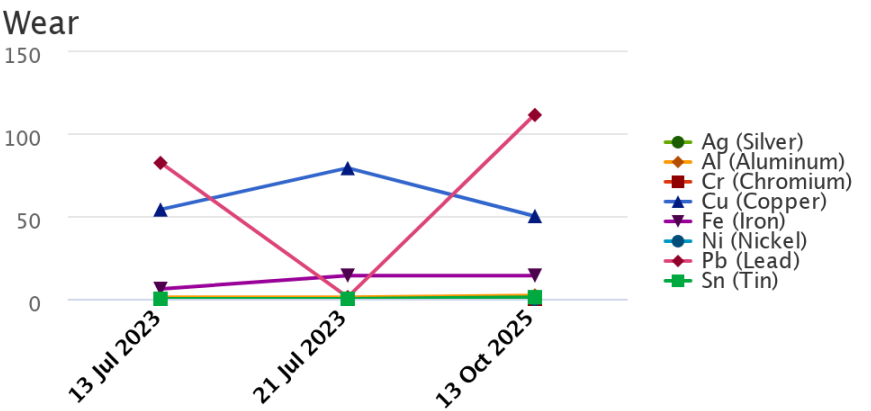

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Caution	
	Sample ID	23205380053	23264173024	25296320030	
	Service Level	Essential	Essential	Essential	
	Bottle ID	a029578283	a004754206	a037299915	
	Tested Lubricant	MOBILTRANS HD 30	MOBILTRANS HD 30	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 30	
	Sampled	13 Jul 2023	21 Jul 2023	13 Oct 2025	
	Reported	25 Jul 2023	25 Sep 2023	24 Oct 2025	
	Equipment Age	1163	5324	8426	
	Equipment UOM	Hours	Hours	Hours	
	Oil Age				
	Make-up Volume				
	Oil Changed	Yes	No	No	
	Filter Changed	Yes	Yes	Yes	
	Lubricant	Contamination Rating	Normal	Normal	Caution
		Equipment Rating	Alert	Alert	Caution
Lubricant Rating		Alert	Normal	Normal	
Visc@100C (cSt)		7.3	10.1	9.4	
Oxidation (Ab/cm)		3	3	3	
Water (Vol.%)		NotDetected	NotDetected	NotDetected	
Wear (ppm)	Ag (Silver)	0	0	0	
	Al (Aluminum)	1	1	2	
	Cr (Chromium)	0	0	0	
	Cu (Copper)	54	79	50	
	Fe (Iron)	6	14	14	
	Mo (Molybdenum)	0	7	1	
	Ni (Nickel)	0	0	0	
	Pb (Lead)	82	1	111	
	Sn (Tin)	0	0	1	
Contaminant (ppm)	K (Potassium)	2	1	1	
	Na (Sodium)	1	3	1	
	Si (Silicon)	7	4	11	
Additive (ppm)	B (Boron)	100	15	38	
	Ba (Barium)	0	1	0	
	Ca (Calcium)	3029	2925	3820	
	Mg (Magnesium)	5	60	29	
	P (Phosphorus)	1080	1176	1109	
	Zn (Zinc)	1240	1179	1274	

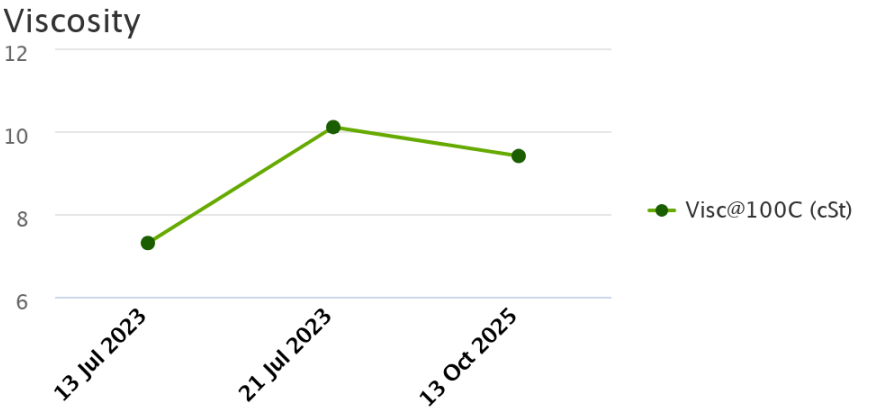

	Caution	
	Unit ID: 1231	Asset ID: 51828010
	Description: roof bolter	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25296320030 Service Level: Essential Bottle ID: a037299915 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 30	Asset Class: Transmission Manufacturer: ATLAS COPCO Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 30
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED WEAR METALS LEVELS. Determine cause of elevated wear metals levels and take corrective action. If the wear metals levels are elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Because silicon levels are not also elevated, abrasive dirt is not the cause of this condition. Possible causes of elevated wear metals include: a. Worn of oil-wetted parts; b. Contamination from previous fill; c. Over-extended oil service life; d. Normal break-in of new equipment. Continue to closely monitor the equipment and oil for signs of further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 13 Oct 2025 3:50 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: