

MobilTM

Alert

Unit ID: 4-RK-2

Asset ID: 50074740

Description: Kiln 1 Drive Trunion Bearing 1

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25343187033

Service Level: Essential

Bottle ID: a037321274

Tested Lubricant: MOBIL SHC 636

Asset Class: Circulating System




Manufacturer:

Model:

Lubricant: MOBIL SHC 636

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Caution	Alert	Alert
	Sample ID	24162579022	24205294026	24330183027	25147288010	25343187033
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a003623009	a030133308	a033579220	a003619569	a037321274
	Tested Lubricant	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636
	Sampled	03 Jun 2024	16 Jul 2024	13 Nov 2024	18 May 2025	03 Dec 2025
	Reported	18 Jun 2024	29 Jul 2024	27 Nov 2024	29 May 2025	11 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed		Yes			
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Normal	Alert	Alert
	Lubricant Rating	Alert	Alert	Caution	Caution	Normal
	Visc@40C (cSt)	782.8	790.1	757.1	769.4	680.4
	TAN (mg KOH/g)	0.40	0.39	0.40	0.40	0.41
Wear (ppm)	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	1	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	89	127	13	58	53
	Fe (Iron)	10	11	1	7	9
	Mo (Molybdenum)	1	0	0	0	0
	Ni (Nickel)	1	1	0	0	0
	Pb (Lead)	39	44	5	20	18
Contaminant (ppm)	Sn (Tin)	8	10	1	4	4
	K (Potassium)	1	0	0	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	2	3	3	5	19
Additive (ppm)	B (Boron)	0	0	0	2	0
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	80	72	10	52	47
	Mg (Magnesium)	2	1	0	1	1
	P (Phosphorus)	292	272	328	363	495
	Zn (Zinc)	2	2	1	2	2

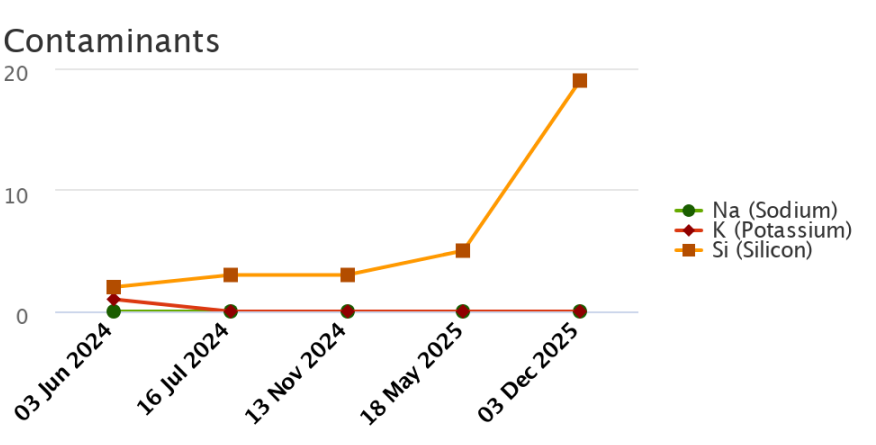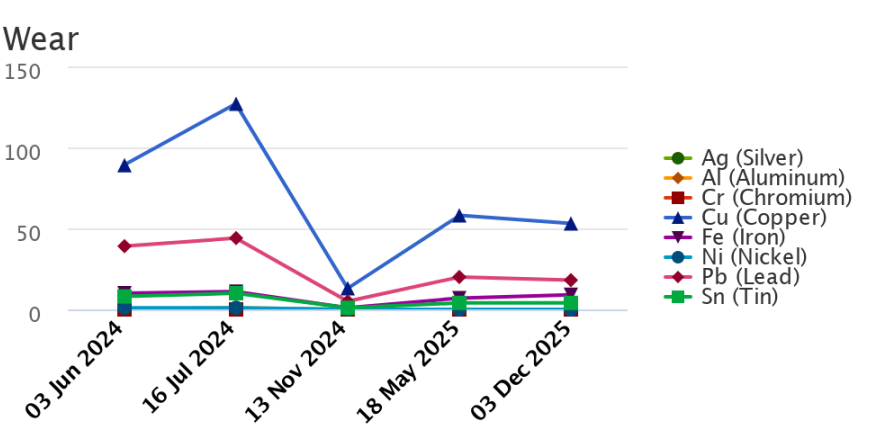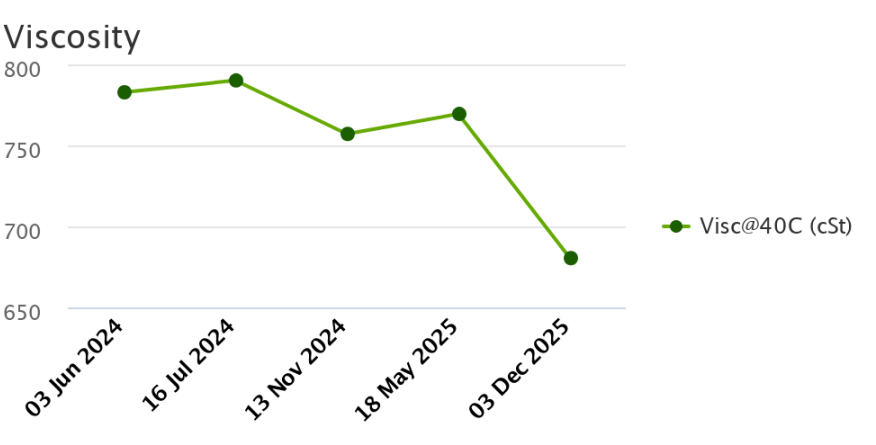

		Alert	
		Unit ID: 4-RK-2	Asset ID: 50074740
		Description: Kiln 1 Drive Trunion Bearing 1	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25343187033	Asset Class: Circulating System
Name: Greer Lime		Service Level: Essential	Manufacturer:
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a037321274	Model:
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL SHC 636	Lubricant: MOBIL SHC 636
Continued			
Recommendation/Comments			

ACTION REQUIRED - ELEVATED WEAR METALS LEVELS. Determine cause of elevated wear metals levels and take corrective action. If the wear metals levels are elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Because silicon levels are not also elevated, abrasive dirt is not the cause of this condition. Possible causes of elevated wear metals include: a. Worn of oil-wetted parts; b. Contamination from previous fill; c. Over-extended oil service life; d. Normal break-in of new equipment. Continue to closely monitor the equipment and oil for signs of further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 03 Dec 2025 10:02 PM UTC - Shawn Turner - In Service Oil Sample Comments: Photo: