

MobilTM

Alert

Unit ID: 5-BM-1

Asset ID: 50074775

Description: Kiln 2 Ball Mil Discharge End Bearing

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25342227011

Service Level: Essential

Bottle ID: a003618125

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Circulating System


Manufacturer:

Model:

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	25044280018	25069424007	25147132038	25308280031	25342227011
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a033584855	a003615680	a003619226	a037317088	a003618125
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	03 Feb 2025	04 Mar 2025	09 May 2025	22 Oct 2025	03 Dec 2025
	Reported	18 Feb 2025	12 Mar 2025	29 May 2025	06 Nov 2025	10 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed	Yes				
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	322.1	320.4	331.9	315.1	322.0
	Oxidation (Abs/cm) D7414	5	3	3	3	4
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	1	0	0
	Al (Aluminum)	4	0	0	0	2
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	40	14	18	26	24
	Fe (Iron)	54	16	16	17	20
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	7	3	5	7	7
	Sn (Tin)	427	112	103	116	102
Contaminant (ppm)	K (Potassium)	1	0	0	0	1
	Na (Sodium)	1	0	0	2	0
	Si (Silicon)	8	2	2	4	6
Additive (ppm)	B (Boron)	13	4	3	6	5
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	100	118	140	170	209
	Mg (Magnesium)	2	1	1	2	1
	P (Phosphorus)	282	396	393	378	434
	Zn (Zinc)	3	383	398	418	448

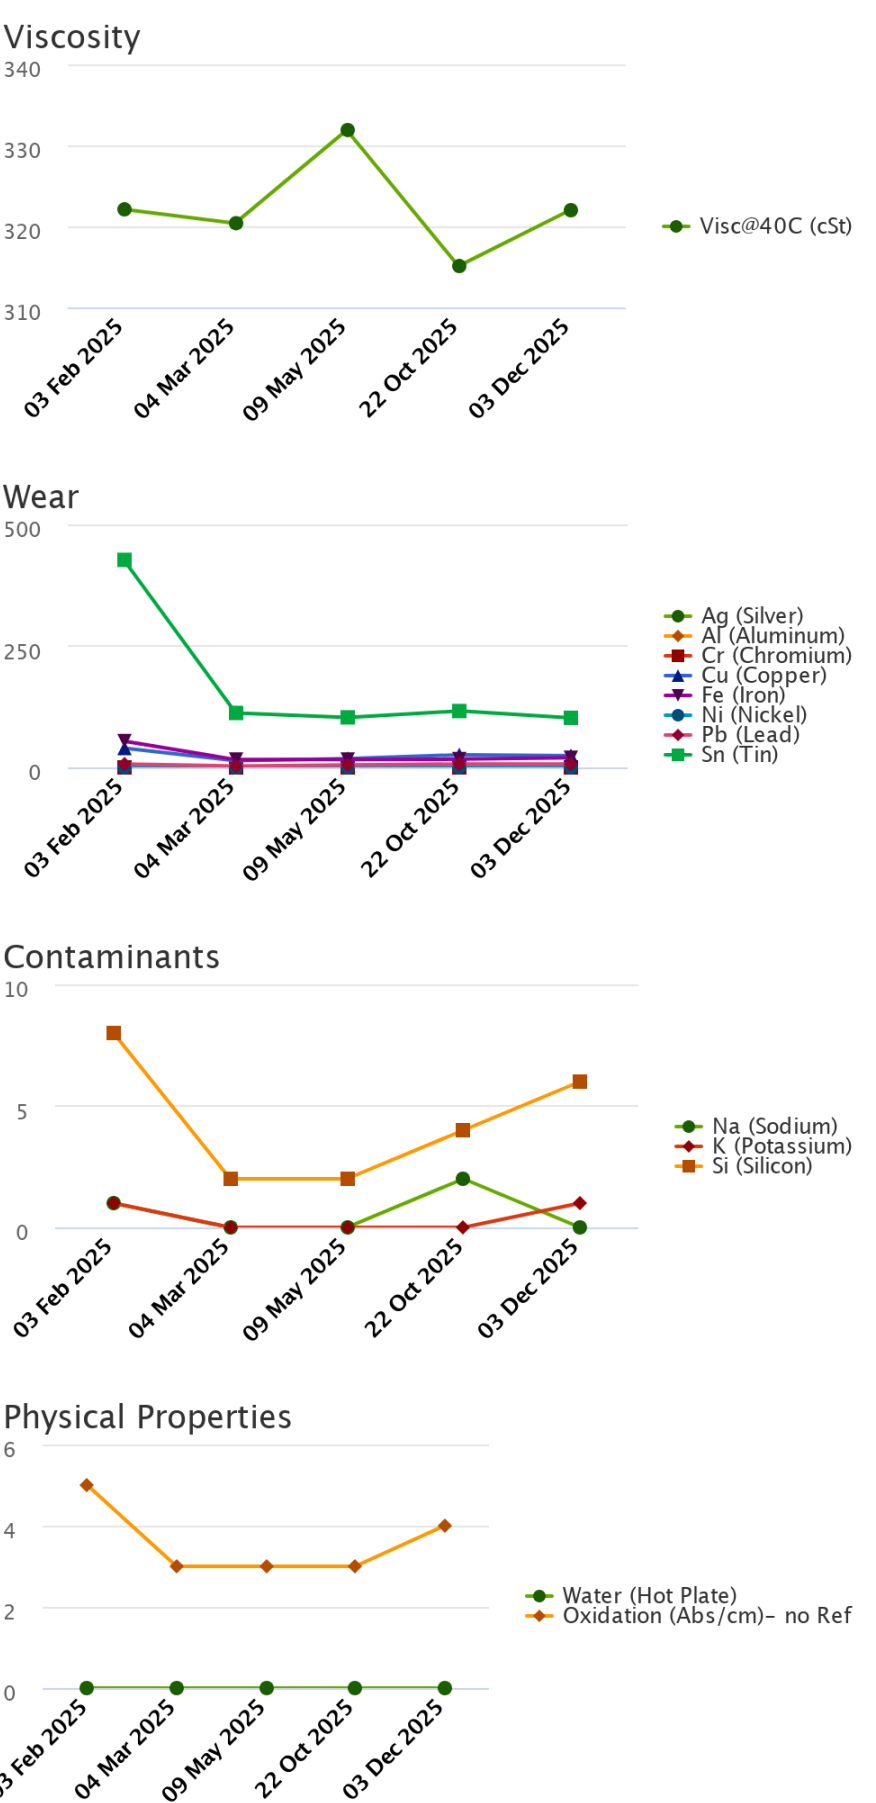

		Alert	
		Unit ID: 5-BM-1	Asset ID: 50074775
		Description: Kiln 2 Ball Mil Discharge End Bearing	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25342227011	Asset Class: Circulating System
Name: Greer Lime		Service Level: Essential	Manufacturer:
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a003618125	Model:
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL VACUOLINE 537	Lubricant: MOBIL VACUOLINE 537
Continued			
Recommendation/Comments			

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [03 Dec 2025 10:27 PM UTC - Shawn Turner - In Service Oil Sample](#) Comments: Photo: