

Mobil™

Alert

Unit ID: 5-BM-1

Asset ID: 50074772

Description: Kiln 2 Ball Mill Feed End Bearing

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308280026

Service Level: Essential

Bottle ID: a037321143

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Circulating System





Manufacturer:

Model:

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Alert	Alert	Alert
	Sample ID	18348218010	19352475036	25044280017	25147132044	25308280026
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a006548071	a005311802	a033581370	a033684445	a037321143
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	11 Dec 2018	12 Dec 2019	03 Feb 2025	18 May 2025	22 Oct 2025
	Reported	19 Dec 2018	20 Dec 2019	18 Feb 2025	29 May 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Alert	Alert	Alert
	Equipment Rating	Normal	Normal	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	331.0	337.2	350.9	319.8	315.6
	Oxidation (Ab/cm)	0	0			
	Oxidation (Abs/cm) D7414			3	3	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)			0	0	0
	Al (Aluminum)	2	6	202	12	18
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	1	5	50	4	5
	Fe (Iron)	3	5	128	10	17
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	1	5	1	2
	Sn (Tin)	21	45	891	55	71
Contaminant (ppm)	K (Potassium)	0	0	33	2	2
	Na (Sodium)	0	1	11	1	3
	Si (Silicon)	6	9	268	22	31
Additive (ppm)	B (Boron)	0	0	11	0	3
	Ba (Barium)	0	0	2	0	0
	Ca (Calcium)	151	218	595	193	249
	Mg (Magnesium)	0	1	17	2	3
	P (Phosphorus)	412	377	254	442	421
	Zn (Zinc)	447	441	3	502	523

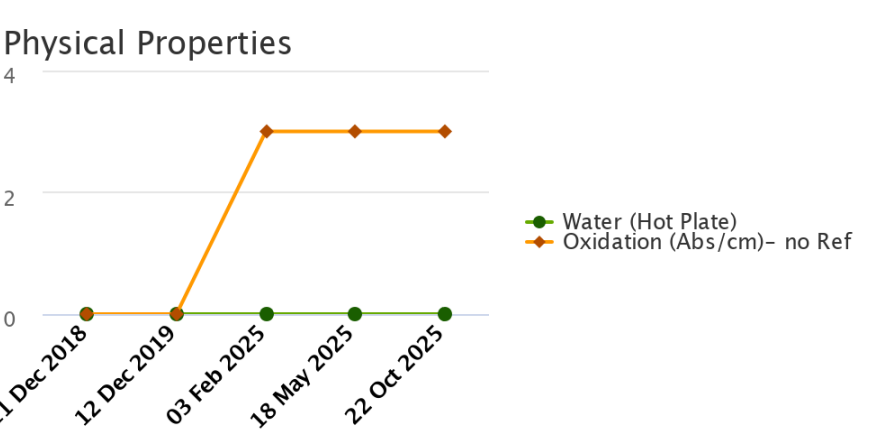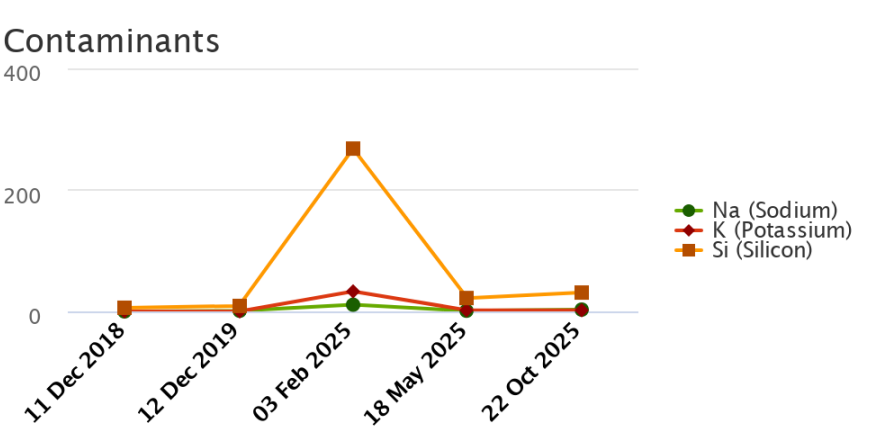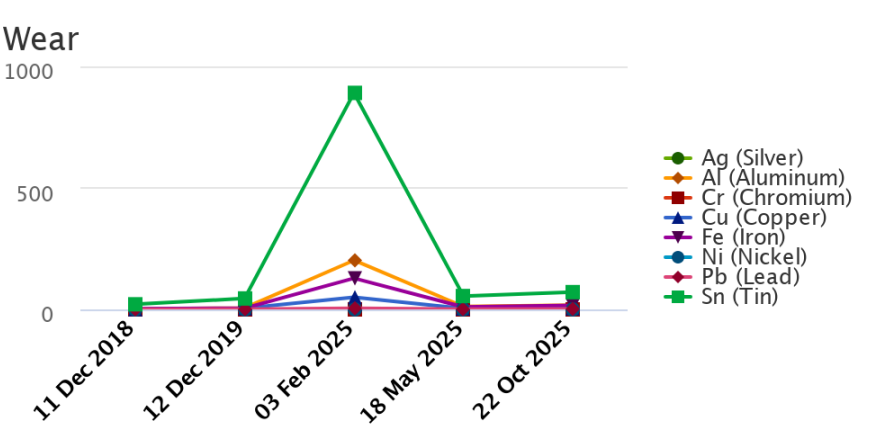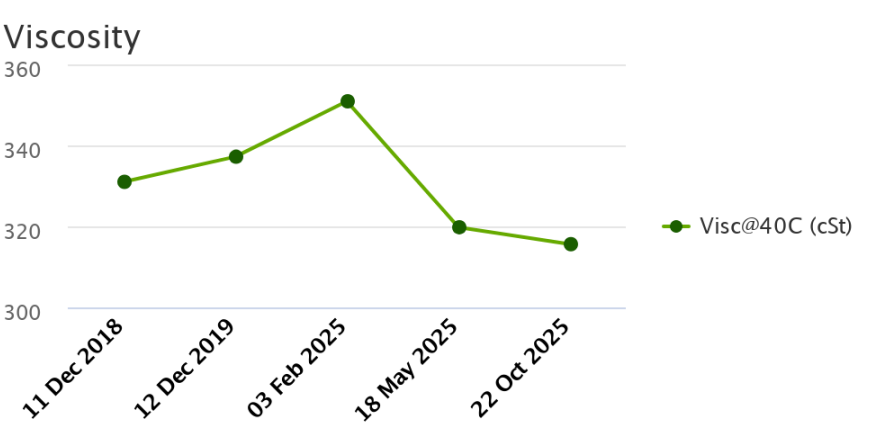

	Alert	
	Unit ID: 5-BM-1	Asset ID: 50074772
	Description: Kiln 2 Ball Mill Feed End Bearing	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25308280026 Service Level: Essential Bottle ID: a037321143 Tested Lubricant: MOBIL VACUOLINE 537	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL VACUOLINE 537
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If the wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metals levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt; b. Contamination from environment during an equipment overhaul or shutdown. Other possible sources of silicon include: a. Inefficient or leaking air intake filters; b. Leaking pipes; c. Clogged oil bath air filter; d. Poor oil filtration; e. Dirty sample containers or improper sampling procedures. In landfill gas applications, silicon can enter the engine as a siloxane. This material is a gas and is not normally abrasive; however, siloxanes can easily mask the presence dirt. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear and change the oil immediately if damage is detected. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [22 Oct 2025 9:31 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: