

Mobil™

Alert

Unit ID: 4-RK-1

Asset ID: 50074758

Description: Kiln 2 Drive Primary Gear Box

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308280022

Service Level: Essential

Bottle ID: a037321079

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Gear Drive


Manufacturer: FALK (REXNORD)

Model: 2140Y3

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Normal	Alert	Alert
	Sample ID	24047458018	24162579023	24330183009	25147132033	25308280022
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030132093	a029199486	a033580470	a033687171	a037321079
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	07 Feb 2024	03 Jun 2024	13 Nov 2024	18 May 2025	22 Oct 2025
	Reported	21 Feb 2024	18 Jun 2024	27 Nov 2024	29 May 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Alert	Alert
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Alert	Alert
	Visc@40C (cSt)	318.2	321.6	331.5	224.3	222.4
	Oxidation (Abs/cm) D7414	2	2	2	3	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	1	0
	Cu (Copper)	0	1	1	1	1
	Fe (Iron)	52	31	49	92	87
	Mo (Molybdenum)	0	0	0	0	1
	Ni (Nickel)	0	0	0	1	0
	Pb (Lead)	0	1	0	0	0
	Sn (Tin)	1	1	0	0	0
Contaminant (ppm)	K (Potassium)	0	0	1	0	0
	Na (Sodium)	1	0	0	0	2
	Si (Silicon)	2	2	7	27	28
Additive (ppm)	B (Boron)	2	2	2	2	3
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	116	98	101	24	18
	Mg (Magnesium)	1	1	1	0	0
	P (Phosphorus)	458	415	358	451	417
	Zn (Zinc)	559	478	430	49	32

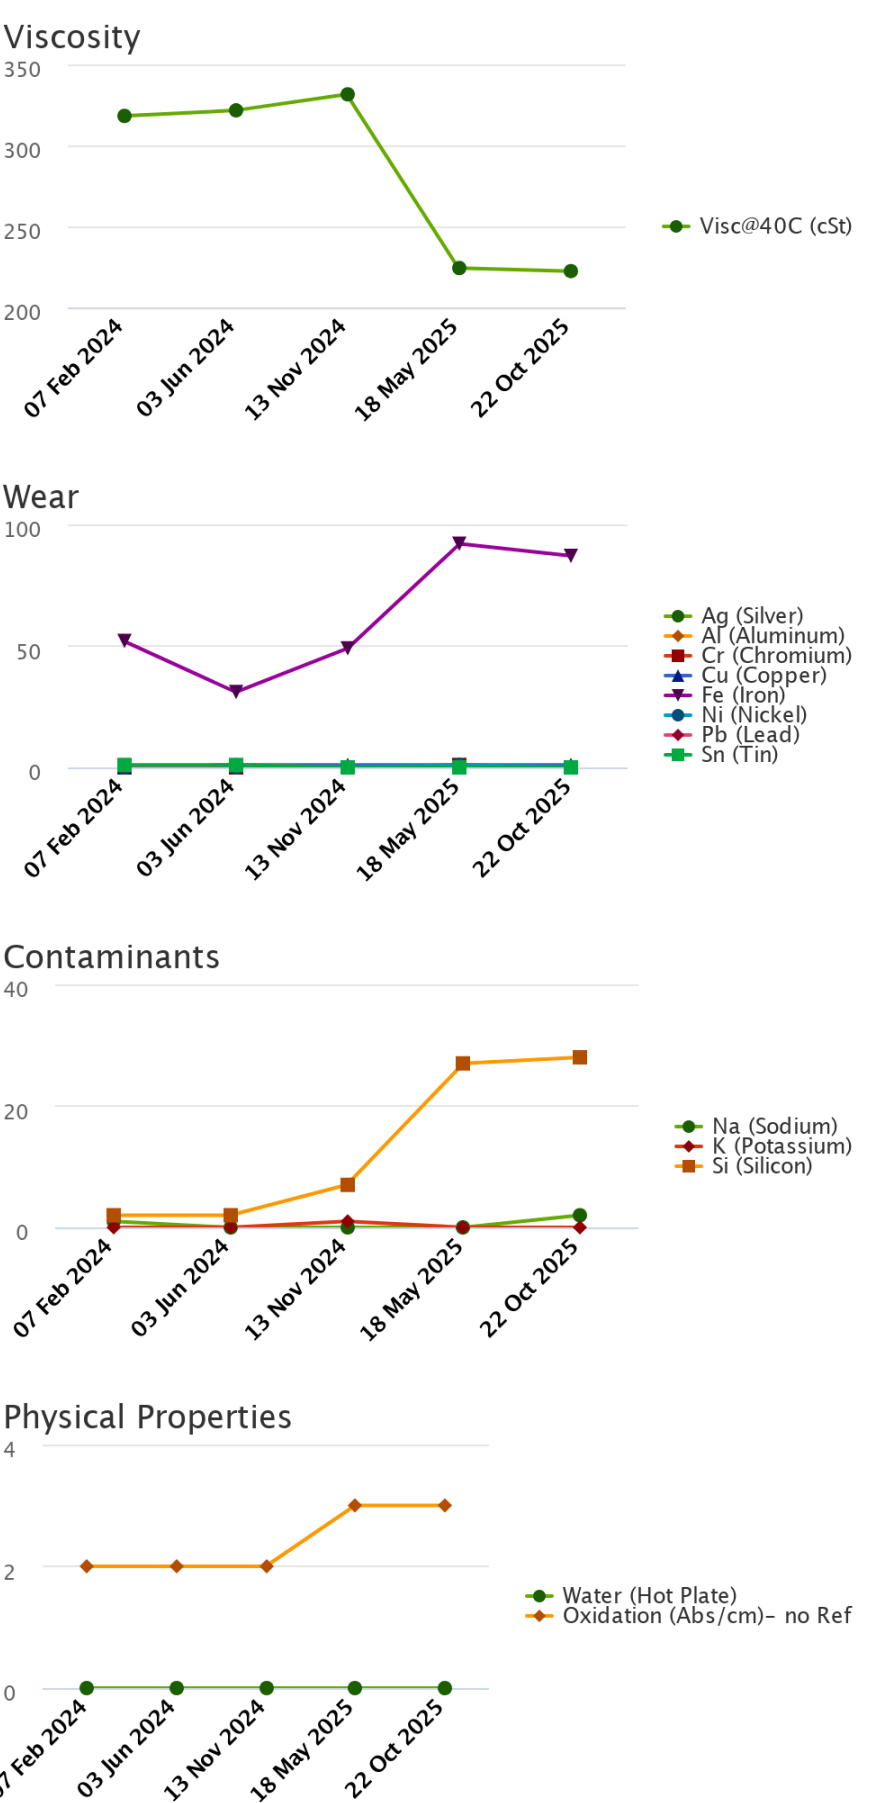

		Alert	
		Unit ID: 4-RK-1	Asset ID: 50074758
		Description: Kiln 2 Drive Primary Gear Box	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25308280022	Asset Class: Gear Drive
Name: Greer Lime		Service Level: Essential	Manufacturer: FALK (REXNORD)
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a037321079	Model: 2140Y3
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL VACUOLINE 537	Lubricant: MOBIL VACUOLINE 537
Continued Recommendation/Comments			

ACTION REQUIRED - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If the wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metals levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt; b. Contamination from environment during an equipment overhaul or shutdown. Other possible sources of silicon include: a. Inefficient or leaking air intake filters; b. Leaking pipes; c. Clogged oil bath air filter; d. Poor oil filtration; e. Dirty sample containers or improper sampling procedures. In landfill gas applications, silicon can enter the engine as a siloxane. This material is a gas and is not normally abrasive; however, siloxanes can easily mask the presence dirt. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear and change the oil immediately if damage is detected. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - REDUCED OIL VISCOSITY. Determine cause of reduced oil viscosity and take corrective action. Oil contamination with fuel is the most frequent cause of reduced oil viscosity. If fuel is not detected in the oil or if the system is not an engine, possible causes of reduced viscosity include: a. Contact with oil that has a lower viscosity; b. Contamination with a hydraulic fluid or automatic transmission oil; c. Incorrectly labeled sample. Inspect the system for signs of fuel or coolant ingress. Resample the oil after corrective actions have been implemented. If the condition continues or escalates, recharge the system with new oil. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [22 Oct 2025 9:28 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: