

MobilTM

Alert

Unit ID: 4-RK-1

Asset ID: 50074761

Description: Kiln 2 Drive Trunion Bearing 2

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25342227022

Service Level: Essential

Bottle ID: a037322874

Tested Lubricant: MOBIL SHC 636

Asset Class: Circulating System




Manufacturer:

Model:

Lubricant: MOBIL SHC 636

Sample Data & Trends

Sample Info	Report Status	Caution	Caution	Caution	Caution	Alert
	Sample ID	24162579025	24330183013	25044280024	25147132040	25342227022
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a029202346	a033582206	a033584009	a033684418	a037322874
	Tested Lubricant	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636
	Sampled	03 Jun 2024	13 Nov 2024	03 Feb 2025	18 May 2025	03 Dec 2025
	Reported	18 Jun 2024	27 Nov 2024	18 Feb 2025	29 May 2025	10 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed			Yes		
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Caution	Caution	Caution	Caution	Alert
	Visc@40C (cSt)	755.8	779.8	780.2	759.5	783.7
	TAN (mg KOH/g)	0.41	0.39	0.39	0.41	0.39
Wear (ppm)	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	2	1	4	4	1
	Fe (Iron)	0	0	0	1	0
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	1	1	1	1	0
Contaminant (ppm)	Sn (Tin)	2	0	0	1	0
	K (Potassium)	1	0	1	0	0
	Na (Sodium)	0	0	1	0	0
	Si (Silicon)	3	2	2	2	2
Additive (ppm)	B (Boron)	0	0	0	0	0
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	1	1	1	9	18
	Mg (Magnesium)	1	0	0	0	0
	P (Phosphorus)	299	255	242	378	310
	Zn (Zinc)	0	0	0	2	3

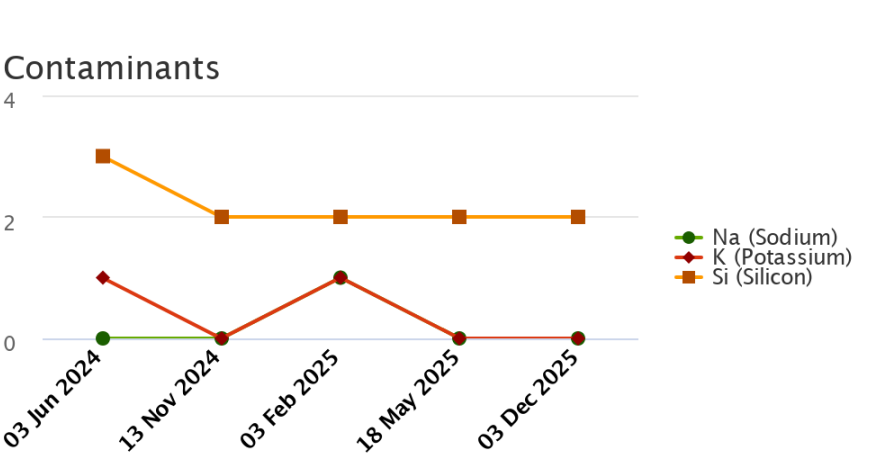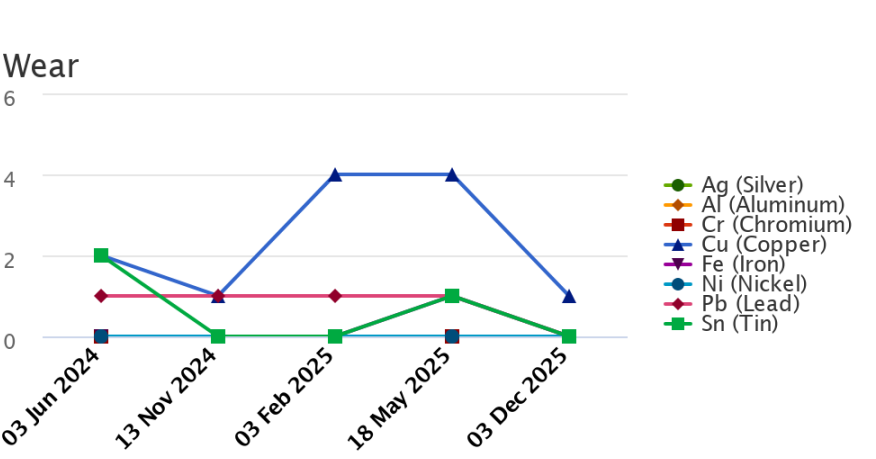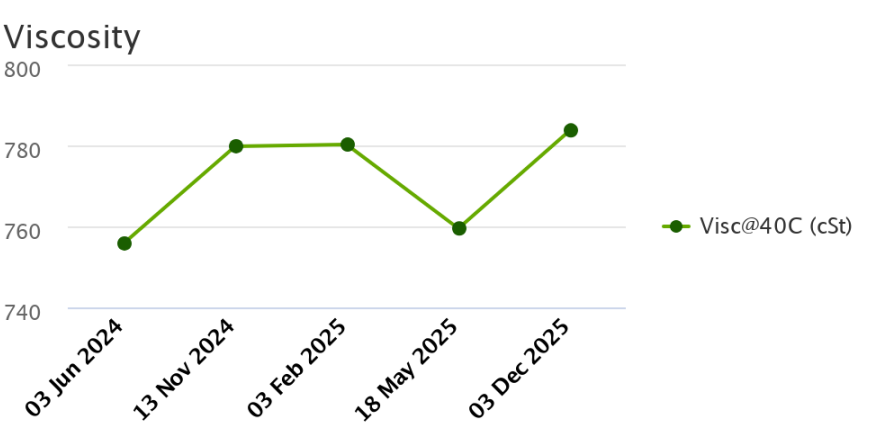

	Alert	
	Unit ID: 4-RK-1	Asset ID: 50074761
	Description: Kiln 2 Drive Trunion Bearing 2	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25342227022 Service Level: Essential Bottle ID: a037322874 Tested Lubricant: MOBIL SHC 636	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL SHC 636
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 03 Dec 2025 10:19 PM UTC - Shawn Turner - In Service Oil Sample Comments: Photo: