

Mobil™

Alert

Unit ID: 5-BM-1

Asset ID: 50074772

Description: Kiln 2 Ball Mill Feed End Bearing

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25342227025

Service Level: Essential

Bottle ID: a003619080

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Circulating System


Manufacturer:

Model:

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	25044280017	25147132044	25308280026	25342227014	25342227025
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a033581370	a033684445	a037321143	a003620210	a003619080
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	03 Feb 2025	18 May 2025	22 Oct 2025	03 Dec 2025	03 Dec 2025
	Reported	18 Feb 2025	29 May 2025	06 Nov 2025	10 Dec 2025	10 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Alert	Alert	Alert	Alert	Normal
	Equipment Rating	Alert	Alert	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Alert	Normal
	Visc@40C (cSt)	350.9	319.8	315.6	219.2	318.8
	Oxidation (Abs/cm) D7414	3	3	3	8	4
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	Detected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	202	12	18	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	50	4	5	1	27
	Fe (Iron)	128	10	17	164	17
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	5	1	2	0	7
	Sn (Tin)	891	55	71	1	105
Contaminant (ppm)	K (Potassium)	33	2	2	1	1
	Na (Sodium)	11	1	3	0	0
	Si (Silicon)	268	22	31	8	3
Additive (ppm)	B (Boron)	11	0	3	0	6
	Ba (Barium)	2	0	0	0	0
	Ca (Calcium)	595	193	249	11	157
	Mg (Magnesium)	17	2	3	2	1
	P (Phosphorus)	254	442	421	223	419
	Zn (Zinc)	3	502	523	2	406

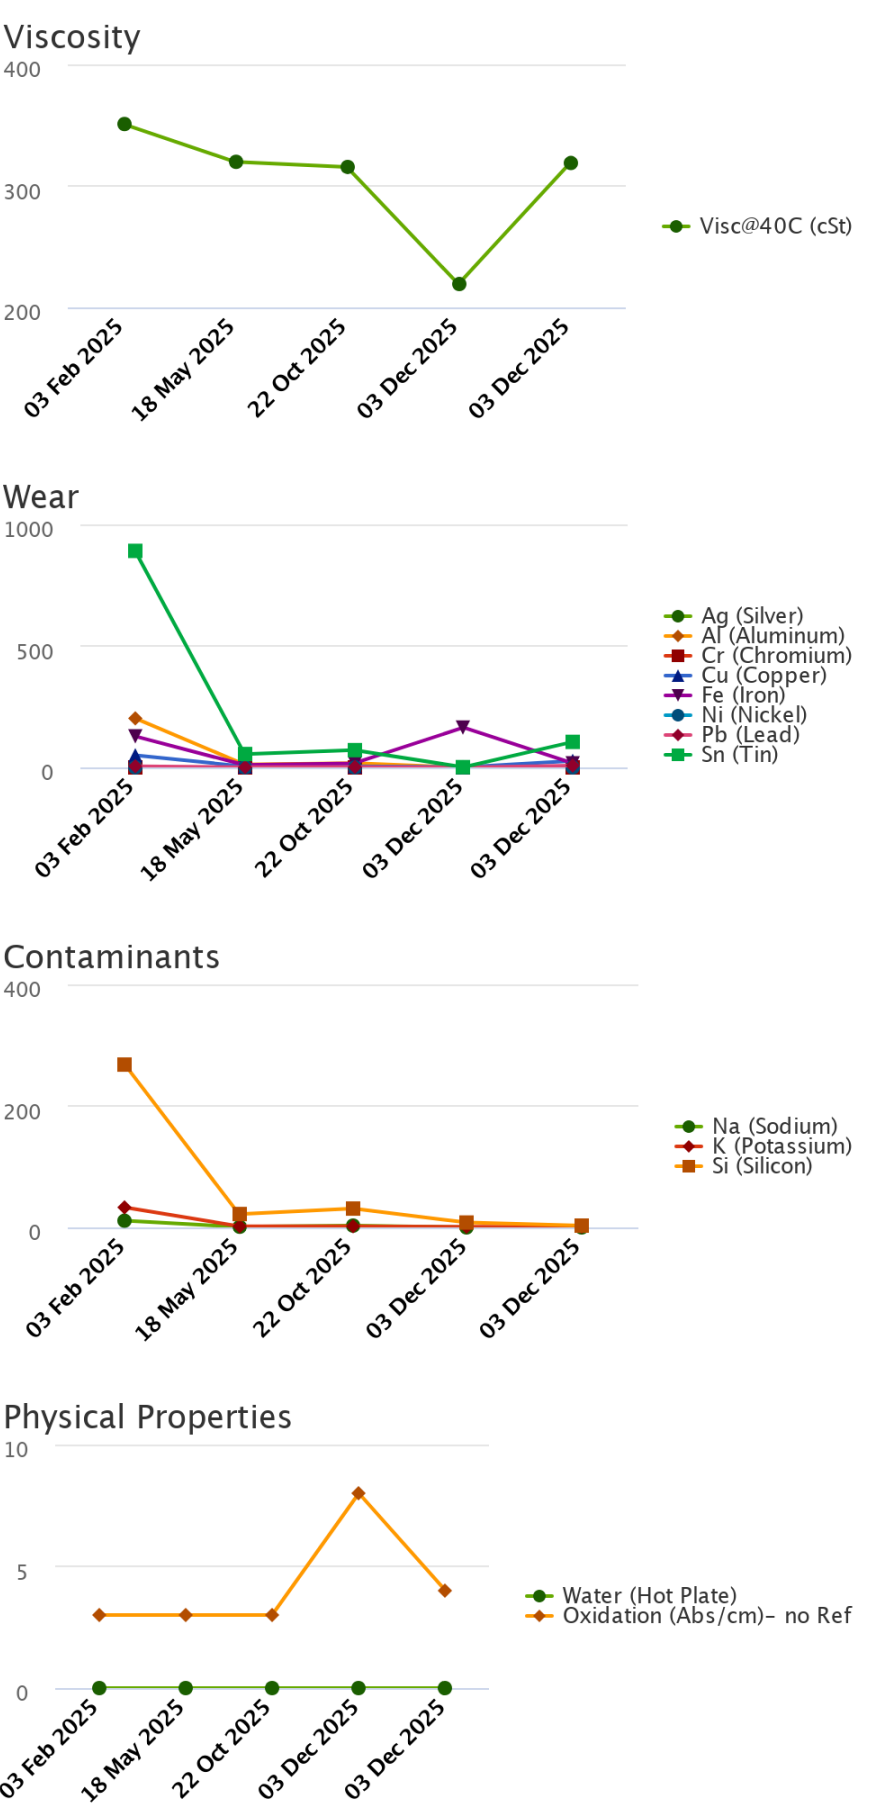

		Alert	
		Unit ID: 5-BM-1	Asset ID: 50074772
		Description: Kiln 2 Ball Mill Feed End Bearing	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25342227025	Asset Class: Circulating System
Name: Greer Lime		Service Level: Essential	Manufacturer:
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a003619080	Model:
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL VACUOLINE 537	Lubricant: MOBIL VACUOLINE 537
Continued Recommendation/Comments			

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [03 Dec 2025 10:28 PM UTC - Shawn Turner - In Service Oil Sample](#) Comments: Photo: