

Mobil™

Alert

Unit ID: 5-BM-1

Asset ID: 50074775

Description: Kiln 2 Ball Mil Discharge End Bearing

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308280031

Service Level: Essential

Bottle ID: a037317088

Tested Lubricant: MOBIL VACUOLINE 537

Asset Class: Circulating System


Manufacturer:

Model:

Lubricant: MOBIL VACUOLINE 537

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	24330183006	25044280018	25069424007	25147132038	25308280031
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a033578292	a033584855	a003615680	a003619226	a037317088
	Tested Lubricant	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537	MOBIL VACUOLINE 537
	Sampled	13 Nov 2024	03 Feb 2025	04 Mar 2025	09 May 2025	22 Oct 2025
	Reported	27 Nov 2024	18 Feb 2025	12 Mar 2025	29 May 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed		Yes			
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Alert	Alert	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	322.6	322.1	320.4	331.9	315.1
	Oxidation (Abs/cm) D7414	5	5	3	3	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	1	0
	Al (Aluminum)	0	4	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	32	40	14	18	26
	Fe (Iron)	46	54	16	16	17
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	1	0	0	0	0
	Pb (Lead)	7	7	3	5	7
	Sn (Tin)	360	427	112	103	116
Contaminant (ppm)	K (Potassium)	1	1	0	0	0
	Na (Sodium)	0	1	0	0	2
	Si (Silicon)	2	8	2	2	4
Additive (ppm)	B (Boron)	10	13	4	3	6
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	97	100	118	140	170
	Mg (Magnesium)	1	2	1	1	2
	P (Phosphorus)	241	282	396	393	378
	Zn (Zinc)	5	3	383	398	418

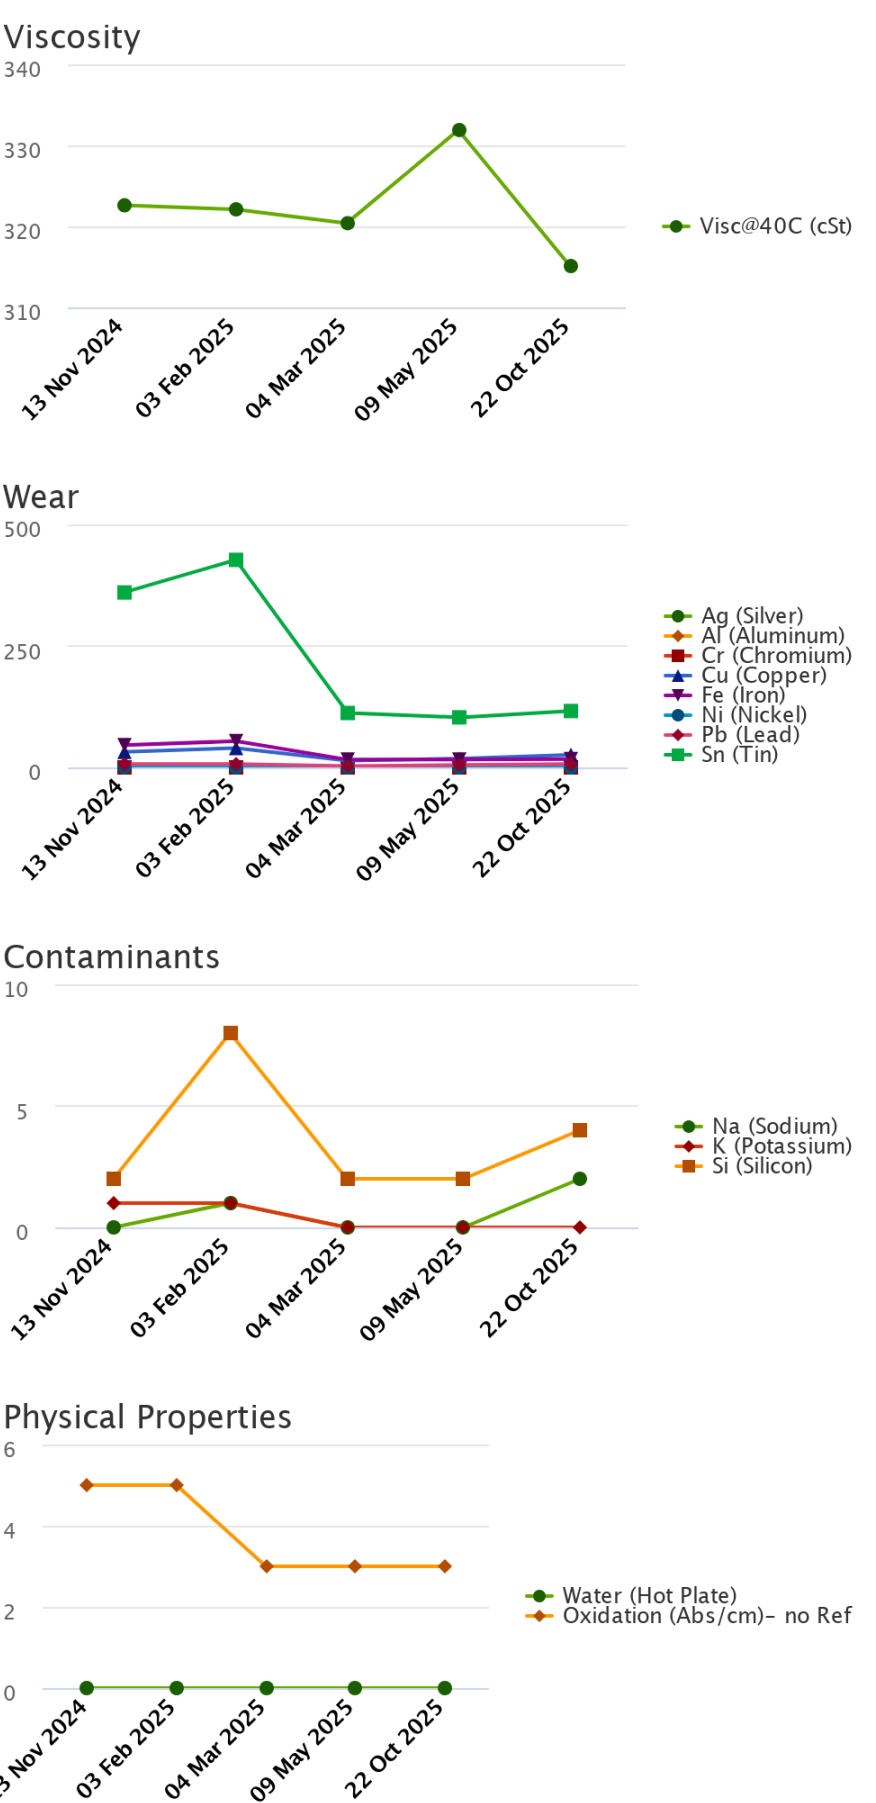

	Alert	
	Unit ID: 5-BM-1	Asset ID: 50074775
	Description: Kiln 2 Ball Mil Discharge End Bearing	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25308280031 Service Level: Essential Bottle ID: a037317088 Tested Lubricant: MOBIL VACUOLINE 537	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL VACUOLINE 537
Continued		
Recommendation/Comments		

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [22 Oct 2025 9:30 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: