

MobilTM

Alert

Unit ID: 7-bm-1 Trun outlet

Asset ID: 50164965

Description: 7-bm-1 bearing bath

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25342227018

Service Level: Essential

Bottle ID: a003620107

Tested Lubricant: MOBILGEAR 600 XP 320

Asset Class: Circulating System





Manufacturer:

Model:

Lubricant: MOBILGEAR 600 XP 320

Sample Data & Trends

Sample Info	Report Status	Caution	Alert	Alert	Caution	Alert
	Sample ID	23300477041	24240194010	24282357070	25196141028	25342227018
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a026527654	a029202801	a033578590	a033684600	a003620107
	Tested Lubricant	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320
	Sampled	20 Oct 2023	10 Aug 2024	16 Sep 2024	27 May 2025	03 Dec 2025
	Reported	31 Oct 2023	05 Sep 2024	10 Oct 2024	17 Jul 2025	10 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed			Yes		
	Filter Changed			Yes		
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Caution	Alert	Alert	Caution	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	299.0	299.6	303.6	306.3	305.6
	Oxidation (Abs/cm) D7414	4	4	4	2	3
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	1	0	0	1	2
	Fe (Iron)	11	7	8	2	4
	Mo (Molybdenum)	1	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	26	48	57	24	32
	Sn (Tin)	2	2	3	1	2
Contaminant (ppm)	K (Potassium)	0	1	0	0	1
	Na (Sodium)	1	0	0	1	1
	Si (Silicon)	2	3	8	1	1
Additive (ppm)	B (Boron)	4	2	3	1	1
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	45	98	109	119	153
	Mg (Magnesium)	0	1	1	0	0
	P (Phosphorus)	307	263	322	439	426
	Zn (Zinc)	3	1	2	458	466

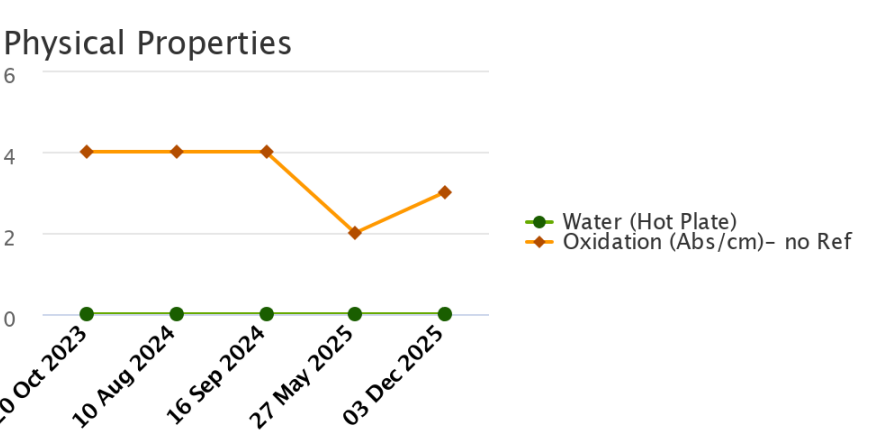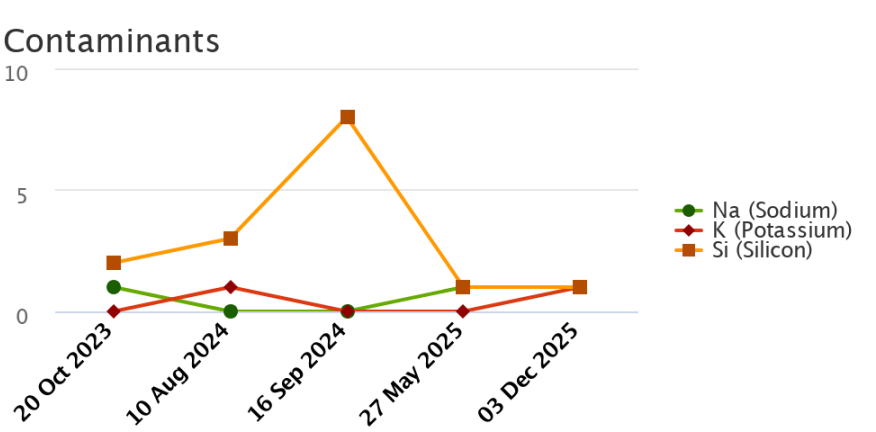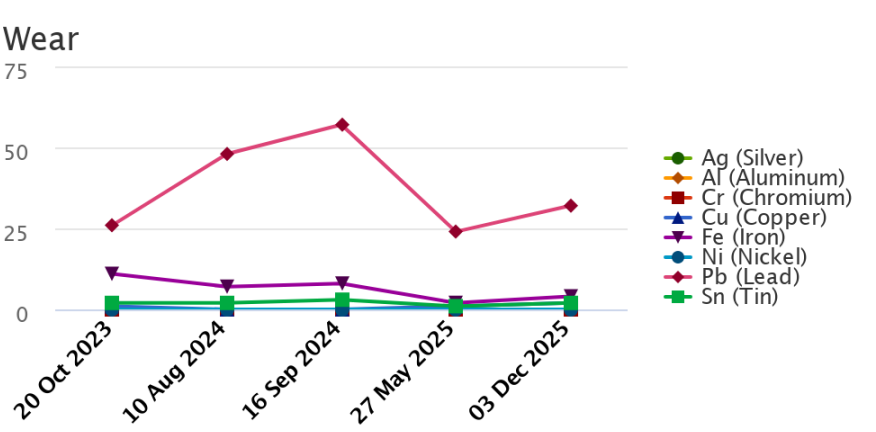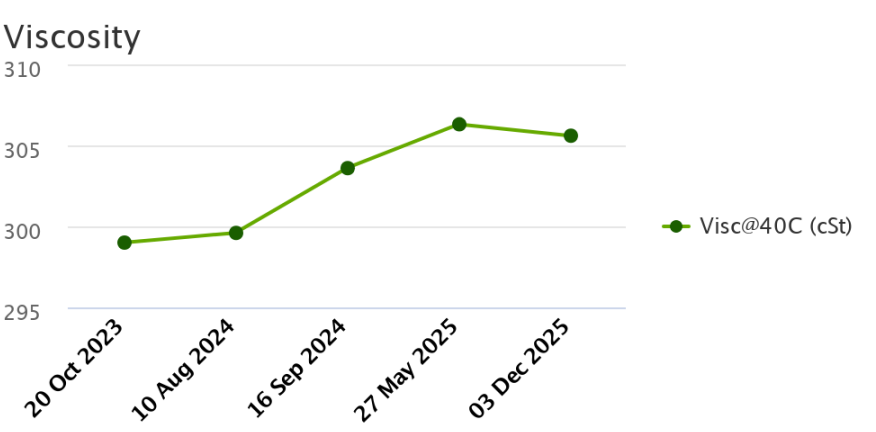

	Alert	
	Unit ID: 7-bm-1 Trun outlet	Asset ID: 50164965
	Description: 7-bm-1 bearing bath	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25342227018 Service Level: Essential Bottle ID: a003620107 Tested Lubricant: MOBILGEAR 600 XP 320	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBILGEAR 600 XP 320
Continued		
Recommendation/Comments		

ACTION REQUIRED - EXCESSIVE WEAR METALS LEVELS. Determine cause of excessive wear metals levels and take corrective action. Possible causes of excessive wear metals levels include: a. Excessively worn bearings, gears, and / or shafts; b. Equipment fatigue; c. Abrasive dirt. The components suffering from excessive wear are unfit for continued use and should be inspected immediately. Change the oil immediately after corrective actions have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 03 Dec 2025 9:54 PM UTC - Shawn Turner - In Service Oil Sample Comments: Photo: