

MobilTM

Alert

Unit ID: 2-VS-1 Upper

Asset ID: 50254146

Description: 2-VS-1 upper

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308253046

Service Level: Essential

Bottle ID: a037322841

Tested Lubricant: MOBIL SHC 629

Asset Class: Circulating System





Manufacturer:

Model:

Lubricant: MOBIL SHC 629

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	25069376060	25154135008	25196140052	25196140053	25308253046
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a003617376	a003622564	a033684957	a033686452	a037322841
	Tested Lubricant	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629
	Sampled	04 Mar 2025	21 May 2025	23 Jun 2025	23 Jun 2025	22 Oct 2025
	Reported	12 Mar 2025	07 Jun 2025	17 Jul 2025	17 Jul 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Alert	Normal	Normal	Normal	Alert
	Equipment Rating	Alert	Alert	Alert	Alert	Alert
	Lubricant Rating	Caution	Alert	Alert	Alert	Alert
	Visc@40C (cSt)		229.0	222.0	219.8	234.8
	TAN (mg KOH/g)	0.30	0.43	0.35	0.34	0.67
Wear (ppm)	Water (Hot Plate)	Detected	NotDetected	NotDetected	NotDetected	Detected
	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	1	1	0	1
	Cr (Chromium)	0	0	1	1	0
	Cu (Copper)	8	14	10	10	8
	Fe (Iron)	69	65	73	74	83
	Mo (Molybdenum)	2	2	2	1	2
	Ni (Nickel)	0	0	1	1	0
	Pb (Lead)	1	2	2	1	1
Contaminant (ppm)	Sn (Tin)	0	1	0	0	2
	K (Potassium)	0	1	1	2	1
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	8	10	12	12	13
Additive (ppm)	B (Boron)	0	1	0	0	0
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	95	178	41	40	44
	Mg (Magnesium)	1	1	0	2	1
	P (Phosphorus)	435	451	470	479	525
	Zn (Zinc)	10	14	13	12	14

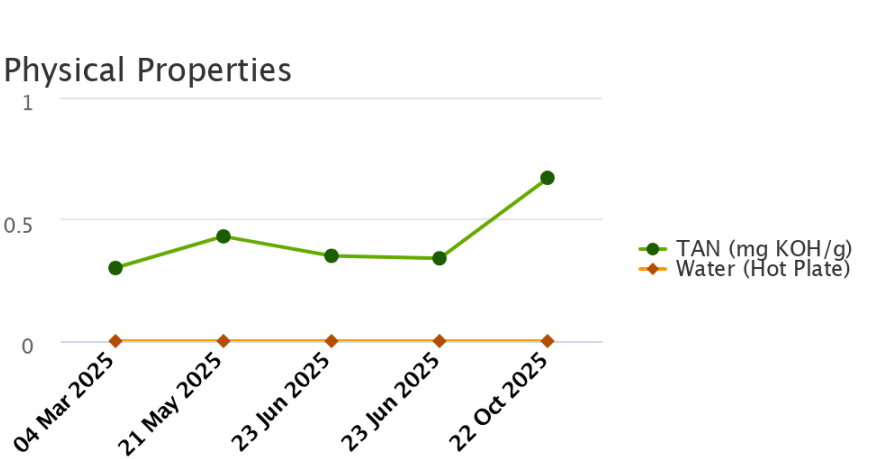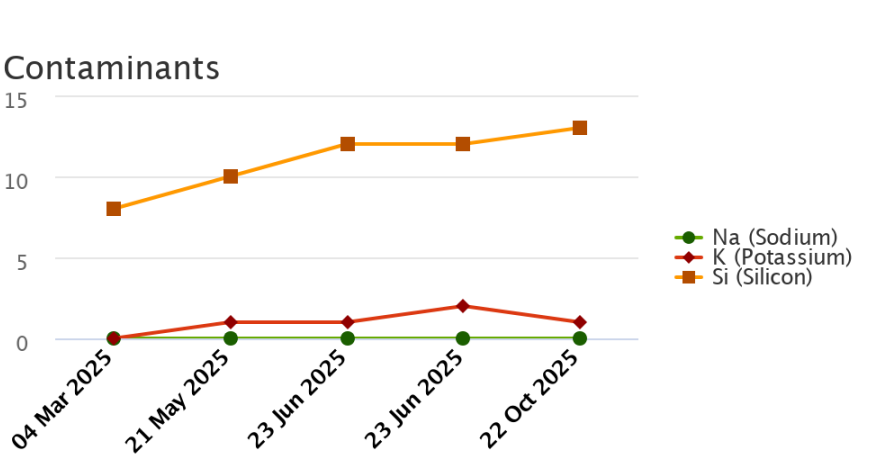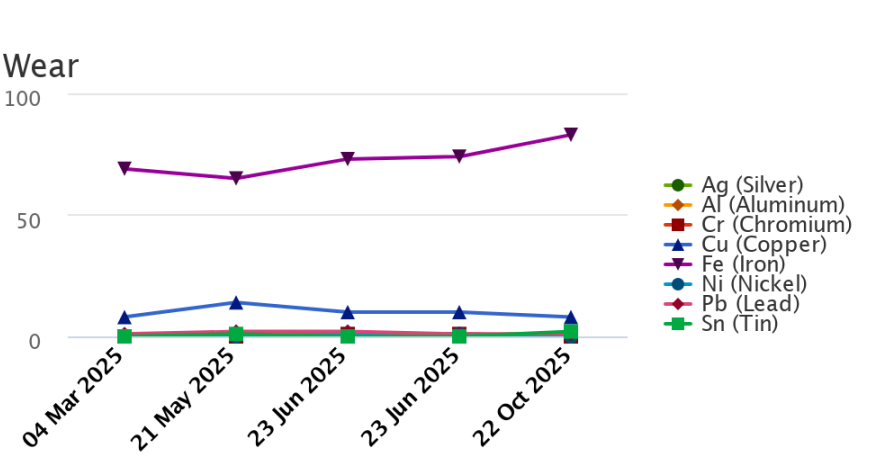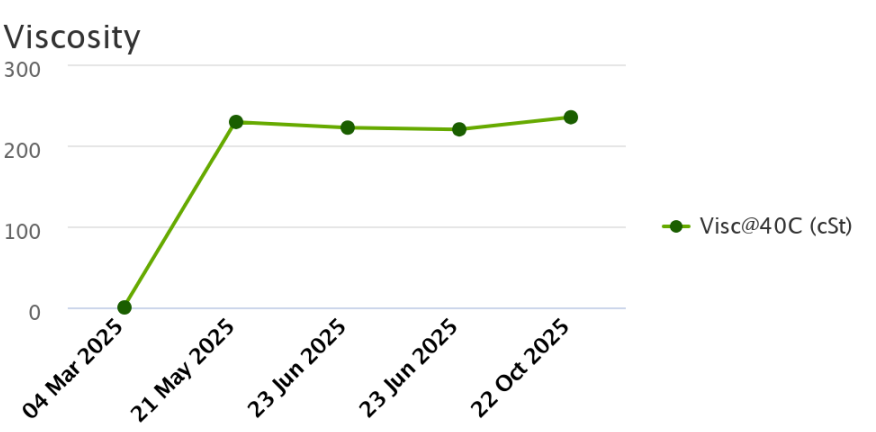

	Alert	
	Unit ID: 2-VS-1 Upper	Asset ID: 50254146
	Description: 2-VS-1 upper	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25308253046 Service Level: Essential Bottle ID: a037322841 Tested Lubricant: MOBIL SHC 629	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL SHC 629
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible sources of iron include: a. Machinery component wear; b. Metal-to-metal contact; c. Corrosion; d. Abrasive dirt contamination. The oil may be unfit for continued use and should be closely monitored for further condition regressions. Inspect the equipment for signs of damage. Change the oil after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Possible sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point). Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 22 Oct 2025 9:24 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: