



Bridge Inspection Report

180570026103105

LOOP 12 WB

over


US 67



Inspection Date: 01/28/2024

Inspected By: Daniel Pelayo

Inspection Type(s): Routine

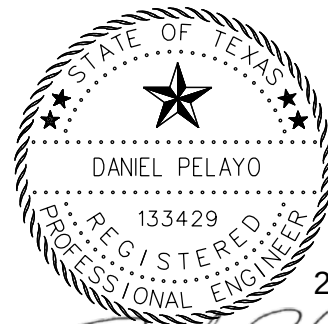

2/18/2024

A handwritten signature in black ink, appearing to read "Daniel Pelayo".

Tejas Structural, LLC (F-23315) for
Jim West Engineering, LLC (F-9220)
TxDOT Contract 88-2IDP5055-WA3

TABLE OF CONTENTS

	PAGE NUMBER
LOCATION MAP	1
BRIDGE INSPECTION RECORD (1085)	2
BRIDGE INVENTORY RECORD	5
UNDERCLEARANCE RECORD	6
ELEMENTS	7
PICTURES	8

Inspector: Pelayo, Daniel

Inspection Date: 01/28/2024

Parent Contract: 88-2IDP5055- Jim West
Engineering, LLC-RT




Bridge Inspection Report

Structure Number: 180570026103105

Facility Carried: LOOP 12 WB

Features Intersected: US 67

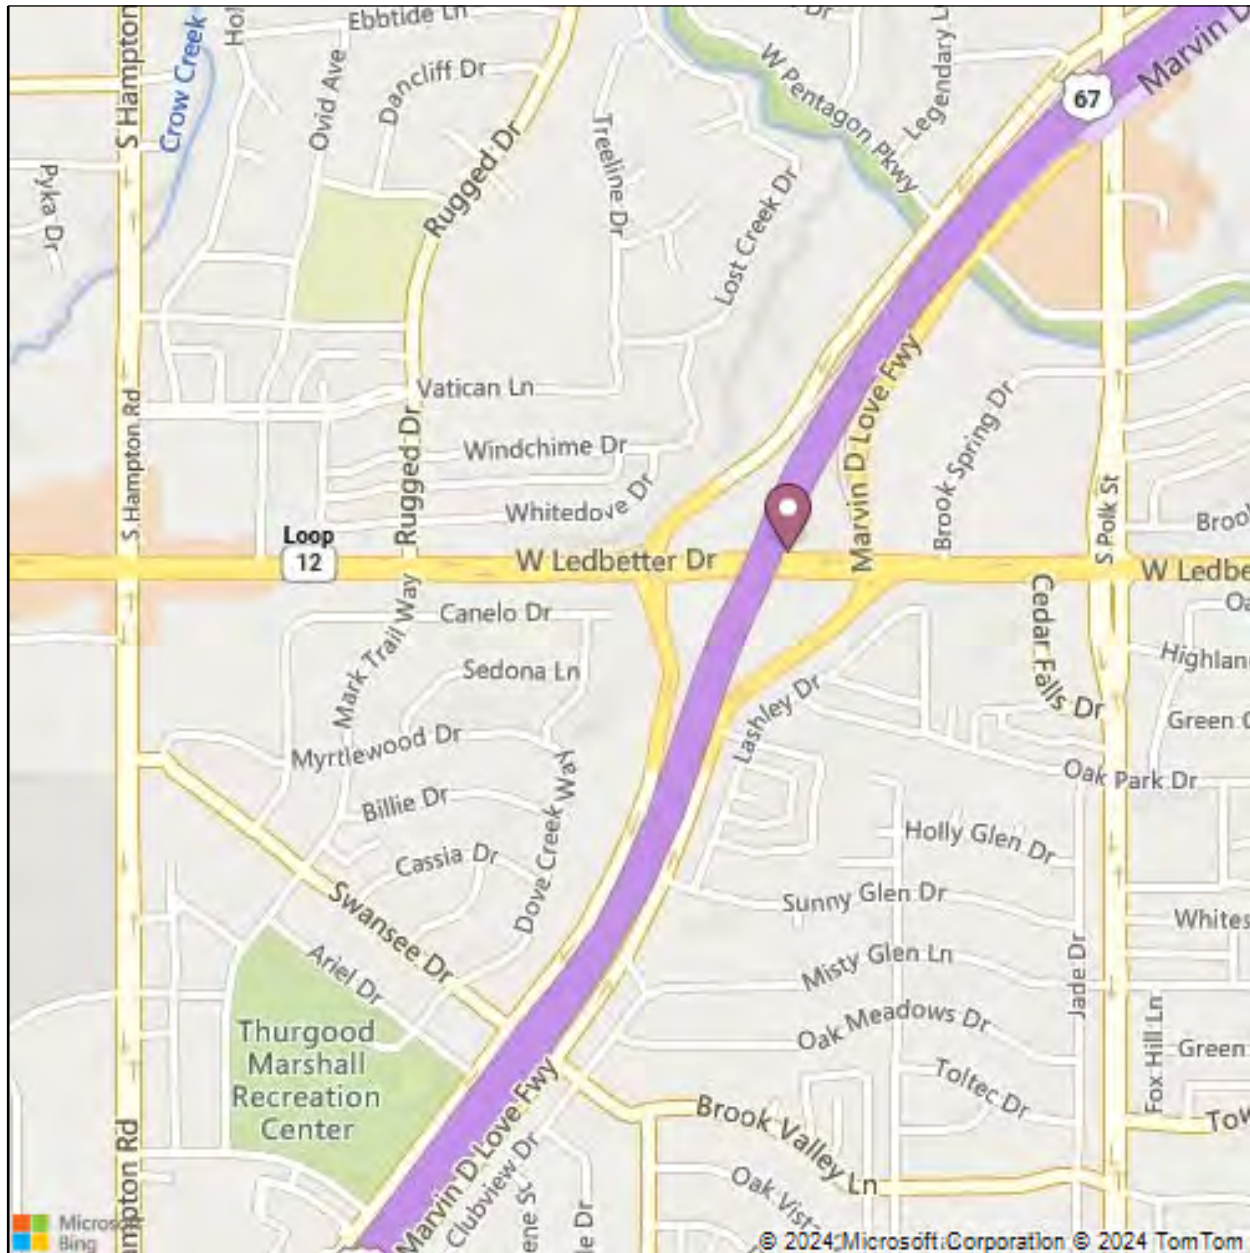

Latitude: 32.69145008

Longitude: -96.84570508

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.



BRIDGE INSPECTION RECORD

Structure Number
Facility Carried
Feature Intersected

180570026103105
LOOP 12 WB
US 67

Inspector
Inspection Date
Maint. Section

Pelayo, Daniel
01/28/2024
15

Condition Rating	Description*
N	Not Applicable
9	Excellent Condition
8	Very Good Condition - no problems noted
7	Good Condition - some minor problems
6	Satisfactory Condition - minor deterioration of structural elements (limited)
5	Fair Condition - minor deterioration of structural elements (extensive)
4	Poor Condition - deterioration significantly affects structural capacity
3	Serious Condition - deterioration seriously affects structural capacity, local failures possible
2	Critical Condition - advance deterioration of primary elements, bridge should be closed until repaired
1	Failing Condition - bridge closed but repairable
0	Failed Condition - bridge closed and beyond repair

*These descriptions are for items 58, 59, 60 and 65. Code Items 61 and 62 according to the TxDOT Coding Guide.

Bridge Description:

4 Span Continuous Steel Stringer Bridge on Concrete Substructure

Seal:

Signature & Date:

Prime Firm Name & Number:

Sub Firm Name & Number:

General Comments:

(W to E) Spans: (40 ft - 72 ft - 72 ft - 40 ft)

DECK (ITEM 58)

Structure ID: 180570026103105 Inspection Date: 01/28/2024

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Deck - Component Rating		1	6	
Wearing Surface	None	6	N	1. Concrete deck top surface has minor wear and cracks. Deck soffit has a few minor cracks with efflorescence and isolated minor spalls with exposed rebar. Original deck soffit has some areas with map pattern cracks with efflorescence near the interior supports (see photo) and have some patched areas.
Surfacing Thickness:	0 inches			
Fill Height:	inches			
Joints, Expansion, Open		6	N	2. Joint seals are in good condition.
Joints, Expansion, Sealed		6	8	
Joints, Other		6	8	
Drainage System		6	8	3. Concrete sidewalks have minor scaling and minor cracks.
Curbs, Sidewalk & Parapets		6	7	
Median Barrier		6	N	
Railings		6	7	4. Concrete rail parapet has minor scaling and cracks. Steel rails have widespread paint failure and minor rusting.
Railing Type:	Not Listed Steel and Concrete			
Railing Protective Coating		7	7	See comment 4.
Delineation		7	N	5. Bridge ID stencil is missing.
Other	Bridge ID	-	7	

SUPERSTRUCTURE (ITEM 59)

Structure ID: 180570026103105 Inspection Date: 01/28/2024

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Main Members - Steel		0	7	1. Steel beams and diaphragms have isolated paint failure and minor rusting mostly over abutment joints. Beams have some pitting along the bottom of the webs near the abutments.

Main Members - Concrete	0	N	
Main Members - Timber	0	N	
Main Members - Connections	0	8	
Floor System Members	1	N	
Floor System Connections	1	N	
Secondary Members	5	7	See comment 1.
Secondary Mem. Connections	5	8	
Expansion Bearings	6	7	2. Steel bearings at the west abutment have paint failure and minor rusting.
Fixed Bearings	6	7	See comment 2.
Steel Protective Coating	6	7	See comment 1 and 2.
Other	-	N	
Overall Component Rating	7		

SUBSTRUCTURE (ITEM 60)

Structure ID: 180570026103105 Inspection Date: 01/28/2024
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Abutment Caps		0	7	1. Concrete abutment caps and backwalls have minor cracks. Wingwalls have minor spalls.
Above Ground		0	N	
Below Ground or Foundation		0	8	
Backwalls & Wingwalls		0	7	See comment 1.
Intermediate Supports:				
Caps - Concrete		-	7	2. Interior support caps have minor flexural cracks and have minor diagonal cracks over columns.
Caps - Steel		-	N	
Caps - Timber		-	N	
Above Ground - Concrete		-	7	3. The 4th north column at Bent 2 has minor cracks at a patch.
Above Ground - Steel		-	N	
Above Ground - Timber		-	N	
Above Ground - Masonry		-	N	
Below Ground or Foundation		-	8	
Collision Protection System		5	8	
Steel Protective Coating		6	N	
Overall Component Rating	7			

CHANNEL (ITEM 61)

Structure ID: 180570026103105 Inspection Date: 01/28/2024
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Channel Banks		0	N	
Channel Bed		0	N	
Rip Rap, Toe Walls & Apron		5	N	
Dikes		5	N	
Jetties		5	N	
Other		-	N	
Overall Component Rating	N			

CULVERTS (ITEM 62)

Structure ID: 180570026103105 Inspection Date: 01/28/2024
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Top Slabs		0	N	
Bottom Slab or Footing		0	N	
Abutments, Intermed. Supports		0	N	
Headwalls & WingWalls		5	N	
Other		-	N	
Overall Component Rating	N			

APPROACHES

Structure ID: 180570026103105 Inspection Date: 01/28/2024

(ITEM 65)

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Embankments		0	8	
Embankment Retaining Walls		4	N	
Slope Protection		5	7	1. Concrete riprap has minor cracks.
Roadway		5	7	2. Original concrete approach slabs have minor cracks and wear.
Relief Joints		6	6	3. Relief joint seals have mostly failed.
Drainage		6	8	
Guardfence		6	N	
Delineation		7	8	
Sight Distance		7	8	
Other		-	N	
Overall Component Rating			7	

MISCELLANEOUS

Structure ID: 180570026103105 Inspection Date: 01/28/2024
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Signs		N	8	1. Posted vertical clearance signs: US 67 NBML: 18 FT 4 IN. (posted on structure 0261-03-104) US 67 SBML: 15 FT 8 IN. US 67 Toll Lane: 17 FT 1 IN.
Illumination		N	N	
Warning Devices		N	N	
Utility Lines		7	8	2. Two 3-inch diameter and 1 inch diameter conduits attached to north side of bridge. 1 inch diameter electrical conduit attached to south side of bridge.
Other		N	N	

APPRAISAL RATINGS

Structure ID: 180570026103105 Inspection Date: 01/28/2024
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

TRAFFIC SAFETY FEATURES (ITEM 36)		Rating	Comment
0 - Does not meet current standards	Bridge Rails:	0	Non-standard T4 (RH = 32 in.)
1 - Meets current standards	Transitions:	0	Not attached
N - Not applicable	Appr. Rails:	1	
	Appr. Rail Ends:	1	
WATERWAY ADEQUACY (ITEM 71)		N	
APPROACH ROADWAY ALIGNMENT (ITEM 72)		8	Regulatory / Advisory Speeds: 50 mph / 50 mph



BRIDGE INVENTORY RECORD

Structure Number
Facility Carried
Feature Intersected

180570026103105
LOOP 12 WB
US 67

Inspector
Inspection Date
Maint. Section

Pelayo, Daniel
01/28/2024
15

District	18-Dallas	County	057-DALLAS	Latitude	32.69145008	Seal:
Milepoint	06.164	System	1 - On System	Longitude	-96.84570508	
General Description: 4 Span Continuous Steel Stringer Bridge on Concrete Substructure						
Bridge Length (ft.)	226	Deck Width (ft.)	56.3			Signature & Date:
Skew Angle (degrees)	25	Clear Width Between (ft.)	48.0			
Right / Left Forward	Left Forward	Measurement Feature	Curbs			
Vertical Over-Clearance	99.99	☒ Unimpaired Over-Clearance				
Surfacing Type	None	Deck Type	1 - Concrete Cast-in-Place			Prime Firm Name & Number:
Lanes On	04	Lanes Under	07			
Bridge Rail	Type T4	Approach Roadway Width (ft.)	48			Sub Firm Name & Number:

Superstructure:	Spans	1 to 4				
Main:	Type	Continuous Steel Girders	Size	WF33x130 & WF33x141	Number	7
	Spacing	See Plans	Controlling Span Length (C-C bearings)	72.0		
Superstructure:	Spans					
Major Approach:	Type		Size		Number	
	Spacing		Controlling Span Length (C-C bearings)			
Superstructure:	Spans					
Minor Approach:	Type		Size		Number	
	Spacing		Controlling Span Length (C-C bearings)			

Estimated Deck Overtopping Frequency	Comments:	
Estimated Approach Overtopping Frequency	(W to E) Spans: (40 ft - 72 ft - 40 ft) Controlling span length is nominal.	
Horizontal / Vertical Alignment	Good	/ Good
Regulatory / Advisory Speeds	50 mph / 50 mph	
Year Built	1961	Year(s) Widened 1969
Posted Load Restriction	NNN	☒ No Restriction
Design Load	4 - H 20	
Design Method	ASD	


DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.



Underclearance Record

Form 2601
(03/16)
Page 1 of 1

District: 18 County: 057 Control - Section: 0261 - 03 Structure #: 105 Route: Loop 12 WB
Feature Crossed: US 67 Inspector's Signature: [Signature] Date: 1/28/2024
Company Name and Company Number: Jim West Engineering, LLC (F-9220)

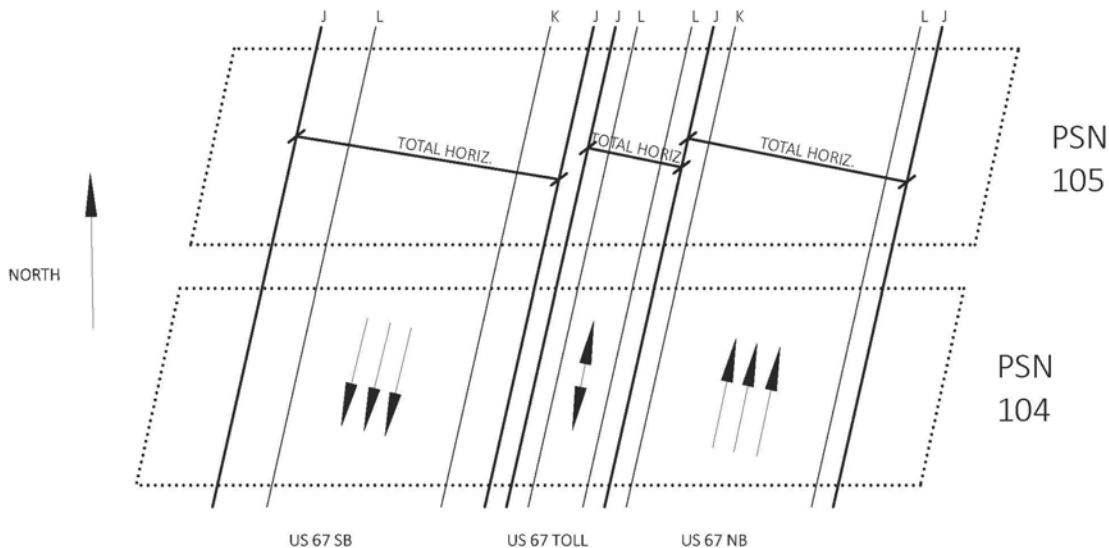

X - LOCATION OF MINIMUM VERT. CLEARANCE

MEASUREMENTS ARE IN FEET

Controlling Item No.:	54.2 - Min. Vertical Clearance	10 or 10A - Max. 10' Wide Vertical Clearance	55.2 - Right Lateral Clearance	56 - Left Lateral Clearance	47 or 47A - Total Horizontal Clearance
-----------------------	--------------------------------	--	--------------------------------	-----------------------------	--

Reference Features:

A. Beam C. Cap E. Guard fence G. Pile I. Toe of >3:1 Slope K. Middle of Yellow Stripe M.
B. Slab D. Railing F. Column H. Curb J. Barrier L. Middle of White Stripe N.

Feature Xed →	US 67 SB			US 67 Toll			US 67 NB					
PSN: 0261-03-105	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.
Right Lateral Clearance	11.7'	L - J		4.0'	L - J		1.3'	L - J	55.2			
Left Lateral Clearance	11.1'	K - J					1.5'	K - J	56			
Total Horizontal Clr	55.0'	J - J	47A	21.0'	J - J	47C	38.0'	J - J	47B			
Max Practical Vert Clr												
Min Measured Vert Clr												
Signed Vertical Clr	15' - 8"		Tolerance	17' - 1"		Tolerance			Tolerance			Tolerance

PSN: 0261-03-104	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.
Right Lateral Clearance	11.7'	L - J		4.0'	L - J		1.3'	L - J	55.2			
Left Lateral Clearance	11.1'	K - J					1.5'	K - J	56			
Total Horizontal Clr	55.0'	J - J	47A	21.0'	J - J	47C	38.0'	J - J	47B			
Max Practical Vert Clr												
Min Measured Vert Clr												
Signed Vertical Clr			Tolerance	17' - 1"		Tolerance	18' - 4"		Tolerance			Tolerance

Inspector: Pelayo, Daniel
 Inspection Date: 01/28/2024
 Parent Contract: 88-2IDP5055- Jim West
 Engineering, LLC-RT



Structure Number: 180570026103105
 Facility Carried: LOOP 12 WB
 Features Intersected: US 67

	Environment	Total Quantity	Units	Condition State 1	Condition State 2	Condition State 3	Condition State 4
12-Reinforced Concrete Deck	3 - Mod.	12612	sq. ft.	6886	5666	60	0
1080-Delamination/Spall/Patched Area		110		0	110	0	0
1120-Efflorescence/Rust Staining		416		0	356	60	0
1130-Cracking (RC and Other)		3700		0	3700	0	0
1190-Abrasion/Wear (PSC/RC)		1500		0	1500	0	0
107-Steel Open Girder/Beam	3 - Mod.	1568	ft.	1468	100	0	0
1000-Corrosion		100		0	100	0	0
205-Reinforced Concrete Column	3 - Mod.	12	each	11	1	0	0
1080-Delamination/Spall/Patched Area		1		0	1	0	0
215-Reinforced Concrete Abutment	3 - Mod.	124	ft.	106	18	0	0
1130-Cracking (RC and Other)		18		0	18	0	0
234-Reinforced Concrete Pier Cap	3 - Mod.	180	ft.	165	15	0	0
1130-Cracking (RC and Other)		15		0	15	0	0
311-Movable Bearing	3 - Mod.	28	each	21	7	0	0
1000-Corrosion		7		0	7	0	0
313-Fixed Bearing	3 - Mod.	7	each	7	0	0	0
321-Reinforced Concrete Approach Slab	3 - Mod.	1920	sq. ft.	1813	107	0	0
1080-Delamination/Spall/Patched Area		7		0	7	0	0
1130-Cracking (RC and Other)		100		0	100	0	0
330-Metal Bridge Railing	3 - Mod.	452	ft.	0	452	0	0
1000-Corrosion		452		0	452	0	0

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Inspector: Daniel Pelayo
Inspection Date: 01/28/2024



Structure Number: 180570026103105
Facility Carried: LOOP 12 WB

Bridge Inspection Report

Pictures



PHOTO 1 Roadway View

Description Looking West



PHOTO 2 Elevation View

Description Looking SW

Inspector: Daniel Pelayo
Inspection Date: 01/28/2024



Structure Number: 180570026103105
Facility Carried: LOOP 12 WB

Bridge Inspection Report

Pictures



PHOTO 3 Superstructure View

Description Looking West



PHOTO 4 Roadway Under View

Description US 67 NB - Looking NE

Inspector: Daniel Pelayo
Inspection Date: 01/28/2024



Structure Number: 180570026103105
Facility Carried: LOOP 12 WB

Bridge Inspection Report

Pictures



PHOTO 5 Roadway Under View

Description US 67 SB - Looking SW



PHOTO 6 Defect

Description Deck soffit map pattern cracks over Bent 4 - Looking West - Rating: 6
Original deck soffit has some areas with map pattern cracks with efflorescence near the interior supports.