



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

IDENTIFICATION

Asset ID:	00261	(009) Location [B.L.11]:	4 MI E OF KINGSTREE
(468) Structure Number:	4540026100200	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(45) Williamsburg
(42A) Type of Service On [B.F.01]:	1 Highway	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	BOGGY SWAMP	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	5 Waterway	(011) Mile Post [B.H.07]:	16.751 mi (26.957 km)
(021) Custodian:	01 SCDOT	(106) Year Recon [B.W.02]:	1967
(027) Year Built [B.W.01]:	1927	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL


(058) Deck Structure Condition [B.C.01]:	N N/A (NBI)	(602) Bridge Railing Condition [B.C.05]	N N/A (NBI)
(059) Superstructure Condition [B.C.02]:	N N/A (NBI)	(603) Bridge Railing Trans. Condition [B.C.06]:	N N/A (NBI)
(060) Substructure Condition [B.C.03]:	N N/A (NBI)	(604) Bridge Bearing Condition [B.C.07]	N N/A (NBI)
(062) Culvert Retaining Condition [B.C.04]:	7 Minor Deterioration	(605) Bridge Joint Condition [B.C.08]:	N N/A (NBI)
(600) UW Substructure Condition [B.C.15]:	7 Good	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	5 Bank Prot Eroded	(071) Waterway Adequacy [B.AP.02]:	8 Equal Desirable
(601) Channel Protection Condition [B.C.09]:	N N/A (NBI)	(113) Scour Condition:	8 - Calc Scour Above Ftg
(633) NSTM Condition:	N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	7 - Minor

GEOMETRY

(034) Skew [B.G.11]:	0	(032) Approach Roadway [B.G.09]:	24.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	24.0
(049) Structure Length [B.G.01]:	20.8	(052) Deck Width Out-To-Out [B.G.05]:	48.0
(619) Curved Bridge [B.G.12]:	N - Not Curved	(441) Deck Area [B.G.16]:	999.84
(620) Maximum Height Bridge [B.G.13]:	6	(033) Bridge Medians [B.G.10]:	0 No median
(621) Side Hill Bridge [B.G.14]:	No	(50A) Curb Sidewalk Width/Left [B.G.07]:	0.0
		(50B) Curb Sidewalk Width/Right [B.G.08]:	0.0
		(606) Minimum Span Length [B.G.04]:	10.0

CULVERT GEOMETRY

(045) # of Main Spans:	2
(43A) Main Material:	2 Concrete Continuous
(43B) Main Design:	19 Culvert
(48) Max Span Length [B.G.03]:	10.0
(607) Main Number Of Beam Lines [B.SP.03]:	1
(608) Main Span Continuity [B.SP.05]:	7 - Buried
(609) Main Protection System [B.SP.07]:	Unprotected Span
(610) Main Deck Interaction [B.SP.08]:	0 - No Deck
(611) Main Deck Reinforcement Protect [B.SP.12]:	0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]:	0 - None

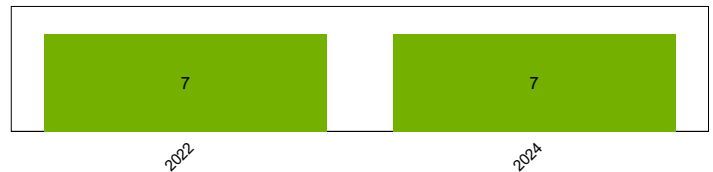

CULVERT CONDITION

(36A) Bridge Rail:	0 Substandard
(36B) Transition:	0 Substandard
(36C) Approach Rail:	0 Substandard
(36D) Approach Rail Ends:	0 Substandard

PARKING LOCATION

Parking Latitude (if one provided):	33.693124	Parking Longitude (if one provided):	-79.742402
Parking Notes (if provided):	Parked at Northwest shoulder		



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

INSPECTION

(090) Date of Inspection: 11/6/2024
(091) Frequency: 24
Water over 4' but UW Inspection Not Needed (No Request): 0
Temperature During Inspection (°F): 71
Weather During Inspection: 2 - Cloudy
Team Members: Jay Hahn
Schedule Notes:

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	24	11/6/2024	11/6/2026
NSTM (A)			
Underwater (B)	60	4/1/2022	4/1/2027
Special (C)			
Other Routine			
Complex Other			
Damage			
Load Rating			

LOAD RATING AND POSTING

(070) Posting %: 5 - Equal/Abv Legal Load
(031) Design Load [B.LR.01]: 2 M 13.5 (H 15)

(411) Date Evaluated [B.LR.03]: 11/01/2020
(418A) Deck/Culvert Condition: 7
(418B) Superstructure Condition:
(418C) Substructure Condition:

(063) Opr Method [B.LR.04]: 6 LFR
(064) Opr Rating [B.LR.06]: 1.15 rf
(065) Inv Method [B.LR.04]: 6 LFR
(066) Inv Rating [B.LR.05]: 0.69 rf
(465) Alternative Inventory Rate Method: 8 LRFR (HL93)
(466) Alternative Inventory Rating Factor: 0.79 rf
(463) Alternative Operating Rate Method: 8 LRFR
(464) Alternative Operating Rating Factor: 1.03 rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values

(443) Legal (non-EV) Single 2-3 Axles (tons):
(444) Legal (non-EV) Single 4+ Axles (tons):
(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values

(446) EV Single Axle (tons):
(447) EV Tandem Axle (tons):
(448) EV Gross (tons):

40T Combination Posting

(889) 40T Combination Sign Posted: 0 - No, Not Posted

ROADWAY AND CLEARANCES

		Location	
(05B) Kind of Hwy:	3 State Hwy	Route Posted Speed:	-1
(011) Milepost [B.H.07]:	16.751 mi (26.957 km)	(102) Direction of Traffic [B.RT.03]:	2 2-way traffic
(019) Detour Length [B.H.17]:	4 mi (6 km)	SCDOT Route Type:	4
		Evac Route:	0

Clearances

(28A) Lanes On Structure:	2	(622) Railroad Service Type [B.RR.01]:	
(28B) Lanes Under Structure:	0	(574) Railroad Min. Vert. Clearance:	
(053) Min. Vertical Clearance Over Bridge [B.H.13]:	99.99	(575) Railroad Min. Horiz. Offset:	
(054A) Under Vertical Clearance Ref. [B.H.13]:	N Feature not hwy or RR	(038) Navigable Waterway [B.N.01]:	Permit Not Required
(055A) Under Horizontal Clearance Ref. [B.H.15&14]:	N Feature not hwy or RR	(039) Navigation Min Vertical Clearance [B.N.02]:	0.00
(54B) Minimum Vertical Underclearance [B.H.13]:	0.00	(116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]:	0.00
(055B) Minimum Lateral Underclearance R [B.H.15]:	0.00	(040) Navigation Channel Width [B.N.04]:	0.00
(056) Minimum Lateral Underclearance L [B.H.14]:	0.00	(631) Nav. Channel Min. Horiz. Clearance [B.N.05]:	0.00
(010) Wide Load Clearance Vertical:	99.99		



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

(047) Wide Load Clearance Horizontal [B.H.16]:

24.00

(111) Substructure Nav. Protection [B.N.06]:

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.N. 01&02]: 06 Rural Minor Arterial
(104) NHS: 0 Not on NHS
(100) Defense Hwy: 0 Not a STRAHNET hwy
(029) ADT [B.H.09]: 2,300 Cars/Day

(109) Pct Trucks [B.H.10]: 9%
(030) ADT Year [B.H.11]: 2023
(114) Future ADT: 3,657
(115) Year Of Future ADT: 2043



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]:	1 Highway	(506) Signs/Utilities attached:	U - Utilities Attached
(42B) Type Of Service Under [B.F.02]:	5 Waterway	(630) Fatigue Details [B.IR.02]:	
(027) Year Built [B.W.01]:	1927	(507) Damaged Deck:	N - No Damage
(106) Year Reconstructed [B.W.02]:	1967	(508) Damaged Superstructure:	N - No Damage
(319) Paint Date:		(509) Damaged Substructure:	N - No Damage
(037) History [B.CL.04]:	5 Not eligible for NRHP	(510) Damaged Culvert:	N - No Damage
(112) NBIS Structure Length:	Y Long Enough		
Status of Consultant Repair Recommendations:	Submitted but Unsigned	(502) Bent or Barrel Direction:	1 - West to East
		(503) Date of Inventory Photos:	11/06/2024
		(504) Asset ID Placard Location:	Bent 1 (SW Corner)
		(505) Stream Flow Direction:	1 - North to South

CURB REVEAL MEASUREMENTS

No Curb:	Yes	Hidden Curb:	No
Curb Reveal Beginning Left (in):		Curb Reveal Beginning Right (in):	
Curb Reveal End Left (in):		Curb Reveal End Right (in):	

CULVERT FILL INVENTORY

Not a Culvert (N/A):	No	Max Fill (ft):	1.5
Culvert Inlet (ft):	1.0	Culvert Outlet (ft):	1.0
Edge of Roadway on Inlet Side of Road (ft):	1.0	Edge of Roadway on Outlet Side of Road (ft):	1.5

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
241/3	Re Conc Culvert	96	1%	1	96%	92	3%	3	0%	0
1080/3	Delamination/Spall/Patched Area	1	0%	0	0%	0	100%	1	0%	0
1130/3	Cracking (RC and Other)	6	0%	0	67%	4	33%	2	0%	0
1190/3	Abrasion(PSC/RC)	88	0%	0	100%	88	0%	0	0%	0



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
241/3	Re Conc Culvert	96	ft	1	92	3	0
(2) Barrel Reinforced Concrete box culvert (48ft L x 10ft W x 10ft H). Original section is (24ft L), Widened (12ft L) on each side. Both barrels, along water line, minor abrasion (1ft high x 1/8in deep). [1190, CS2, Q88] Barrel 1, top slab at south end, honeycombing and spall (8in L x 14in W x 1in D) with (2) exposed rebars. [1080, CS3, Q1] IW 1, North widened portion, vertical crack (full height x 1/32in). [1130, CS2, Q1] IW 1, original portion, (3) vertical cracks (full height x 1/32in). [1130, CS2, Q3] IW 1, at South widened construction joint, vertical cracks (full height x 3/16in). [1130, CS3, Q1] EW 2, at South widened construction joint, vertical cracks (full height x 3/16in). [1130, CS3, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	1	ft	0	0	1	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/3	Cracking (RC and Other)	6	ft	0	4	2	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/3	Abrasion(PSC/RC)	88	ft	0	88	0	0



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

N/A

Traffic Signs

(4) Delineators.

NW delineator is set low and partially obstructed by telephone cable enclosure.

Encroachments

(1) metal conduit (1-1/2in diameter) and (1) metal conduit (2-1/2in diameter) along North end of culvert.

Utility conduits disconnected from support brackets over IW 1.

Waterway and Channel

Waterway Details:

- Maximum water depth is 5.6ft at IW1 inlet side.
- The flow angle of attack is 10 degrees with no significant effect on the structure.

Debris/Obstructions:

- Both barrels at inlet, drift accumulation (20ft W x 4ft L x up to 2ft D).
- Both barrels have approximately 60% blockage due to sediment buildup (6ft high x full length).
- Barrel 2 at outlet heavy silt accumulation (5ft deep) with heavy vegetation growth restricting water flow through the barrel.

Channel Protection:

- The embankments at all corners of the culvert are vegetated with areas of erosion behind the wingwalls.
- The channel bottom upstream and downstream of the culvert primarily consists of silt.

Scour:

- There has been approximately 1ft of degradation along the inlet of the culvert since the 2018 Routine Inspection.

Approach Roadway Condition

Approach erosion at all corners of culvert exposing top slab.

Wearing surface over the culvert, sealed and open cracks, up to 1/4in wide, throughout.

Fender System

N/A

Median and Other Barriers

36A -0: None

36B -0: None

36C -0: None

36D -0: None

Under Bridge Railings/Barriers

N/A

Curbs and Sidewalks

(2) Reinforced Concrete Headwalls (12in H x 11in W).

North headwall, at West end, scattered spalling (4ft total long x up to 4in wide x up to 1in deep).

North headwall, at East end, spall (14in long x 11in wide x up to 12in deep).

Drainage System

Original top slab drain holes have been sealed.

Diaphragms

N/A

Wingwalls

(4) Reinforced Concrete Wingwalls at all corners.

All wingwalls, scattered spalls along top inside corner.



Bridge Inspection Report

00261

Team Leader: Michael Meyer

(7) Facility Carried: SC 261

Inspection Date: 11/06/2024

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

(623) Summary of Previously Performed Maintenance Work [B.W.03]

N/A

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

INSPECTION PHOTOS



Photo 1:
West Approach Looking East



Photo 2:
East Approach Looking West



Photo 3:
Backstation (West Approach Looking West)



Photo 4:
Upstation (East Approach Looking East)

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 5:
North Profile Looking South



Photo 6:
South Profile Looking North



Photo 7:
Feature Intersected (Looking Upstream) (North)



Photo 8:
Feature Intersected (Looking Downstream) (South)

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 9:
Asset ID Plaque at Bent 1 (SW Corner)



Photo 10:
Typical Reinforced Concrete Headwall (North Shown)



Photo 11:
Asphalt Wearing Surface



Photo 12:
Looking North through Barrel 1

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 13:
Typical Wingwall (All Corners) (Southwest Shown)



Photo 14:
(1) metal conduit (1-1/2in diameter) and (1) metal conduit (2-1/2in diameter) along North end of culvert.



Photo 15:
Both barrels, along water line, minor abrasion (1ft high x 1/8in deep).



Photo 16:
Barrel 1, top slab at south end, honeycombing and spall (8in L x 14in W x 1in D) with (2) exposed rebars.

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 17:

IW 1, North widened portion, vertical crack (full height x 1/32in).



Photo 18:

IW 1, at South widened construction joint, vertical cracks (full height x 3/16in).



Photo 19:

EW 2, at South widened construction joint, vertical cracks (full height x 3/16in).



Photo 20:

NW delineator is set low and partially obstructed by telephone cable enclosure.

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 21:

Utility conduits disconnected from support brackets over IW 1.



Photo 22:

Both barrels at inlet, drift accumulation (20ft W x 4ft L x up to 2ft D).



Photo 23:

Approach erosion at all corners of culvert exposing top slab.



Photo 24:

North headwall, at West end, scattered spalling (4ft total long x up to 4in wide x up to 1in deep).

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056



Photo 25:

North headwall, at East end, spall (14in long x 11in wide x up to 12in deep).



Photo 26:

All wingwalls, scattered spalls along top inside corner.



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

STREAMBED CROSS SECTIONS

Orientation:	Left View	Snding Date:	11/2024
Offset Remark:	Inlet	Location of BM:	Top of Headwall
Elev Basis:	Assumption	Offset:	24.00
Water Surface:	-5.20		
SND/ELEV Ind.:	Soundings		

Streambed Details

Stations	SND/ELEV		Remarks
1 + 0.0	10.8	_____	Exterior Wall 1
1 + 5.0	10.0	_____	Barrel 1
1 + 10.0	10.8	_____	Interior Wall 1
1 + 15.0	10.3	_____	Barrel 2
1 + 20.0	9.9	_____	Exterior Wall 2

STREAMBED CROSS SECTIONS

Orientation:	Right View	Snding Date:	11/2024
Offset Remark:	Outlet	Location of BM:	Top of Headwall
Elev Basis:	Assumption	Offset:	24.00
Water Surface:	-5.20		
SND/ELEV Ind.:	Soundings		

Streambed Details

Stations	SND/ELEV		Remarks
1 + 0.0	10.0	_____	Exterior Wall 1
1 + 5.0	10.0	_____	Barrel 1
1 + 10.0	9.6	_____	Interior Wall 1
1 + 15.0	8.7	_____	Barrel 2
1 + 20.0	6.7	_____	Exterior Wall 2



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

SCOUR AND WATERWAY

Request Scour Evaluation: No Request Waterway Adequacy: No

Request Scour Evaluation Reason:

Request Waterway Adequacy Evaluation Reason:

Inspection Information

Streambed Information

(511) Bridge Over Tidal Waterway: No
(512) Tide Status During Inspection:
(513) Time During Tidal Inspection:
(517) Max Water Depth at Bent (ft) 5.6
(518) Dry Channel: No

(519) Water Level: 1 - Within Banks
(520) Debris Buildup: Yes
(521) Bed Deposits Downstream: No
(522) Up/Dwnstrm Ch. Stab.: Channel Stable
(523) Riprap (if any) Displaced: N/A (No Riprap)
(524) Structure on a Channel Change: No
(525) Stream Aggradation or Degradation: None Observed
(526) Lateral Movement of Stream: No Movement
(527) Lakes, dams near the bridge? No Feature

Evidence of Scour

Underwater Bridge Inspection Only

(534) SSU's Inspected:

(528) Scour Holes at End Bents: No
(529) Scour Holes at Bents: No
(530) Scour Holes at Culvert Inlet: No
(531) Scour Holes at Culvert Outlet: No
(532) Footing Exposed: No
(533) Bank Soil Material Washing Out: No

(535) ADCI Dive Supervisor:
(536) ADCI Tender/Diver(s):

Scour Condition, POA and Vulnerability

(442A) Scour Plan of Action Followed: No
(442B) POA Category 1:
(442C) POA Category 2:
(450) Scour Risk Bin: 2
(451) Monitoring / Scour Risk Bin:

(537) Water Temperature:
(538) Visibility:
(539) Flow Velocity:

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:	(312) Responsible District:	5
(98A) Border Bridge FHWA Region:	(311) Responsible County:	45
(98A) Border Bridge State:	(439) Asset Management:	0
(101) Parallel Structure: No bridge exists	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:	(SBI) Topside Inspection Category:	CB2
(422) Date of Temporary Structure:	(SBI) Underwater Inspection Category:	UA1
(SBI) Island Mobility Bridge: No		

JOINT

Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter

Notes:



Bridge Inspection Report

00261

Team Leader: Michael Meyer
Inspection Date: 11/06/2024

(7) Facility Carried: SC 261
(6) Crossing: BOGGY SWAMP
Inspection Type(s): Routine
(16) Latitude: 33.693197 (17) Longitude: -79.742056

BEARINGS						
Bent #	Bearing #	Bearing Type	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)
Notes:						

PILES							
Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness
Notes:							



Bridge Inspection Report

00261

Team Leader: Michael Meyer

(7) Facility Carried: SC 261

Inspection Date: 11/06/2024

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

PROCEDURES FOR THIS INSPECTION

Done	Insp Type	Procedure Type	Procedure Name	Details
S	Routine	Routine (Typical)	Inspection: Timber Sounding	Sound full length of exposed timber piles (including through bolts) per BIGD 5.3.3.1 and 5.3.3.2.1.
S	Routine	Routine (Typical)	Inspection: Pile Sketch	Pile Sketch Table required when NBI Item 60 Condition Rating = 5. Per BIGD 5.3.3.1 and 5.4.4.5.
R	Routine	Routine (Typical)	Inspection: Defect Photos	Any NBE (element) with CS3 or CS4 Any deterioration causing an NBE (element) to have a CS3 or CS 4 documented with a photograph. Per BIGD 5.4.4.2.
R	Routine	Routine (Typical)	Post-Inspection: Requests	Confirm that all Inspection Requests are included as both scheduled inspections in the Schedule Table and the Requests Table when needed. Confirm requests include Load Rating (if needed) (NBI GCR 7 to 5 or NBI GCR to 4, Element CS4, etc.). Confirm requests include Hydraulic Appraisal (if needed) (NBI 071 and NBI 113). Confirm requests include UW (Unscheduled) (Water Depth 4' or more at Bent).



Bridge Inspection Report

00261

Team Leader: Michael Meyer

(7) Facility Carried: SC 261

Inspection Date: 11/06/2024

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

R	Routine	Routine (Typical)	Post-Inspection: Data Verification	Verify the correct: 1) Traffic Status (NBI 041), 2) Inspection Intervals (NBI 090 to 093), 3) Bridge Condition (NBI 58, 59, 60 or 62), 4) Rating Values (NBI 064 and 066), and 5) Sign Posting Values (SBI 443 to 448 and 889).
S	Routine	Routine (Typical)	Inspection: Posting Photos	Photographs of at bridge and advance (if present) posting or weight limit signs are required to be taken during all routine inspections. These requirements are applicable to the posting or weight limit signs at the bridge and in advance of the bridge which could require many signs to be photographed. These signs include R-12-6-48 and R-12-7-48 (legal loads), and R-12-9-36 (EV weight limit) at both ends of the bridge. Per BIGD 5.4.4.2 (TN03).

Inspector Procedure Notes
Substructure is a Culvert, No Pile Sketch Needed; No Timber Piles; Culvert is not Posted

EQUIPMENT USED IN THIS INSPECTION

Name	Hours	Cost
A06 Boat: John Boat without Motor	1.00	0
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

00261

Team Leader: Michael Meyer

Inspection Date: 11/06/2024

(7) Facility Carried: SC 261

(6) Crossing: BOGGY SWAMP

Inspection Type(s): Routine

(16) Latitude: 33.693197 (17) Longitude: -79.742056

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY Michael Meyer

Date 11/6/2024

QC Reviewed By: Bill Mitchell

QC Completed: 12/31/2024

QA Reviewed By:

QA Completed: