



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

IDENTIFICATION

Asset ID:	00237	(009) Location [B.L.11]:	4MI W OF PROSPECT
(468) Structure Number:	2140034100200	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(21) Florence
(42A) Type of Service On [B.F.01]:	1 Highway	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	GUM BRANCH	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	5 Waterway	(011) Mile Post [B.H.07]:	22.970 mi (36.967 km)
(021) Custodian:	01 SCDOT	(106) Year Recon [B.W.02]:	1937
(027) Year Built [B.W.01]:	1926	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL


(058) Deck Structure Condition [B.C.01]:	N N/A (NBI)	(602) Bridge Railing Condition [B.C.05]	N N/A (NBI)
(059) Superstructure Condition [B.C.02]:	N N/A (NBI)	(603) Bridge Railing Trans. Condition [B.C.06]:	N N/A (NBI)
(060) Substructure Condition [B.C.03]:	N N/A (NBI)	(604) Bridge Bearing Condition [B.C.07]	N N/A (NBI)
(062) Culvert Retaining Condition [B.C.04]:	Considerable Damage	(605) Bridge Joint Condition [B.C.08]:	N N/A (NBI)
(600) UW Substructure Condition [B.C.15]:	4 Poor	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	6 Bank Slumping	(071) Waterway Adequacy [B.AP.02]:	8 Equal Desirable
(601) Channel Protection Condition [B.C.09]:	N N/A (NBI)	(113) Scour Condition:	8 - Calc Scour Above Ftg
(633) NSTM Condition:	N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	4 - Moderate to Major

GEOMETRY

(034) Skew [B.G.11]:	0	(032) Approach Roadway [B.G.09]:	26.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	26.0
(049) Structure Length [B.G.01]:	32.0	(052) Deck Width Out-To-Out [B.G.05]:	42.0
(619) Curved Bridge [B.G.12]:	N - Not Curved	(441) Deck Area [B.G.16]:	1,344.00
(620) Maximum Height Bridge [B.G.13]:	8	(033) Bridge Medians [B.G.10]:	0 No median
(621) Side Hill Bridge [B.G.14]:	No	(50A) Curb Sidewalk Width/Left [B.G.07]:	0.0
		(50B) Curb Sidewalk Width/Right [B.G.08]:	0.0
		(606) Minimum Span Length [B.G.04]:	10.0

CULVERT GEOMETRY

(045) # of Main Spans:	3
(43A) Main Material:	2 Concrete Continuous
(43B) Main Design:	19 Culvert
(48) Max Span Length [B.G.03]:	10.0
(607) Main Number Of Beam Lines [B.SP.03]:	0
(608) Main Span Continuity [B.SP.05]:	7 - Buried
(609) Main Protection System [B.SP.07]:	Unprotected Span
(610) Main Deck Interaction [B.SP.08]:	0 - No Deck
(611) Main Deck Reinforcement Protect [B.SP.12]:	0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]:	0 - None

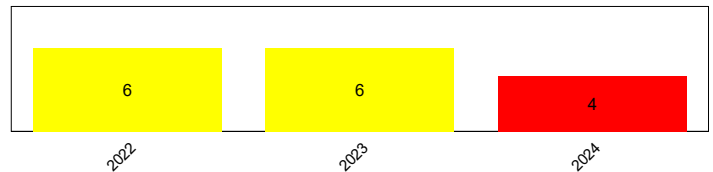

CULVERT CONDITION

(36A) Bridge Rail:	N N/A or not required
(36B) Transition:	N N/A or not required
(36C) Approach Rail:	1 Meets Standards
(36D) Approach Rail Ends:	1 Meets Standards

PARKING LOCATION

Parking Latitude (if one provided):	33.831383	Parking Longitude (if one provided):	79.626850
Parking Notes (if provided):	NE corner paved area.		



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

INSPECTION

(090) Date of Inspection: 9/19/2024
(091) Frequency: 24
Temperature During Inspection (°F): 81
Weather During Inspection: 2 - Cloudy
Team Members: Ray Cortright; Stuart Pitre; Nicholas Schilling
Schedule Notes:

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	24	10/17/2023	10/17/2025
NSTM (A)			
Underwater (B)	24	9/19/2024	9/19/2026
Special (C)			
Other Routine			
Complex Other			
Damage			
Load Rating			

LOAD RATING AND POSTING

(070) Posting %: 5 - Equal/Abv Legal Load
(031) Design Load [B.LR.01]: 2 M 13.5 (H 15)

(411) Date Evaluated [B.LR.03]: 01/01/2021
(418A) Deck/Culvert Condition: 6
(418B) Superstructure Condition:
(418C) Substructure Condition:

(063) Opr Method [B.LR.04]: 6 LFR
(064) Opr Rating [B.LR.06]: 1.36 rf
(065) Inv Method [B.LR.04]: 6 LFR
(066) Inv Rating [B.LR.05]: 0.81 rf

(465) Alternative Inventory Rate Method: 8 LRFR (HL93)
(466) Alternative Inventory Rating Factor: 0.53 rf
(463) Alternative Operating Rate Method: 8 LRFR
(464) Alternative Operating Rating Factor: 0.69 rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values
(443) Legal (non-EV) Single 2-3 Axles (tons):
(444) Legal (non-EV) Single 4+ Axles (tons):
(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values
(446) EV Single Axle (tons):
(447) EV Tandem Axle (tons):
(448) EV Gross (tons):

40T Combination Posting
(889) 40T Combination Sign Posted: 0 - No, Not Posted

ROADWAY AND CLEARANCES

Location	
(05B) Kind of Hwy: 3 State Hwy	Route Posted Speed: -1
(011) Milepost [B.H.07]: 22.970 mi (36.967 km)	(102) Direction of Traffic [B.RT.03]: 2 2-way traffic
(019) Detour Length [B.H.17]: 0 mi (0 km)	SCDOT Route Type: 4
	Evac Route: 0

Clearances

(28A) Lanes On Structure:	2	(622) Railroad Service Type [B.RR.01]:	
(28B) Lanes Under Structure:	0	(574) Railroad Min. Vert. Clearance:	
(053) Min. Vertical Clearance Over Bridge [B.H.13]:	99.99	(575) Railroad Min. Horiz. Offset:	
(054A) Under Vertical Clearance Ref. [B.H.13]:	N Feature not hwy or RR	(038) Navigable Waterway [B.N.01]:	Permit Not Required
(055A) Under Horizontal Clearance Ref. [B.H.15&14]:	N Feature not hwy or RR	(039) Navigation Min Vertical Clearance [B.N.02]:	0.00
(54B) Minimum Vertical Underclearance [B.H.13]:	99.90	(116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]:	0.00
(055B) Minimum Lateral Underclearance R [B.H.15]:	99.90	(040) Navigation Channel Width [B.N.04]:	0.00
(056) Minimum Lateral Underclearance L [B.H.14]:	99.90	(631) Nav. Channel Min. Horiz. Clearance [B.N.05]:	0.00
(010) Wide Load Clearance Vertical:	99.90	(111) Substructure Nav. Protection [B.N.06]:	
(047) Wide Load Clearance Horizontal [B.H.16]:	26.00		



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.N. 01&02]:	07 Rural Mjr Collector	(109) Pct Trucks [B.H.10]:	7%
(104) NHS:	0 Not on NHS	(030) ADT Year [B.H.11]:	2023
(100) Defense Hwy:	0 Not a STRAHNET hwy	(114) Future ADT:	3,212
(029) ADT [B.H.09]:	2,200 Cars/Day	(115) Year Of Future ADT:	2043



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]:	1 Highway	(506) Signs/Utilities attached:	N - Nothing Attached
(42B) Type Of Service Under [B.F.02]:	5 Waterway	(630) Fatigue Details [B.IR.02]:	No E/E' details
(027) Year Built [B.W.01]:	1926	(507) Damaged Deck:	N - No Damage
(106) Year Reconstructed [B.W.02]:	1937	(508) Damaged Superstructure:	N - No Damage
(319) Paint Date:		(509) Damaged Substructure:	N - No Damage
(037) History [B.CL.04]:	5 Not eligible for NRHP	(510) Damaged Culvert:	N - No Damage
(112) NBIS Structure Length:	Y Long Enough		
Status of Consultant Repair Recommendations:	Returned Signed	(502) Bent or Barrel Direction:	3 - East to West
		(503) Date of Inventory Photos:	10/17/2023
		(504) Asset ID Placard Location:	Other End Bent (SW Crnr)
		(505) Stream Flow Direction:	1 - North to South

CURB REVEAL MEASUREMENTS

No Curb:	Yes	Hidden Curb:	No
Curb Reveal Beginning Left (in):		Curb Reveal Beginning Right (in):	
Curb Reveal End Left (in):		Curb Reveal End Right (in):	

CULVERT FILL INVENTORY

Not a Culvert (N/A):	No	Max Fill (ft):	2.5
Culvert Inlet (ft):	1.5	Culvert Outlet (ft):	1.5
Edge of Roadway on Inlet Side of Road (ft):	2.3	Edge of Roadway on Outlet Side of Road (ft):	2.5

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
241/3	Re Conc Culvert	126	0%	0	53%	67	47%	59	0%	0
1080/3	Delamination/Spall/Patched Area	3	0%	0	0%	0	100%	3	0%	0
1090/3	Exposed Rebar	2	0%	0	0%	0	100%	2	0%	0
1130/3	Cracking (RC and Other)	52	0%	0	0%	0	100%	52	0%	0
1190/3	Abrasion(PSC/RC)	67	0%	0	100%	67	0%	0	0%	0
6000/3	Scour	2	0%	0	0%	0	100%	2	0%	0



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
241/3	Re Conc Culvert	126	ft	0	67	59	0
[3] Barrel (10ft wide x 8ft high) Reinforced Concrete Culvert (42ft long) 10/17/2023 Routine Inspection findings: North headwall, at West end, spall (10in long x 6in wide x 1in deep). [1080, CS3, Q1] North headwall, at East end, spall (9in long x 7in high x 7in wide x 1in deep). [1080, CS3, Q0] South headwall, at West end, spall (2ft long x up to 7in wide x 0.5in deep). [1080, CS3, Q1] South headwall, at East end, vertical crack (up to 1/4in wide). [1130, CS3, Q0] Barrel 1 top slab at outlet, spall (9in long x 3in high x 2in deep). [1080, CS3, Q1] Barrel 3 top slab at construction joint, (2) spalls (1ft long x 1ft wide x 2in deep) with exposed rebar with section loss (40% section loss). [1090, CS3, Q2] 9/19/2024 Underwater inspection findings: Throughout all barrels, from high-water line to top of bottom slab, abrasion (up to 1/16in deep) with exposed secure aggregate. [1190, CS2, Q66] Barrels 1 through 3, at widened sections, throughout all surfaces, map cracking (up to 1/16in wide). [1130, CS3, Q52, Photo 9] Barrels 1 and 2, IW1, scour/undermining (2in high x 2ft wide x 6in deep). [6000, CS3, Q2, Photo 17]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	3	ft	0	0	3	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1090/3	Exposed Rebar	2	ft	0	0	2	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/3	Cracking (RC and Other)	52	ft	0	0	52	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/3	Abrasion(PSC/RC)	67	ft	0	67	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
6000/3	Scour	2	ft	0	0	2	0



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

Traffic Signs

[4] Delineators in place, [1] located at each approach corner.

Encroachments

N/A

Waterway and Channel

Waterway Details

- Streamflow is well-aligned with culvert opening.
- Overall max. depth is (5.4ft) at inlet, IW1.
- High-water line is (1ft) above current waterline.

Debris/Obstructions

- No significant debris observed.

Streambed Material

- Consists primarily of sand, silt, and organics.
- Max. probe depth measurement (8in).

Channel Protection

- No channel protection devices observed. [Photos 10 through 13]

Embankment Deterioration

- Near/Northeast embankment, erosion/scour hole at wingwall tip (3ft diameter x up to 2ft deep).

Scour

- Barrel 1, (up to 2.4ft) of scour since 2006 Routine Inspection.
- Barrel 3, (up to 2.4ft) of scour since 2020 Routine Inspection.
- IW1, scour/undermining (2in high x 2ft wide x 6in deep) [Photo 17].

Approach Roadway Condition

No significant deficiencies noted at time of inspection.

Fender System

N/A

Median and Other Barriers

36A: N- Metal Thrie Beam with Metal Posts; Not attached to headwall
36B: N- Metal Thrie Beam with Metal Posts on transitions
36C: 1- Metal "W" beam with metal posts on approaches
36D: 1- ET Plus end terminals

Under Bridge Railings/Barriers

N/A

Curbs and Sidewalks

N/A

Drainage System

N/A

Diaphragms

N/A

Wingwalls

Map cracking up to 1/16in wide extends from barrel up to 2ft into wingwalls.

(623) Summary of Previously Performed Maintenance Work [B.W.03]



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

Team Leader: Stephen Rowley

Inspection Date: 09/19/2024

(7) Facility Carried: SC 341

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

INSPECTION PHOTOS



Photo 1:
Inlet / North Elevation



Photo 2:
Outlet / South Elevation



Photo 3:
View Upstream from Top of Culvert



Photo 4:
View Downstream from Top of Culvert

Team Leader: Stephen Rowley

Inspection Date: 09/19/2024

(7) Facility Carried: SC 341

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850



Photo 5:
Asset ID, Southwest Corner



Photo 6:
Typical Culvert Ceiling, Barrel 1



Photo 7:
Typical Concrete Condition at Waterline
(IW1 Inlet shown)



Photo 8:
Typical Concrete Condition below Waterline
(IW1 Inlet shown)

Team Leader: Stephen Rowley

Inspection Date: 09/19/2024

(7) Facility Carried: SC 341

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850



Photo 9:
IW1 typical cracking condition at outlet.



Photo 10:
Near / Southeast Embankment



Photo 11:
Near / Northeast Embankment



Photo 12:
Far / Northwest Embankment

Team Leader: Stephen Rowley

Inspection Date: 09/19/2024

(7) Facility Carried: SC 341

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850



Photo 13:
Far / Southwest Embankment



Photo 14:
Looking through Barrel 1 from Outlet



Photo 15:
Looking through Barrel 2 from Outlet



Photo 16:
Looking through Barrel 3 from Outlet

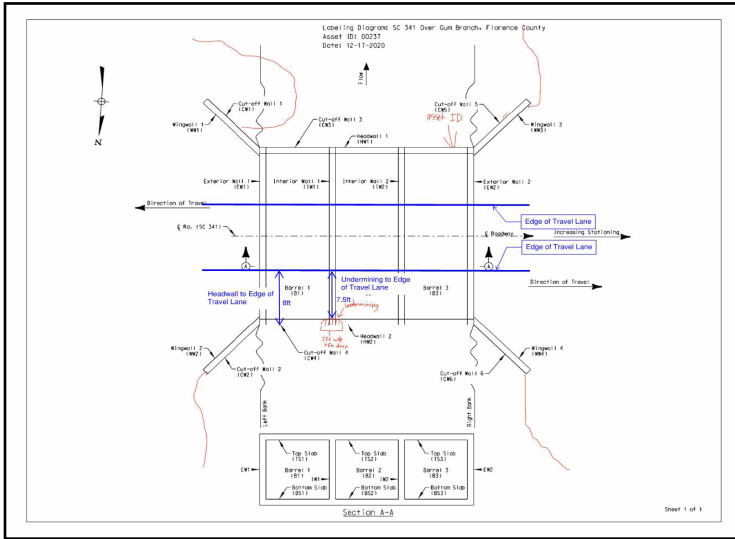


Photo 17:

Extent of Undermining at Inlet of Culvert



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

Inspection Date: 09/19/2024

(7) Facility Carried: SC 341

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

STREAMBED CROSS SECTIONS

Orientation:	Right View	Snding Date:	09/2024
Offset Remark:	Inlet WW Tip	Location of BM:	Top of Headwall
Elev Basis:	Plans	Offset:	33.70
Water Surface:	41.40		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
0 + 92.7	39.2	_____	Near WW Tip
1 + 0.0	37.8	_____	EW1
1 + 5.0	37.8	_____	B1
1 + 10.0	36.7	_____	IW1
1 + 15.0	36.5	_____	B2
1 + 20.0	37.8	_____	IW2
1 + 25.0	37.7	_____	B3
1 + 30.0	40.2	_____	EW2

STREAMBED CROSS SECTIONS

Orientation:	Right View	Snding Date:	09/2024
Offset Remark:	Inlet	Location of BM:	Top of Headwall
Elev Basis:	Plans	Offset:	21.00
Water Surface:	41.40		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
1 + 0.0	37.1	_____	EW1
1 + 5.0	37.0	_____	B1
1 + 10.0	36.0	_____	IW1
1 + 15.0	36.4	_____	B2
1 + 20.0	36.9	_____	IW2
1 + 25.0	37.7	_____	B3
1 + 30.0	37.4	_____	EW2

STREAMBED CROSS SECTIONS

Orientation:	Left View	Snding Date:	09/2024
Offset Remark:	Outlet	Location of BM:	Top of Headwall
Elev Basis:	Plans	Offset:	21.00
Water Surface:	41.40		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
1 + 0.0	38.1	_____	EW1
1 + 5.0	38.1	_____	B1
1 + 10.0	37.7	_____	IW1
1 + 15.0	37.6	_____	B2
1 + 20.0	37.5	_____	IW2
1 + 25.0	38.0	_____	B3



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

1 + 30.0

37.8

EW2



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

SCOUR AND WATERWAY

Request Scour Evaluation:	No	Request Waterway Adequacy:	No
<u>Request Scour Evaluation Reason:</u>		<u>Request Waterway Adequacy Evaluation Reason:</u>	
Inspection Information		Streambed Information	
(511) Bridge Over Tidal Waterway:	No	(519) Water Level:	1 - Within Banks
(512) Tide Status During Inspection:		(520) Debris Buildup:	No
(513) Time During Tidal Inspection:		(521) Bed Deposits Downstream:	No
(517) Max Water Depth at Bent (ft)	5.4	(522) Up/Dwnstrm Ch. Stab.:	Channel Stable
(518) Dry Channel:	No	(523) Riprap (if any) Displaced:	N/A (No Riprap)
		(524) Structure on a Channel Change:	No
		(525) Stream Aggradation or Degradation:	Degradation Observed
		(526) Lateral Movement of Stream:	No Movement
		(527) Lakes, dams near the bridge?	Lake Upstream
Evidence of Scour		Underwater Bridge Inspection Only	
(528) Scour Holes at End Bents:	No	(534) SSU's Inspected:	Barrels 1 through 3.
(529) Scour Holes at Bents:	No		
(530) Scour Holes at Culvert Inlet:	Yes	(535) ADCI Dive Supervisor:	Ray Cortright
(531) Scour Holes at Culvert Outlet:	No	(536) ADCI Tender/Diver(s):	Nicholas Schilling; Stuart Pitre
(532) Footing Exposed:	No		
(533) Bank Soil Material Washing Out:	No		
Scour Condition, POA and Vulnerability			
(442A) Scour Plan of Action Followed:	No	(537) Water Temperature:	70
(442B) POA Category 1:		(538) Visibility:	1
(442C) POA Category 2:		(539) Flow Velocity:	.0
(450) Scour Risk Bin:	9		
(451) Monitoring / Scour Risk Bin:			

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:	(312) Responsible District:	5
(98A) Border Bridge FHWA Region:	(311) Responsible County:	21
(98A) Border Bridge State:	(439) Asset Management:	0
(101) Parallel Structure:	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:	(SBI) Topside Inspection Category:	CC2
(422) Date of Temporary Structure:	(SBI) Underwater Inspection Category:	
(SBI) Island Mobility Bridge:		No

JOINT

Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter

Notes:



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

BEARINGS

Bent #	Bearing #	Bearing Type	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)

Notes:

PILES

Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness

Notes:



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

PROCEDURES FOR THIS INSPECTION

<u>Done</u>	<u>Insp Type</u>	<u>Procedure Type</u>	<u>Procedure Name</u>	<u>Details</u>
R	Underwater	Underwater (Typical)	Pre-Inspection: Review Items	Review the status of NBI Items 62, 61, 113 and any Scour POA's, previous inspection reports and scour analyses for special conditions to consider during inspection.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Plan	A dive plan for each inspection mobilization shall be uploaded to Bridge File prior to inspection efforts. The dive plan should consider any notable hazards and site conditions that are listed in the risk factor and hazard documentation located in BrM Consultant Inspection Task. from the previous underwater inspection, if applicable. The dive plan shall include ADCI certification for at least three dive team members, including the BITL. The dive plan is unique for each mobilization. The dive plan shall be uploaded to the Bridge File according to the BFP. If the dive plan was updated, or changed during the mobilization, a new revised plan should also be uploaded to the Bridge File.
R	Underwater	Underwater (Typical)	Inspection: Level I and II Inspections, Photograph	Perform a Level I visual and tactile inspection of 100% of the exterior surface of each submerged element and a Level II inspection (cleaning) on at least 10% of the underwater portion of the structure at selected areas or at areas with suspected deficiencies. Document significant areas of distress using appropriate methods of underwater photography. Perform a detailed channel survey in compliance with BIGD Sections 5.3.4.1.2.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Team	Dive team shall be comprised of, at minimum, three people meeting the requirements of SCDOT BIGD 3.1.1.4 and 3.1.3.4 as well as all applicable ADCI or OSHA standards.



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

R	Underwater	Underwater (Typical)	Pre-Inspection: Risk Factors and Hazards	Identify/review any of the following unique site hazards/conditions that require mitigation and consideration during the underwater inspection: Examples include, but are not limited to, Poor Visibility/Turbidity, Heavy Debris/Obstructed Channel, Hydraulic Features (Dam, Weir, etc.), High Current/Water Velocity (>2fps), Construction Activity, Contaminated Water, Delta P scenarios, Confined Spaces, Hazardous Wildlife, Recreational Boat Traffic, Commercial Traffic, Weather Considerations, and Water Depths. Risk Factor and hazard documentation shall be located in the BrM Complex, UW and NSTM page
R	Underwater	Underwater (Custom)	Underwater Custom Other	If bottom slab is exposed, the amount of vertical exposure and/or undermining shall be documented. Vertical exposure and height of undermining should be measured from top of bottom slab to channel bottom. If undermined, depth of penetration should be measured from culvert opening to firm material.
<u>Inspector Procedure Notes</u>				

EQUIPMENT USED IN THIS INSPECTION

<u>Name</u>	<u>Hours</u>	<u>Cost</u>
A08 SCUBA	0.00	0
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

00237

Team Leader: Stephen Rowley

(7) Facility Carried: SC 341

Inspection Date: 09/19/2024

(6) Crossing: GUM BRANCH

Inspection Type(s): Underwater (Unscheduled)

(16) Latitude: 33.831383 (17) Longitude: -79.626850

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY Stephen Rowley

Date 9/19/2024

QC Reviewed By: Tyler Patterson QC Completed: 10/31/2024

QA Reviewed By: Will Gwaltney QA Completed: 12/1/2024