



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

IDENTIFICATION

Asset ID:	02753	(009) Location [B.L.11]:	2.0 MI SE OF CONWAY
(468) Structure Number:	2620050105200	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(26) Horry
(42A) Type of Service On [B.F.01]:	1 Highway	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	WACCAMAW RIVER	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	5 Waterway	(011) Mile Post [B.H.07]:	20.636 mi (33.210 km)
(021) Custodian:	01 SCDOT	(106) Year Recon [B.W.02]:	0
(027) Year Built [B.W.01]:	1958	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL

(058) Deck Structure Condition [B.C.01]:	4 Poor	(602) Bridge Railing Condition [B.C.05]	5 Fair
(059) Superstructure Condition [B.C.02]:	4 Poor	(603) Bridge Railing Trans. Condition [B.C.06]:	6 Satisfactory
(060) Substructure Condition [B.C.03]:	4 Poor	(604) Bridge Bearing Condition [B.C.07]	5 Fair
(062) Culvert Retaining Condition [B.C.04]:	N N/A (NBI)	(605) Bridge Joint Condition [B.C.08]:	3 Serious
(600) UW Substructure Condition [B.C.15]:	4 Poor	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	7 Minor Damage	(071) Waterway Adequacy [B.AP.02]:	8 Equal Desirable
(601) Channel Protection Condition [B.C.10]:	7 Good, Some Min Def	(113) Scour Condition:	5 - Scour Within Limits
(633) NSTM Condition:	N N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	4 - Moderate to Major


GEOMETRY

(034) Skew [B.G.11]:	0	(032) Approach Roadway [B.G.09]:	52.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	52.0
(049) Structure Length [B.G.02]:	1,110.0	(052) Deck Width Out-To-Out [B.G.05]:	62.2
(634) NBIS Bridge Length [B.G.01]	1,105.00	(441) Deck Area [B.G.16]:	69,042.00
(619) Curved Bridge [B.G.12]:	N - Not Curved	(033) Bridge Medians [B.G.10]:	3 Closed Med w/Barriers
(620) Maximum Height Bridge [B.G.13]:	39	(50A) Curb Sidewalk Width/Left [B.G.07]:	2.5
(621) Side Hill Bridge [B.G.14]:	No	(50B) Curb Sidewalk Width/Right [B.G.08]:	2.5
		(606) Minimum Span Length [B.G.04]:	50.0

DECK

Deck Material and Type

(501) Deck Overburden Depth (in):	0.0
(107) Deck Type:	1 - Conc Cast-in-Place
(108A) Wearing Surface:	1 Monolithic Concrete
(108B) Membrane:	0 - None
(108C) Deck Protection:	0 None

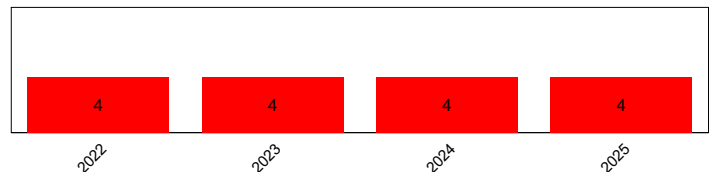

DECK CONDITION

Roadside Hardware

(36A) Bridge Rail:	0 Substandard
(36B) Transition:	1 Meets Standards
(36C) Approach Rail:	1 Meets Standards
(36D) Approach Rail Ends:	N N/A or not required



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

SUPERSTRUCTURE

Main Span Material and Type

(045) # of Main Spans: 3
(048) Max Span Length [B.G.03]: 80.0
(43A) Main Material: 4 Steel Continuous
(43B) Main Design: 02 Stringer/Girder
(607) Main Number Of Beam Lines [B.SP.03]: 10
(607A) Main Number Of Precast Panels*: 0.00
(608) Main Span Continuity [B.SP.05]: 2 - Continuous
(609) Main Protection System [B.SP.07]: C01 - Coat Paint
(610) Main Deck Interaction [B.SP.08]: NC - Non-composite
(611) Main Deck Reinforcement Protect [B.SP.12]: 0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]: 0 - None


* = Main/Appr Number of Precast Panels only reports on precast slab bridges

Approach Span Material and Type

(046) # of Approach Spans: 18
(308) Appr Max Span Length: 50.0
(44A) Approach Span Material: 1 Concrete
(44B) Approach Span Design: 04 Tee Beam
(613) Appr Number Of Beam Lines [B.SP.03]: 10
(607B) Appr Number Of Precast Panels*: 0.00
(614) Appr Span Continuity [B.SP.05]: 1 - Simple / Single Span
(615) Appr Protection System [B.SP.07]: 0 - Unprotected Span
(616) Appr Deck Interaction [B.SP.08]: IM - Integral/Monolithic
(617) Appr Deck Reinforcement Protect [B.SP.12]: 0 - No Protection
(618) Appr Deck Stay-In-Place Forms [B.SP.13]: 0 - None

SUPERSTRUCTURE CONDITION


(059) Superstructure Rating [B.C.02]: 4 Poor

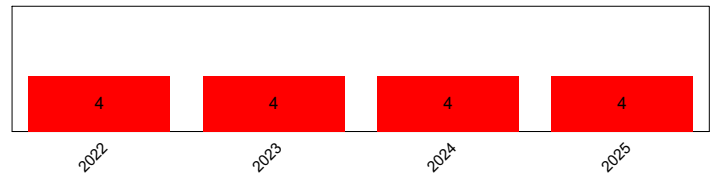

SUPERSTRUCTURE CONDITION

SUBSTRUCTURE

(060) Substructure Rating: 4 Poor

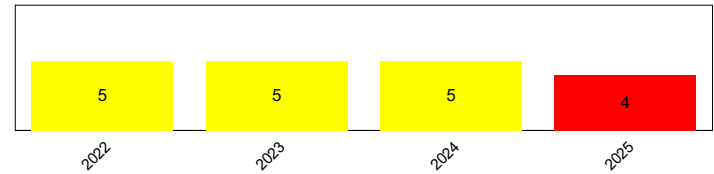

SUBSTRUCTURE CONDITION

PARKING LOCATION

Parking Latitude (if one provided): 33.816612

Parking Longitude (if one provided): -79.041440

Parking Notes (if provided):

Billy Witherspoon Boat Landing at Southeast corner of the bridge.



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

INSPECTION

(090) Date of Inspection: 2/21/2025
(091) Frequency: 12
Water over 4' but UW Inspection Not Needed (No Request): 0
Temperature During Inspection (°F): 34
Weather During Inspection: 1 - Sunny
Team Members: Adrian Marchand, Nicholas Schilling,
Schedule Notes: Stephen Rowley (Tender Only)

Underwater Inspection Interval reduced to 24 months due to B.C.15 coding of 4. Future underwater inspection date adjusted to align with routine inspection schedule.

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	12	11/11/2024	11/11/2025
NSTM (A)			
Underwater (B)	24	2/21/2025	8/21/2026
Special (C)		2/1/2023	
Other Routine			
Complex Other			
Damage			
Load Rating	3		5/21/2025

LOAD RATING AND POSTING

(070) Posting %: 5 - Equal/Abv Legal Load
(031) Design Load [B.LR.01]: 5 MS 18 (HS 20)

(411) Date Evaluated [B.LR.03]: 06/22/2023
(418A) Deck/Culvert Condition: 4
(418B) Superstructure Condition: 4
(418C) Substructure Condition: 5

(063) Opr Method [B.LR.04]: 6 LFR
(064) Opr Rating [B.LR.06]: 1.10 rf
(065) Inv Method [B.LR.04]: 6 LFR
(066) Inv Rating [B.LR.05]: 0.66 rf
(465) Alternative Inventory Rate Method: 8 LRFR (HL93)
(466) Alternative Inventory Rating Factor: 0.04 rf
(463) Alternative Operating Rate Method: 8 LRFR
(464) Alternative Operating Rating Factor: 0.05 rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values

(443) Legal (non-EV) Single 2-3 Axles (tons):
(444) Legal (non-EV) Single 4+ Axles (tons):
(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values

(446) EV Single Axle (tons):
(447) EV Tandem Axle (tons):
(448) EV Gross (tons):

40T Combination Posting

(889) 40T Combination Sign Posted: Not Posted

ROADWAY AND CLEARANCES

		Location	
(05B) Kind of Hwy:	U.S. Numbered Hwy	Route Posted Speed:	-1
(011) Milepost [B.H.07]:	20.636 mi (33.210 km)	(102) Direction of Traffic [B.RT.03]:	2 2-way traffic
(019) Detour Length [B.H.17]:	0 mi (0 km)	SCDOT Route Type:	2
		Evac Route:	1

Clearances

(28A) Lanes On Structure:	4	(622) Railroad Service Type [B.RR.01]:	
(28B) Lanes Under Structure:	0	(574) Railroad Min. Vert. Clearance:	
(053) Min. Vertical Clearance Over Bridge [B.H.13]:	99.99	(575) Railroad Min. Horiz. Offset:	
(054A) Under Vertical Clearance Ref. [B.H.13]:	N Feature not hwy or RR	(038) Navigable Waterway [B.N.01]:	Permit Not Required
(055A) Under Horizontal Clearance Ref. [B.H.15&14]:	N Feature not hwy or RR	(039) Navigation Min Vertical Clearance [B.N.02]:	0.00
(54B) Minimum Vertical Underclearance [B.H.13]:	0.00	(116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]:	
(055B) Minimum Lateral Underclearance R [B.H.15]:	0.00	(040) Navigation Channel Width [B.N.04]:	0.00
(056) Minimum Lateral Underclearance L [B.H.14]:	0.00	(631) Nav. Channel Min. Horiz. Clearance [B.N.05]:	0.00
(010) Wide Load Clearance Vertical:	99.99		



Bridge Inspection Report

02753

Team Leader: William Cochran
Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP
(6) Crossing: WACCAMAW RIVER
Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

(047) Wide Load Clearance Horizontal [B.H.16]: 26.00 (111) Substructure Nav. Protection [B.N.06]:

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.N. 01&02]:	14 Urban Other Princ	(109) Pct Trucks [B.H.10]:	5%
(104) NHS:	1 On the NHS	(030) ADT Year [B.H.11]:	2024
(100) Defense Hwy:	0 Not a STRAHNET hwy	(114) Future ADT:	65,125
(029) ADT [B.H.09]:	52,100 Cars/Day	(115) Year Of Future ADT:	2044



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]: 1 Highway
(42B) Type Of Service Under [B.F.02]: 5 Waterway
(027) Year Built [B.W.01]: 1958
(106) Year Reconstructed [B.W.02]: 0
(319) Paint Date: 1958-03-01
(037) History [B.CL.04]: 5 Not eligible for NRHP
(112) NBIS Structure Length: Y Long Enough

Status of Consultant Repair Recommendations:
Submitted but Unsigned

(506) Signs/Utilities attached: U - Utilities Attached
(630) Fatigue Details [B.IR.02]: N/A - No D/E/E' details
(507) Damaged Deck: N - No Damage
(508) Damaged Superstructure: N - No Damage
(509) Damaged Substructure: N - No Damage
(510) Damaged Culvert: N - No Damage

(502) Bent or Barrel Direction: 1 - West to East
(503) Date of Inventory Photos: 11/14/2023
(504) Asset ID Placard Location: Bent 1 (SW Corner)
(505) Stream Flow Direction: 5 - Tidal

CURB REVEAL MEASUREMENTS

Curb Type: Mountable Curb

* = A curb should be considered 12" high or less.
A barrier/railing/parapet is not considered a curb.

Curb Reveal Beginning Left (in): 9.75
Curb Reveal End Left (in): 9.75

Curb Reveal Beginning Right (in): 9.75
Curb Reveal End Right (in): 9.75

CULVERT FILL INVENTORY

Not a Culvert (N/A): Yes
Culvert Inlet (ft):
Edge of Roadway on Inlet Side of Road (ft):

Max Fill (ft):
Culvert Outlet (ft):
Edge of Roadway on Outlet Side of Road (ft):



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
12/3	Re Concrete Deck	13,062	0%	0	73%	9,496	27%	3,560	0%	6
1080/3	Delamination/Spall/Patched Area	471	0%	0	67%	316	33%	155	0%	0
1090/3	Exposed Rebar	28	0%	0	0%	0	79%	22	21%	6
1120/3	Efflorescence/Rust Staining	653	0%	0	0%	0	100%	653	0%	0
1130/3	Cracking (RC and Other)	2,730	0%	0	0%	0	100%	2,730	0%	0
1190/3	Abrasion(PSC/RC)	9,179	0%	0	100%	9,179	0%	0	0%	0
16/4	Re Conc Top Flange	55,980	25%	13,916	75%	42,061	0%	3	0%	0
1080/4	Delamination/Spall/Patched Area	60	0%	0	95%	57	5%	3	0%	0
1090/4	Exposed Rebar	73	0%	0	100%	73	0%	0	0%	0
1130/4	Cracking (RC and Other)	19,539	0%	0	100%	19,539	0%	0	0%	0
1190/4	Abrasion(PSC/RC)	22,392	0%	0	100%	22,392	0%	0	0%	0
107/4	Steel Opn Girder/Beam	2,100	0%	10	80%	1,677	6%	122	14%	291
515/4	Steel Protective Coating	18,347	0%	0	0%	0	84%	15,447	16%	2,900
3440/4	Eff (Stl Protect Coat)	18,347	0%	0	0%	0	84%	15,447	16%	2,900
1000/4	Corrosion	2,089	0%	0	80%	1,677	6%	121	14%	291
1020/4	Connection	1	0%	0	0%	0	100%	1	0%	0
110/4	Re Conc Opn Girder/Beam	9,000	100%	8,986	0%	0	0%	14	0%	0
1080/4	Delamination/Spall/Patched Area	14	0%	0	0%	0	100%	14	0%	0
205/4	Re Conc Column	60	72%	43	20%	12	8%	5	0%	0
1080/4	Delamination/Spall/Patched Area	4	0%	0	25%	1	75%	3	0%	0
1090/4	Exposed Rebar	2	0%	0	50%	1	50%	1	0%	0
1190/4	Abrasion(PSC/RC)	10	0%	0	90%	9	10%	1	0%	0
215/4	Re Conc Abutment	124	98%	122	2%	2	0%	0	0%	0
1080/4	Delamination/Spall/Patched Area	2	0%	0	100%	2	0%	0	0%	0
220/4	Re Conc Pile Cap/Ftg	500	86%	430	10%	52	4%	18	0%	0
1190/4	Abrasion(PSC/RC)	52	0%	0	96%	50	4%	2	0%	0
6000/4	Scour	16	0%	0	0%	0	100%	16	0%	0
228/4	Timber Pile	54	0%	0	0%	0	0%	0	100%	54
234/4	Re Conc Pier Cap	1,240	99%	1,223	1%	9	1%	8	0%	0
1080/4	Delamination/Spall/Patched Area	8	0%	0	0%	0	100%	8	0%	0
1090/4	Exposed Rebar	1	0%	0	100%	1	0%	0	0%	0
1130/4	Cracking (RC and Other)	8	0%	0	100%	8	0%	0	0%	0
301/3	Pourable Joint Seal	1,120	51%	569	9%	103	26%	286	14%	162
2320/3	Seal Adhesion	441	0%	0	16%	70	49%	214	36%	157
2330/3	Seal Damage	124	100%	124	0%	0	0%	0	0%	0
2340/3	Seal Cracking	18	0%	0	0%	0	100%	18	0%	0
2360/3	Adjacent Deck or Header	92	0%	0	36%	33	59%	54	5%	5
302/3	Compressn Joint Seal	118	20%	24	10%	12	17%	20	53%	62
2330/3	Seal Damage	62	0%	0	0%	0	0%	0	100%	62
2340/3	Seal Cracking	20	0%	0	0%	0	100%	20	0%	0
2350/3	Debris Impaction	12	0%	0	100%	12	0%	0	0%	0
311/2	Moveable Bearing	30	0%	0	0%	0	100%	30	0%	0
515/2	Steel Protective Coating	60	0%	0	0%	0	0%	0	100%	60
3440/2	Eff (Stl Protect Coat)	60	0%	0	0%	0	0%	0	100%	60
1000/2	Corrosion	29	0%	0	0%	0	100%	29	0%	0
1020/2	Connection	1	0%	0	0%	0	100%	1	0%	0
313/2	Fixed Bearing	10	0%	0	0%	0	100%	10	0%	0
515/2	Steel Protective Coating	20	0%	0	0%	0	0%	0	100%	20
3440/2	Eff (Stl Protect Coat)	20	0%	0	0%	0	0%	0	100%	20
1000/2	Corrosion	10	0%	0	0%	0	100%	10	0%	0
331/2	Re Conc Bridge Railing	3,330	93%	3,087	6%	209	1%	32	0%	2
1080/2	Delamination/Spall/Patched Area	238	0%	0	88%	209	11%	27	1%	2



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
1130/2	Cracking (RC and Other)	5	0%	0	0%	0	100%	5	0%	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
12/3	Re Concrete Deck	13,062	ft ²	0	9,496	3,560	6
Spans 10-12: (3) Main Spans at 65ft, 80ft, 65ft for a total of 210ft; Reinforced Concrete Cast-in-Place Deck (62ft-2in W x 6-1/2in thick); Top of Deck: Throughout spans 10 -12, all lanes, abrasion (up to 1/16in deep) with secure aggregate. [1190, CS2, Q9179] Spans 10-12, throughout all lanes, transverse cracking (full width x up to 1/8in wide) at average 4ft centers. [1130, CS3, Q2730] Spans 10-12, throughout all lanes, spalls and adjacent delaminated areas (up to 3ft wide x 1ft long x 2in deep) with exposed rusted rebar (no section loss), partially patched by asphalt. [1080, CS2, Q200 & CS3, Q40] Underside of Deck: Spans 10, 11, and 12, along edge of BM top flanges, scattered spalls (up to 4in W x 1in D). [1080, CS3, Q105] Spans 10, 11, and 12, in all bays, shattered transverse cracks (FW) with efflorescence buildup. [1120, CS3, Q653] Span 10, at BT 10 in all bays, patched area (2ft L x FW) for joint header replacement. [1080, CS2, Q116] Span 10, Bay 1, 20ft from Bent 10, spall (3ft wide x 6in long x 1.5in deep) with exposed rebar (25% loss). [1090, CS3, Q3] Span 10, Bay 2, 20ft from Bent 10, (2) spalls (up to 3ft wide x 6in long x 1.5in deep) with exposed rebar (25% loss). [1090, CS3, Q6] Span 10, Bay 6, next to BM 10-7 at 5ft from BT 10, spall (20in L x 6in W x 2in D) with exposed rebar (25% loss). [1090, CS3, Q2] Span 10, Bay 9, 25ft from Bent 10, spall (3ft wide x 6in long x 1.5in deep) with exposed rebar(25% loss. [1090, CS3, Q3] Span 11, Bay 1, 7ft from BT12 at deck drain, spall (3ft diameter x 1.5in deep) with exposedrebar (10% loss). [1090, CS3, Q3] Span 11, Bay 7, above 1st diaphragm, spall (3ft wide x 6in long x 3in deep) with exposed rebar (up to 100% loss). [1090, CS4, Q3] Span 11, Bay 7, above 3rd diaphragm, spall (3ft wide x 6in long x 3in deep) with exposed rebar (up to 100% loss). [1090, CS4, Q3] Span 12, Bay 1, along BM12-1 spall (4in wide x 10ft long x 1in deep). [1080, CS3, Q10] Span 12, Bay 1, near BT13, spall (10in diameter x 1.5in deep) with exposed rebar (25% loss). [1090, CS3, Q1] Span 12, Bay 2, 15ft from BT13, spall (2ft W x 6in L x 1.5in deep) with exposed rebar (25% loss). [1090, CS3, Q2] Span 12, Bay 8, at 2nd diaphragm, spall (2ft W x 6in L x 1.5in deep) with exposed rebar (25% loss). [1090, CS3, Q2]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	471	ft ²	0	316	155	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1090/3	Exposed Rebar	28	ft ²	0	0	22	6
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	653	ft ²	0	0	653	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/3	Cracking (RC and Other)	2,730	ft ²	0	0	2,730	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/3	Abrasion(PSC/RC)	9,179	ft ²	0	9,179	0	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
16/4	Re Conc Top Flange	55,980	ft ²	13,916	42,061	3	0
Spans 1-9 and 13-21: (18) Approach Spans each at 50ft for a total of 900ft; Reinforced Concrete Top Flange (62ft-2in W x 6-1/2in thick); Top side of RC Top Flange Deck: All shoulders and sidewalks, debris accumulation (full length x full width). Throughout all spans, scattered areas of abrasion with minor loose aggregate (approximately 40% of surface area). [1190, CS2, Q22392] Spans 1-9 and 13-21, scattered areas of longitudinal / diagonal / map-cracks (approximately 35% of surface area x up to 0.020W). [1130, CS2, Q19539] Span 16, southbound lanes near median over Bent 17, spall (up to 13-1/2in L x 11-1/2in W x 1-1/2in deep). [1080, CS3, Q1] Underside of RC Top Flange Deck: Throughout Spans 1, 2, 4, 5 and 7, (20) spalls randomly located (up to 6in L x 4in W x 1in deep). [1080, CS2 Q20] Throughout all spans, in Bay 5 scattered spalls (up to 6in diameter x 3in deep) with exposed anchor from retrofitted median rail. Average (4) per span. [1090, CS2, Q72] Span 1, Bay 5 at End Bent 1, spall (5in diameter x 1in deep) with exposed rusted rebar. [1090, CS2, Q1] Span 1, Bays 5 and 6 at 18ft from BT 2, (2) patched areas (up to 3ft L x 2ft W) with adjacent efflorescence.[1080, CS2, Q12] Span 2, Bay 5 at BT 2, patched area (5ft L x FW) with adjacent efflorescence.[1080, CS2, Q25] Span 13, Bay 9 over BT 13, spall (up to 12in long x 12in wide x 1in deep). [1080, CS3, Q1] Span 21 in Bay 5, 1ft from End Bent 22, spall (up to 6in long x 4in wide x 2in deep). [1080, CS3, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	60	ft ²	0	57	3	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1090/4	Exposed Rebar	73	ft ²	0	73	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/4	Cracking (RC and Other)	19,539	ft ²	0	19,539	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/4	Abrasion(PSC/RC)	22,392	ft ²	0	22,392	0	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
107/4	Steel Opn Girder/Beam	2,100	ft	10	1,677	122	291
Spans 10-12: (10) Continuous Steel beams that transition from (W36x150) to (W36x170) at Splices. All defects are section loss at the following locations: Span 10: At BT 10: BM 10-1, South face, bottom flange (4ft L x FW x 0.60in average remaining), base of web (3ft L x 6in H x up to 100%) with (2) corrosion holes (1in diameter). [CS4, Q3] BM 10-5, North face, lower web (3ft L x 3in H x 1/16in loss). [CS3, Q3] BM 10-7, bottom flange (4ft L x FW x 1/16in loss), web (4ft L x 4in H x up to 1/16in loss). [CS3, Q4] BM 10-8, bottom flange (3ft L x FW x 1/16in loss), web (2ft L x 6in H x up to 1/16in loss). [CS3, Q3] BM 10-10, bottom flange (5ft L x FW x 0.70in remaining), web (5ft L x 6in H x up to 1/8in loss). [CS4, Q5] At midspan: BM 10-3, bottom flange (4ft L x FW x 0.69in remaining), web (4ft L x 8in H x 1/8in loss). [CS3, Q4] BM 10-4, bottom flange (5ft L x FW x 0.53in remaining), web (5ft L x 4in H x 1/8in loss). [CS4, Q5] BM 10-5, bottom flange (5ft L x FW x 0.80in remaining), web (5ft L x 3in H x 1/16in loss). [CS3, Q5] BM 10-7, bottom flange (5ft L x FW x 0.73in remaining), web (5ft L x 3in H x 1/8in loss). [CS3, Q5] BM 10-8, bottom flange (5ft L x FW x 0.75in remaining), web (5ft L x 3in H x 1/8in loss). [CS3, Q5] BM 10-9, bottom flange (4ft L x FW x 0.69in remaining), web (4ft L x 3in H x 1/8in loss). [CS3, Q5] BM 10-10, bottom flange (6ft L x FW x 0.26in remaining), web (6ft L x 3in H x 1/8in loss). [CS4, Q5] At splice: BM 10-1, bottom flange (10ft L x 5in W x 0.51in remaining), web (8ft L x 6in H x 1/4in loss). [CS4, Q10] BM 10-2, bottom flange (10in L x FW x 0.70in remaining), web (2ft L x 6in H x up to 1/8in loss). Lower splice plate nuts (80% loss). [CS4, Q2] BM 10-4, bottom flange (30in L x 5in W x 0.55in remaining), web (2ft L x 5in H x 3/16in loss). [CS4, Q3] BM 10-5, bottom flange (3ft L x FW x 0.49in remaining), web (3ft L x 5in H x 1/8in remaining) with corrosion hole (14in L x 2in H). [CS4, Q3] BM 10-6, bottom flange (3ft L x FW x 1/4in remaining) web (12ft L x 8in H x 1/8in remaining) with corrosion hole (4ft L x 3in H). [CS4, Q12] BM 10-7, bottom flange (1ft L x FW x 0.46in remaining) web (2ft L x 8in H x 1/8in loss), North side (3) splice bolts (50-90% loss). [CS4, Q2] BM 10-8, bottom flange (1ft L x FW x 0.47in remaining) web (2ft L x 7in H x 1/8in loss). [CS4, Q2] BM 10-9, bottom flange (1ft L x FW x 0.62in remaining) web (2ft L x 8in H x 1/16in loss), North side (2) splice bolts (30-70% loss). [CS4, Q3] BM 10-10, bottom flange (2ft L x FW x 0.44in remaining) web (2ft L x 8in H x 1/16in loss), North side (2) splice bolts (20-60% loss). [CS4, Q2] At BT11 BM 10-2, at 3ft from BT 11, bottom flange (10ft L x FW x 1/16in loss), web (10ft L x 8in H x 1/16in loss). [CS3, Q10] BM 10-3 at 3ft from BT 11, bottom flange (10ft L x FW x 1/8in loss), web (10ft L x 8in H x 3/16in loss). [CS4, Q10] BM 10-4, at 3ft from BT 11, bottom flange (10ft L x FW x 1/8in loss) web (10ft L x 8in H x 3/16in loss). [CS4, Q10] BM 10-5, bottom flange (6ft L x FW x 0.71in remaining), web (5ft L x 8in H x 1/4in deep); above bearing (10in L x FH x 1/8in loss), bottom of stiffener (6in H x 1/8in loss). [CS4, Q6] BM 10-6, bottom flange (5ft L x FW x 1/16in loss), web (5ft L x 8in H x 1/16in loss). [CS3, Q5] BM 10-7, at 3ft from BT 11, bottom flange (6ft L x FW x 1/16in loss), web (6ft L x 8in H x 1/16in loss). [CS3, Q6] BM 10-8, at 3ft from BT 11, bottom flange (5ft L x FW x 1/8in loss), web (5ft L x 10in H x 1/16in loss). [CS4, Q5] BM 10-9, at 3ft from BT 11, bottom flange (3ft L x FW x 1/16in loss), web (2ft L x 4in H x 1/16in loss). [CS3, Q3] BM 10-10, North face, bottom flange (8ft L x 5in W x 0.77in remaining), web (10ft L x 1ft H x 1/4in loss). [CS4, Q10]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
515/4	Steel Protective Coating	18,347	ft ²	0	0	15,447	2,900
Steel Protective Coatings Present in all Steel Beams. Throughout all beams, protective coating substantially ineffective with areas of coating failure, typically below deck joints at splice points and beam ends.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
3440/4	Eff (Stl Protect Coat)	18,347	ft ²	0	0	15,447	2,900



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1000/4	Corrosion	2,089	ft	0	1,677	121	291
Corrosion defects continued: Span 11 At BT11: BM 11-1, bottom flange (4ft L x FW x 0.65in remaining), web (4ft L x 4in H x 1/16in loss). [CS3, Q4] BM 11-5, bottom flange (3ft L x FW x 1/16in loss). [CS3, Q3] BM 11-10, bottom flange (4ft L x FW x 1/16in loss), web (4ft L x up to 2ft-6in H x 1/16in loss). [CS3, Q4] Near Splice 1: BM 11-3, West of Splice 1, South face, bottom flange, (3in L x 3in W x 0.76in average remaining), web (5ft L x 8in H x 1/16in loss). [CS3, Q5] BM 11-4, West of Splice 1, South face, bottom flange (3ft-6in L x 5in W with 0.66in average remaining), web, (5ft L x 5in H with up to 3/16in loss). [CS4, Q5] BM 11-6, East of Splice 1, bottom flange (2ft L x FW x 0.65in average remaining), web (30in L x 3in H x up to 1/8in loss). [CS4, Q2] BM 11-7, West of Splice 1, bottom flange (1ft L x 0.65in remaining) lower web (2ft L x 8in H x 1/4in loss) and hole (1in diameter). Lower splice plate nuts, section loss to 16 of 32 (75% loss). [CS4, Q2] BM 11-8, West of Splice 1, both sides of splice plate, lower web (2ft L x 8in H x 1/4in loss). Lower splice plate nuts, section loss to 8 of 16 (75% loss). [CS4, Q2] BM 11-9, West of Splice 1, bottom flange (9in L x 3in W with 0.78in average remaining), web (2ft L x 4in H x up to 3/16in loss) and hole (1/2in diameter). [CS4, Q2] BM 11-10, West of Splice 1, bottom flange (16in L x 5in W x 0.29in average remaining), web (4ft L x 6in H x 1/8in remaining) and (2) corrosion holes (7in L x 1.5in H and 8in L x 3in H). [CS4, Q4] Between Splices: BM 11-7, 25ft from BT11, bottom flange (5ft-6in L x FW x 0.50in average remaining), web (3ft L x 7in H x up to 3/16in loss). [CS4, Q6] BM 11-8, 30ft from BT 11, North face, bottom flange (up to 6ft L x 5in W x 0.60in average remaining), web (6ft L x 4in H x up to 1/8in loss). [CS4, Q6] BM 11-10, 22ft from BT 11, bottom flange (5ft L x 5in W x 0.10in average remaining and edge loss for 2ft L x 1.5in W), web (10ft L x 6in H x up to 1/4in loss) and (3) holes (up to 1in diameter). [CS4, Q10] BM 11-1, 25ft from BT 12, South face, bottom flange (10ft L x 6in W x 0.80 average remaining), web (3ft L x 8in H x 1/4in loss). [CS4, Q10] BM 11-2, 25ft from BT 12, South face, bottom flange (3.5ft L x 5in W x 0.77in remaining), web (3.5ft L x 7in H x 3/16in loss). [CS4, Q4] BM 11-10, 22ft from BT 12, bottom flange (3ft L x FW x 0.37in remaining), web (6ft L x 6in H x up to 1/4in loss). [CS4, Q6] At Splice 2: BM 11-3, bottom flange, (12in L x FW x 0.68in average remaining), web (18in L x 5in H x up to 1/16in loss). Lower splice bolts, 6 of 16 (50% loss). [CS4, Q2] BM 11-4, North face, web (4ft L x 4in H x 1/16in loss). [CS3, Q4] BM 11-6, at West of Splice 2, bottom flange (12in L x FW x 0.56in average remaining), lower web (4ft L x 3in H x 3/16in loss). [CS4, Q4] BM 11-7, South face, bottom flange (9in L x 3in W x 0.54in remaining) web (4ft L x 7in H x 3/16in loss) with hole (3in W x 4in H). Lower splice plate nuts, 12 of 16 (50% loss). [CS4, Q4] BM 11-8, bottom flange (9in L x 3in W x 0.75in remaining), web (2ft L x 5in H x 3/16in loss). Lower splice plate nuts, 12 of 16 (50% loss). [CS4, Q2] BM 11-9, bottom flange (18in L x FW x 0.67in remaining), web (3ft L x 8in H x 1/8in loss). [CS4, Q3] BM 11-10, bottom flange (6in L x FW x 0.80in remaining), web (5ft L x 8in H x 1/8in loss). [CS4, Q10] At BT 12: BM 11-1 bottom flange (3ft L x 6in W x 0.97 remaining), web (4ft long x 4in high x 1/16in loss). [CS3, Q4] BM 11-5, bottom flange (2ft L x FW x 0.98in remaining), web (4ft L x 3in H x 1/16in loss). [CS3, Q4] BM 11-6, bottom flange (3ft L x FW x 0.94in remaining), web (5ft L x 3in H x 1/16in loss). [CS3, Q5] BM 11-10, bottom flange (4ft L x FW x 0.55in remaining), web (5ft L x 7in H x 1/8in loss). [CS4, Q5]							



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1020/4	Connection	1	ft	0	0	1	0
Corrosion defects continued: Span 12 At BT12: BM 12-1 bottom flange (10ft L x 6in W x 0.61 remaining), web (10ft long x 8in high x 1/4in loss). [CS4, Q10] BM 12-2, 2ft from BT12, bottom flange (6ft L x FW x 1/16in loss) web (6ft long x 8in high x 1/8in loss). [CS4, Q6] BM 12-3, 2ft from BT12, bottom flange (6ft L x FW x 1/16in loss) web (6ft long x 8in high x 1/8in loss). [CS4, Q6] BM 12-4, 2ft from BT12, bottom flange corrosion (6ft L x FW x up to 1/16in loss). [CS3, Q6] BM 12-5, North face, bottom flange (1ft L x FW x 1/8in loss), lower web (3ft L x 5in H x 3/16in loss). [CS4, Q3] BM 12-6, bottom flange (3ft L x FW x 1/8in loss). [CS4, Q3] BM 12-7, bottom flange (7ft L x FW x 0.83in remaining), web (6ft L x 5in H x 1/16in loss). [CS3, Q7] BM 12-8, 2ft from BT 12, bottom flange (8ft L x FW x 0.84in remaining), web (8ft L x 6in H x 1/16in loss). [CS3, Q8] BM 12-9, 2ft from BT 12, bottom flange (4ft L x FW x 0.92in remaining), web (5ft L x 8in H x 1/16in loss). [CS3, Q5] BM 12-10, bottom flange (5ft L x 5in W x 0.81in remaining), web (8ft L x 3in H x 5/16in loss). [CS4, Q8] At Splice BM 12-1, bottom flange (30in L x 5in W x 0.17in remaining), web (4ft L x 6in H x 1/4in loss). [CS4, Q4] BM 12-2, bottom flange (5ft L x FW x 0.83in remaining), web (3ft L x 8in H x 1/4in loss). [CS4, Q3] BM 12-3, bottom flange (2ft L x FW x 0.22in at edge with 0.47in average remaining), web (30in L x 7in H x 1/4in loss) with several holes (up to 1in diameter). [CS4, Q3] BM 12-4, East of Splice, bottom flange (2ft L x FW x 0.51in remaining), web (30in L x 8in H x 1/8in remaining) with corrosion hole (12in L x 3in H). [CS4, Q3] BM 12-5, bottom flange (3ft L x FW x 0.58in remaining), web (8ft L x 6in H x 1/8in remaining) with holes (7in L x 2in H). [CS4, Q8] BM 12-6, bottom flange (up to 10ft L x FW x 0.56in remaining), web (8ft L x 6in H x down to knife edge) with hole (4in L x 1in H). [CS4, Q10] BM 12-7, bottom flange (2ft L x 5in W x 0.54in remaining), web (30in L x 6in H x 1/4in loss), Lower splice plate, 5 of 16 nuts (50% loss). [CS4, Q3] BM 12-8, bottom flange (18in L x FW with 0.62in remaining), web (3ft L x 4in H x 1/4in loss) and hole (9in L x 2in H). [CS4, Q3] BM 12-9, bottom flange (1ft L x FW x 0.52in remaining), web (30in L x 6in H x 3/16in loss) and (2) holes (3/4in diameter). [CS4, Q3] BM 12-10, North face, bottom flange (1ft L x 5in W x 0.53in remaining), web (30in L x 6in H x 1/4in loss). [CS4, Q3] At midspan: BM 12-3, at 25ft from BT 12, bottom flange, (6ft L x FW x 0.35in remaining), web (6ft L x 9in H x 1/4in loss). [CS4, Q6] BM 12-7, bottom flange (7ft L x 5in W x 0.48in remaining), web (6ft L x 7in H x 5/16in loss). [CS4, Q7] BM 12-9, 25ft from BT 12, bottom flange (7ft L x FW x 0.40in at edge and 0.70in average remaining), web (5ft L x 5in H x 3/8in loss).[CS4, Q7] BM 12-10, 25ft from BT 12, bottom flange (4ft L x FW x 0.80in remaining), web (5ft L x 5in H x 1/8in loss). [CS4, Q5] At BT13: BM 12-1, bottom flange (2ft L x FW x 0.59in remaining), web (3ft L x 4in H x 1/16in loss).[CS3, Q3] BM 12-10, bottom flange (5ft L x FW x 1/16in loss), web (2ft L x 9in H x 1/16in loss).[CS3, Q5]							



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
110/4	Re Conc Opn Girder/Beam	9,000	ft	8,986	0	14	0

Spans 1-9 and 13-21: (10) Reinforced Concrete Tee Beams (up to 2ft-11in high x 1ft-5in wide)

BM 1-7, at BT 2 North face, vertical crack with spall/delamination (5in L x FH). [1080, CS3, Q1]

BM 3-9 at BT3, North face, vertical crack with spall/delamination (5in L x FH). [1080, CS3, Q1]

BM 3-3, at BT 4, North face, spall/delamination (1ft long x 1ft high x 2in deep). [1080, CS3, Q1]

BM 9-6, at BT 9, South face, at bottom corner, spall/delamination (2ft L x 18in H x 3in D). [1080, CS3, Q2]

BM 9-8 at BT 10, North and South face at East end corners, (2) spalls (up to 12in L x 12in H x up to 5in deep) with exposed rebar. [1080, CS3, Q1]

Span 13, all beams at BT13, beam end overhangs West edge of cap step (3in).

BM 13-3 at BT 13, North face, spall (12in L x 12in H x 1in D). [1080, CS3, Q1]

BM 13-2, at BT 14, on North and South face, beam end spall over bearing (up to full height x 10in W x up to 5in deep) with exposed rebar. [1080, CS3, Q1]

BM 13-3, at BT 14, North face, Beam end spall over bearing (up to full height x 10in W x up to 5in deep) with exposed rebar. [1080, CS3, Q1]

BM 13-4, at BT 14, North face, Beam end spall over bearing (up to full height x 10in W x up to 5in deep) with exposed rebar. [1080, CS3, Q1]

BM 14-3, at BT 15, North face, Beam end spall over bearing (up to 4in H x 6in L x up to 5in deep). [1080, CS3, Q1]

BM 14-4, at BT 15, North face, Beam end spall over bearing (up to 1ft H x 8in L x up to 1in deep) with exposed rebar. [1080, CS3, Q1]

BM 15-8, at BT 16, South face, Beam end spall (1ft L x 1ft H x 4in deep). [1080, CS3, Q1]

BM 16-3, at BT 17, North face, spall (18in L x 18in H x 1in deep) with exposed rusted rebar. [1080, CS3, Q1]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	14	ft	0	0	14	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
205/4	Re Conc Column	60	each	43	12	5	0

Bents 2 through 9 and 14 through 21: (3) Reinforced Concrete Columns (up to 4ft 7-1/2in long x 2ft 9in wide) per bent with reinforced concrete struts between the footings. [Q48]

Bents 10 through 13: (3) Reinforced Concrete Columns (up to 5ft 7in long x 2ft 9in wide) per bent with reinforced concrete struts between the columns. [Q12]

11/11/2024 Routine Inspection Findings:

Column 9-2, East face at footing, spall (3ft diameter x 1in deep). [1080, CS3, Q1]

[UW] Column 12-2, south face near southeast corner above strut, spall, (6in H x 1ft W x up to 1in deep) with exposed rebar up to 10% section loss [1090, CS3, Q1]

Column 13-3, North face near bottom strut, spall (9in x 5in x 1-1/4in) with exposed rusted rebar. [1080, CS3, Q1]

Column 14-2, East face near the ground line, spall (2ft diameter x 1/2in deep). [1080, CS3, Q1]

Column 18- 2, North and South face 3ft from the bottom of BT18 cap, (3) spalls (up to 3-1/2in diameter x 1/2in deep) with exposed rebar (no section loss). [1090, CS2, Q1]

Column 20-2, South face 3ft from the bottom of BT20 cap, spall (up to 6in diameter x 1/2in deep). [1080, CS2, Q1]

2/21/2025 Underwater Inspection Findings:

Bents 10 through 13, columns and struts, from high-water line extending down 5ft, abrasion (up to 3/8in deep) with exposed/secure coarse aggregate. [1190, CS2, Q9, Photo 6]

Column 10-1, along construction joint at bottom of strut, area of poor consolidation and abrasion (full circumference x up to 2in high x 2in deep) with loose and missing coarse aggregate.

[1190, CS3, Q1]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	4	each	0	1	3	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1090/4	Exposed Rebar	2	each	0	1	1	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/4	Abrasion(PSC/RC)	10	each	0	9	1	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
215/4	Re Conc Abutment	124	ft	122	2	0	0

(2) Spill Through End Bents with Reinforced Concrete Cap (61ft-9in long x 30in wide x 30in high) each with (20) treated timber piles (12in diameter) concealed by compacted fill slope.

EB 1, below Bay 7, horizontal crack (2ft L x 1/16in) with adjacent delamination (2ft L x 4in H). [1080, CS2, Q2]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	2	ft	0	2	0	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
220/4	Re Conc Pile Cap/Ftg	500	ft	430	52	18	0

Bents 2 through 9 and 14 through 21: Reinforced Concrete Footing (9ft long x 9ft wide x 4ft thick) per column. [Q432]

Bents 10 and 13: Reinforced Concrete Footing (10ft 6in long x up to 15ft wide x 5ft thick) per column; footings buried [Q0]

Bents 11 and 12: Reinforced Concrete Footing (10ft 6in long x 15ft wide x 5ft thick) per exterior column and (12ft long x 15ft wide x 5ft thick) per interior column. [Q68]

11/11/2024 Routine Inspection Findings:

Bents 2-9 and 14-21, all footings exposed (average 2ft H); Exposure needs to be fully measured next inspection.

2/21/2025 Underwater Inspection Findings:

Bents 11 and 12, scour defect applied to foundational piles (Element 228) where footings are undermined.

Bents 11 and 12, throughout footings, abrasion (up to 1/4in deep) with exposed/secure aggregate. [1190, CS2, Q50, Photo 8]

Bents 11 and 12, footings, intermittent throughout top and corners of footing, areas of poor consolidation and voiding (up to 4in deep).

Footing 11-1, scour resulting in undermining (up to 2ft high x full perimeter). [6000, CS4, Q0]

Footing 11-2, northwest and northeast corners, scour resulting in undermining (up to 2.2ft high). [6000, CS4, Q0]

Footing 11-2, southwest and southeast corners, scour resulting in vertical footing exposure (up to 4.4ft high). [6000, CS3, Q2]

Footing 11-3 scour resulting in undermining (up to 2.8ft high x full perimeter). [6000, CS4, Q0]

Footing 11-3, west face, bottom of footing, 5ft north of southwest corner, area of poor consolidation and abrasion (2ft long x 8in high x up to 2in deep). [1190, CS3, Q2]

Footing 12-1, northwest and northeast corners, scour resulting in undermining (up to 1.3ft high). [6000, CS4, Q0]

Footing 12-1, southwest and southeast corners, scour resulting in vertical footing exposure (up to 4.4ft high). [6000, CS3, Q1]

Footing 12-2 scour resulting in vertical footing exposure (up to 4.4ft high x full perimeter). [6000, CS3, Q12]

Footing 12-3, northwest corner, scour resulting in undermining (1.2ft high). [6000, CS4, Q0]

Footing 12-3, south and east faces, scour resulting in vertical footing exposure (up to 4.3ft high). [6000, CS3, Q1]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/4	Abrasion(PSC/RC)	52	ft	0	50	2	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
6000/4	Scour	16	ft	0	0	16	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
228/4	Timber Pile	54	each	0	0	0	54

(54) Untreated Timber Foundational Piles Exposed due to Scour

2/21/2025 Underwater Inspection Findings:

Bents 11 and 12, exterior piles are sound with no significant deterioration observed. [Photo 9]

Footing 11-1, all timber piles exposed due to scour (up to 2ft high). [6000, CS4, Q15]

Footing 11-2, (10) timber piles exposed due to scour (up to 2.2ft high). [6000, CS4, Q10]

Footing 11-3, all timber piles exposed due to scour (up to 2.8ft high). [6000, CS4, Q15]

Footing 12-1, (10) timber piles exposed due to scour (up to 1.3ft high). [6000, CS4, Q10]

Footing 12-3, (4) timber piles exposed due to scour (up to 1.2ft high). [6000, CS4, Q4]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
234/4	Re Conc Pier Cap	1,240	ft	1,223	9	8	0

(20) Interior Bents with Reinforced Concrete Caps (61ft-3in long x 4ft high x 3ft wide)

Throughout the top of all bent caps, moderate sediment buildup.

BT 5, top of cap at Bay 5, heavy debris accumulation at cap.

BT 5, underside below BM 6, spall (6in diameter x 3/4in deep) with exposed rebar. [1090, CS2, Q1].

BT 9, West face, below beam 8-6, spall (32in L x 8in H x 6in deep) with bearing undermined (1in). [1080, CS3, Q3]

BT 13, West face, at BM12-10, spall (6in W x 18in H x 1in deep) with exposed rusted rebar (no section loss). [1080, CS3, Q1]

BT 15, underside, 6ft from the South face, spall (up to 2ft L x 6in W x 1in deep) with exposed rebar (no section loss). [1080, CS3, Q2]

BT 19, underside, 4ft from COL19-1, spall (up to 2ft L x 5in W x 1/2in deep) with exposed rebar (no section loss). [1080, CS3, Q2]

BT 21, underside, between COLs 21-2 and 21-3, (8) flexure cracks (2ft L x HL). [1130, CS2, Q8]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	8	ft	0	0	8	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1090/4	Exposed Rebar	1	ft	0	1	0	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/4	Cracking (RC and Other)	8	ft	0	8	0	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
301/3	Pourable Joint Seal	1,120	ft	569	103	286	162
Joints over EB1 and EB22 are covered by an asphalt overlay. (18) Pourable joint seals (62ft-2in L) over BTs 2-8, 11-12, and 14-21. Spans 10 and 12 have (1) Intermediate pourable seal joint (62ft-2in L) each. Span 11 has (2) Intermediate pourable seal joints (62ft-2in L). Northbound Lanes JT 2, NBL header has scattered spalls (9ft total L x up to 6in W x 1in D) [2360, CS3, Q9] JT 3, NBL header near centerline (2) spalls (6ft total L x up to 6in W x 1in D) [2360, CS3, Q6] JT 4, NBL header near centerline delamination/spall (10ft total L x up to 4in W x 1in D) with exposed rebar. [2360, CS3, Q10] JT 5, NBLs, scattered areas of loss of adhesion (10ft total L) [2320, CS3, Q10] JT 7, NBLs, scattered areas of loss of adhesion (10ft total L) [2320, CS3, Q10] JT 8, NBL header near North shoulder, spall (1ft L x 6in W x 3/4in D) [2360, CS3, Q1] JT 8, NBLs, scattered areas of loss of adhesion (8ft total L) [2320, CS3, Q8] JT 9, NBL seal adhesion failure (26ft L) with areas of the joint that are torn and damaged. Joint opening is up to 3.5in W. [2320, CS4, Q26] JT 10-1, NBL at centerline, header delamination/spall (9ft L x 6in W x 3/4in D) [2360, CS3, Q9] JT 11, NBL at centerline, header spall (2ft L x 6in W x 1-1/2in D) [2360, CS3, Q2] JT 11-1, NBL header near North shoulder, delamination (3ft L x 2in W) [2360, CS2, Q3] JT 12-1, NBL header near centerline, asphalt patch (2ft L x 6in W) [2360, CS3, Q2] JT 14, NBL, scattered areas of loss of adhesion and missing material (26ft total L) [2320, CS4, Q26] JT 15, NBL, scattered areas of loss of adhesion (15ft total L) [2320, CS2, Q10; CS3, Q5] JT 16, NBL, scattered areas of loss of adhesion (26ft L) [2320, CS3, Q26] JT 17, NBL, scattered areas of loss of adhesion (15ft total L) [2320, CS2, Q10; CS3, Q5] JT 18, NBL, scattered areas of loss of adhesion (26ft L) [2320, CS3, Q26] JT 19, NBL, scattered areas of loss of adhesion (15ft total L) [2320, CS2, Q10; CS3, Q5] JT 20, NBL, scattered areas of loss of adhesion (25ft L) [2320, CS2, Q10; CS3, Q15] JT 21, NBL, scattered areas of loss of adhesion (26ft L) [2320, CS3, Q20; CS4, Q6] South Bound Lanes JT 5, SBLs, scattered areas of partial loss of adhesion (26ft total L) [2320, CS2, Q10; CS3, Q10; CS4, Q6] JT 6, SBLs, scattered areas of partial loss of adhesion (26ft total L) [2320, CS2, Q20; CS3, Q6] JT 7, SBLs, scattered areas of loss of adhesion (26ft total L) [2320, CS3, Q20; CS4, Q6] JT 8, SBLs, scattered areas of partial loss of adhesion (10ft total L) [2320, CS3, Q10] JT 9, SBL seal adhesion failure (26ft L) with areas of the joint that are torn and damaged. Joint opening is up to 3.5in W. [2320, CS4, Q26] JT 10-1, SBL header has scattered patched areas (15ft L) with adjacent spalls (5ft total L x up to 6in W x 2in D). [2360, CS2, Q10; CS3, Q5; CS4, Q5] JT 11, SBL header near North shoulder, delamination (3ft L x 2in W). [2360, CS2, Q3] JT 11-1, SBL header near North shoulder, delamination (6ft L x 4in W). [2360, CS2, Q6] JT 11-2, SBL header near both shoulders, delaminations (5ft total L x up to 6in W). [2360, CS2, Q5] JT 12-1, SBL near centerline, header has patched areas (10ft L). [2360, CS2, Q6; CS3, Q4] JT 14, SBLs, scattered areas of loss of adhesion and missing material (26ft total L) [2320, CS4, Q26] JT 15, SBLs, scattered areas of loss of adhesion (15ft total L) [2320, CS2, Q10; CS3, Q5] JT 16, SBLs, scattered areas of loss of adhesion (20ft total L) [2320, CS4, Q20] JT 17, SBLs, scattered areas of partial loss of adhesion (10ft total L) [2320, CS3, Q10] JT 18, SBLs, scattered areas of seal cracking (18ft total L) [2340, CS3, Q18] JT 18, SBLs, on North side scattered spalls (6ft total L x up to 2in W x 1in D). [2360, CS3, Q6] JT 20, SBLs, scattered areas of partial loss of adhesion (18ft total L) [2320, CS3, Q18] JT 21, SBLs, scattered areas of loss of adhesion (10ft total L) [2320, CS4, Q10]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2320/3	Seal Adhesion	441	ft	0	70	214	157



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2330/3	Seal Damage	124	ft	124	0	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2340/3	Seal Cracking	18	ft	0	0	18	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2360/3	Adjacent Deck or Header	92	ft	0	33	54	5

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
302/3	Compressn Joint Seal	118	ft	24	12	20	62
(2) Compression Seal joints (59ft L) over BTs 10 and 13.							
Northbound Lanes							
JT 10, NBL seal cracking (FL). [2340, CS3, Q20]							
JT 10, NBL in left lane wheel paths seal damage (6ft L). [2330, CS4, Q6]							
JT 13, torn and damaged seal (26ft L) with debris accumulation. [2330, CS4, Q26]							
JT 13, NBL header on span 12 side near median, spall (1ft L x 10in W x 1-1/2in D) with exposed rebar.[2360, CS3, Q0]							
JT 13, NBL the armor plate of the joint header on the Span 12 side is higher (up to 1-1/2in) than the armor plate on the Span 13 side.							
South Bound Lanes							
JT 10, SBL seal damage (FL) with debris impaction along the joint. [2330, CS4, Q26]							
JT 10, the armor plate of the joint header on the Span 10 side is higher (up to 1in) than the armor plate on the Span 9 side.							
JT 13, SBLs scattered debris accumulation (12ft L) [2350, CS2, Q12]							
JT 13, SBL in right lane wheel paths, seal damaged (4ft L) [2330, CS4, Q4]							

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2330/3	Seal Damage	62	ft	0	0	0	62
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2340/3	Seal Cracking	20	ft	0	0	20	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2350/3	Debris Impaction	12	ft	0	12	0	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
311/2	Moveable Bearing	30	each	0	0	30	0
(30) Movable steel plate bearings, (10) per Bent at BTs 10, 11 and 13. Spans 10-12, throughout all steel bearings and anchor bolts, pack rust with section loss (up to 1/16in of loss). [1000, CS3, Q26] BRG 10-7, between sole plate and bottom flange, pack rust (up to 1/2in) higher on South side of flange. [1000, CS3, Q1] BRG 10-10, anchor bolt nuts, corrosion (up to 100% of loss). [1020, CS3, Q1] BRG 13-2, BRG 13-2, heavy scaling and pack rust. Beam to cap measurement 4-3/4in. [1000, CS3, Q1] BRG 13-3, BRG 13-2, heavy scaling and pack rust. Beam to cap measurement 5-1/2in. [1000, CS3, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
515/2	Steel Protective Coating	60	ft ²	0	0	0	60
Steel Protective coatings (2sf) per movable bearing. Throughout all bearings, coating has failed. [3440, CS4, Q60]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
3440/2	Eff (Stl Protect Coat)	60	ft ²	0	0	0	60
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1000/2	Corrosion	29	each	0	0	29	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1020/2	Connection	1	each	0	0	1	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
313/2	Fixed Bearing	10	each	0	0	10	0
(10) Fixed steel bearings at BT12. Spans 10-12, throughout all steel bearings and anchor bolts, pack rust with section loss (up to 1/16in of loss). [1000, CS3, Q10]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
515/2	Steel Protective Coating	20	ft ²	0	0	0	20
Steel Protective coating (2sf) per fixed bearing. Throughout all bearings, coating has failed. [3440, CS4, Q20]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
3440/2	Eff (Stl Protect Coat)	20	ft ²	0	0	0	20
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1000/2	Corrosion	10	each	0	0	10	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
331/2	Re Conc Bridge Railing	3,330	ft	3,087	209	32	2
(2) Reinforced Concrete Posts and Rails (30in high x 11-1/2in W) (1) Reinforced Concrete Median (32in high x 2ft wide) NBL Defects Span 2 Left Rail, beginning at post 3, rail patched (10ft L). [1080, CS2, Q10] Span 2 Left Rail, post 2 at bottom, horizontal crack (FW x 1/16in). [1130, CS3, Q1] Span 5 Left Rail, beginning near post 3, rail and post patched (12ft L). [1080, CS2, Q12] Span 5 Left Rail, at BT6, inside face on top edge, spall (6in L x 4in H x 1/2in D). [1080, CS2, Q1] Span 6 Left Rail, post 6 at bottom, horizontal crack (FW x 1/16in) and on outside face, spall (18in L x 6IN h x 2in D). [1080, CS3, Q2] Span 7 Median Rail, NBL side center of 3rd section, vertical crack (FH x 1/16in). [1130, CS3, Q1] Span 8 Left Rail, beginning at post 2, rail and post patched (19ft L). [1080, CS2, Q19] Span 9 Left Rail, beginning at post 2, rail and posts patched (40ft L). [1080, CS2, Q40] Span 10 Median Rail, NBL side at South end of 2nd and North end of 3rd section, (2) spalls (up to 4in L x 18in H x 3in D). [1080, CS3, Q2] Span 11 Left Rail, near post 6, inside face on top edge, spall (14in L x 3in W x 1/2in D). [1080, CS3, Q2] Span 11 Left Rail, at post 10, end face on top edge, spall (3in L x 8in W x 2in D). [1080, CS3, Q1] Span 12 Right Rail, 2ft from BT 13, diagonal crack (2ft L x 1/16in). [1130, CS3, Q2] Span 13 Right Rail, beginning at BT 13, rail and post patched (10ft L). [1080, CS2, Q10] Span 13 Right Rail, at post 2, outside face on top edge, spall (1ft L x 2in W x 3/4in D). [1080, CS3, Q1] Span 13 Right Rail, at post 5, inside face on top edge, spall (18in L x 2in W x 1/2in D). [1080, CS3, Q2] Span 14 Left Rail, beginning near post 2, rail and posts patched (15ft L). [1080, CS2, Q15] Span 14 Median Rail, North face over BT15, vertical crack (32in H x up to 1/4in W). [1130, CS3, Q1] Span 15 Left Rail, beginning near post 2, rail and posts patched (10ft L). [1080, CS2, Q10] Span 16 Left Rail, beginning at post 6, rail and posts patched (20ft L). [1080, CS2, Q20] Span 16 Median Rail, NBL side at North end of 2nd section, spall (4in L x 10in H x 2in D). [1080, CS3, Q1] Span 17 Left Rail, at post 3, inside face on top edge, spall (28in L x 3in H x 3/4in D). [1080, CS3, Q3] Span 17 Left Rail, beginning near post 1, rail and posts patched (17ft L). [1080, CS2, Q17] Span 17 Left Rail, beginning at post 5, rail and posts patched (20ft L). [1080, CS2, Q20] Span 18 Left Rail, beginning at post 1, rail and posts patched (9ft L). [1080, CS2, Q9] Span 18 Median Rail, NBL side at South end of 4th section, spall (4in L x 20in H x 2in D). [1080, CS3, Q1] Span 20 Median Rail, North Face center of 2nd section, vertical crack (FH x 1/16in). [1080, CS3, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/2	Delamination/Spall/Patched Area	238	ft	0	209	27	2
SBL Defects Span 4 Median Rail, SBL side at North end of 3rd section, delamination/spall (6in L x 18in H x 3/4in D). [1080, CS3, Q1] Span 4 Median Rail, NBL side at South end of 1st section, spall (2in L x 8in H x 3/4in D). [1080, CS3, Q1] Span 4 Right Rail, beginning at post 2, rail and post patched (9ft L). [1080, CS2, Q9] Span 4 Right Rail, beginning at post 4, rail patched (2ft L). [1080, CS2, Q2] Span 10 Right Rail, beginning at post 7, rail and post patched (11ft L). [1080, CS2, Q11] Span 10 Median Rail, SBL side at South end of 1st section, spall (6in L x 16in H x 3in D). [1080, CS3, Q1] Span 10 Median Rail, SBL side at South end of 2nd section, spall (3in L x 14in H x 1in D). [1080, CS3, Q1] Span 14 Right Rail, interior top edge 5ft from BT15, (2) spalls (12in L x 2in W x 1/2in deep). [1080, CS3, Q2] Span 16 Median Rail, SBL side at South end of 1st section, spall (6in L x 1ft H x 3in D). [1080, CS3, Q1] Span 16 Median Rail, SBL side at North end of 5th section, spall (1ft L x 8in H x up to 2in D). [1080, CS3, Q1] Span 16 Median Rail, SBL side at North end of last section, delamination/spall (10in L x 18in H x 3/4in D). [1080, CS3, Q1] Span 17 Right Rail, Posts 2 and 3, have been patched. [1080, CS2, Q2] Span 18 Right Rail, between posts 5 and 6 on top inside corner, spall (9in L x 4in W x 1in D). [1080, CS3, Q1] Span 18 Right Rail, over BT18 is misaligned transversely (up to 1in). Span 20 Median Rail, SBL side at South end of 1st section, spall (1ft L x 2ft H x 5in D). [1080, CS4, Q1] Span 21 Right Rail, over EB22, exterior face of end post, spall (6in diameter x 1in deep). [1080, CS2, Q1]							



Bridge Inspection Report

02753

Team Leader: William Cochran
Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP
(6) Crossing: WACCAMAW RIVER
Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/2	Cracking (RC and Other)	5	ft	0	0	5	0



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

Unscheduled inspection due to call from motorist about excessive bump when crossing over bridge. Vertical difference in Deck height measured at Bents 10 and 13. See Joint sketch sheet and multimedia for measurement details.

Along the embankment at EB1, areas of minor erosion throughout.

Northwest corner of Span 1 at the guardrail to bridge rail transition, vegetation growth encroaching over the bridge rail and onto the curb.

Traffic Signs

(3) Delineators in place at the Southwest, Southeast, and Northeast corners of the bridge.

The delineator in the Northwest corner of the bridge was missing during the time of inspection.

Encroachments

(2) PVC utility pipes (2-1/2in diameter) along the North fascia of the bridge.

(1) PVC utility pipe (1in diameter) along the South fascia of the bridge.

Span 4 and 5, South side conduit is detached from BM.

Waterway and Channel

Waterway Details:

- Streamflow angle of attack is approximately 10 degrees on Bents 10 through 13.
- Bridge crosses over bend in river with a bend radius of (approx. 1000ft).
- Overall max. depth is (25.9ft) at upstream side of Bent 11.
- High-water line is (3.0ft) above current waterline.

Debris/Obstructions:

- Upstream side of Footings 11-1, 12-2, and Column 10-1, minor timber debris buildup (up to 8in diameter, approx. 3cy).

Streambed Material

- Consists primarily of sand and silt.
- Max. probe depth measurement (6in).

Channel Protection

- Both embankments have (6in to 1ft diameter) riprap slope protection partially infilled with sand. [Photos 10 and 11]

Embankment Deterioration:

- Both embankments, minor erosion along end bent cap.
- Throughout both floodplains, under bridge, minor local scour (up to 1ft deep). [Photo 14]

Scour

- From Bents 10 through 13, (up to 7.5ft) of scour since construction.
- Bents 11 and 12, (up to 2.3ft) of scour since 2021 Underwater Inspection.
- Streambed cross sections from 2011, 2016, 2021, and 2023 Underwater Inspections added for comparison. [Photos 15 and 16]
- Due to a combination of contraction and local scour, Footings 11-1, 11-2, 11-3, 12-1, and 12-3 are undermined (up to 2.8ft high), exposing (approx. 54) untreated timber foundational piles. [Photo 17]
- No significant change in scour conditions observed since 2023 Underwater Inspection. [Photo 18]
- Bents 11 and 12, height of footing exposure/undermining comparison for all underwater inspections completed since first reported in 2011. [Photos 18 through 21]

Approach Roadway Condition

No significant deficiencies noted at time of inspection.

Fender System

(4) 7-Pile Cluster, Timber Dolphin located upstream and downstream of Bents 11 and 12.

- All dolphin clusters, from top of pile to 1ft below waterline, decay/rot (up to 90% section loss). [Photos 22 and 23]

Median and Other Barriers



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

Reinforced Concrete Median (32in high x 2ft wide)

36A - 0: RC rail and posts with curb and sidewalk.

36B - 1: Thrie-Beam Transitions with Metal Posts.

36C - 1: "W" Beam Railing on Approaches.

36D - N: Terminal Ends greater than 75ft from end of structure.

Northwest corner of Span 1 at the guardrail to bridge rail transition, vegetation growth encroaching over the bridge rail and onto the curb.

SW guardrail transition, posts 9 and 10 from EB1, metal spacer post has impact damage and is rotated at top.

Southeast corner of Span 21 at the guardrail to bridge rail transition, damage (up to 7ft L).

Northeast corner metal guardrail near EB22, minor impact damage (up to 1ft L) with a loose post connection.

Under Bridge Railings/Barriers

Curbs and Sidewalks

(2) Reinforced Concrete curbs (9-3/4in H) each with a (2ft-6in W) sidewalk.

Throughout curbs and sidewalks of all spans, heavy debris accumulation.

Drainage System

along face of both curbs, deck drains (4in diameter) with no downspouts draining into exterior bays.

Throughout deck drains in the shoulder areas of all spans, (up to 75%) of the drains are clogged with debris accumulation.

Diaphragms

Throughout Spans 10-12, (up to 40%) of the diaphragms have heavy corrosion with pitting and (up to 60%) of the diaphragms have section loss (up to 100% loss).

EB 1, backwall, multiple horizontal and vertical cracks (up to full height x hairline).

EB 1, backwall, all bays, diagonal cracks (up to 9in L x 1/32in W) with efflorescence.

EB 1, backwall, Bay 9, (2) spalls (4in diameter x 1/2in deep) with exposed rebar.

Span 10, 2nd Intermediate diaphragm, Bay 5, section loss in web (FL x FH x 100% loss).

BT 11, End diaphragm, Bay 5, (100% loss).

Wingwalls

(4) Reinforced Concrete Wingwalls (1) at each corner.

SE wingwall, top corner near South end, spall (12in L x 3in W x 1in D).

NW wingwall, top corner near North, (2) spalls (up to 8in L x 10in W x 1in D).

(623) Summary of Previously Performed Maintenance Work [B.W.03]

1992 - JT1 - Joints at Bents 10 and 13 were replaced with compression seals.

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

INSPECTION PHOTOS



Photo 1:
Upstream/North Elevation



Photo 2:
Downstream/South Elevation

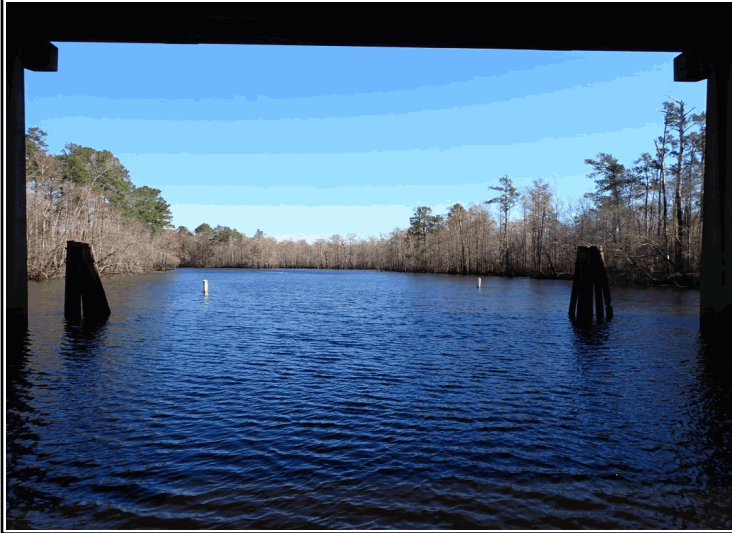


Photo 3:
View Upstream from under Bridge

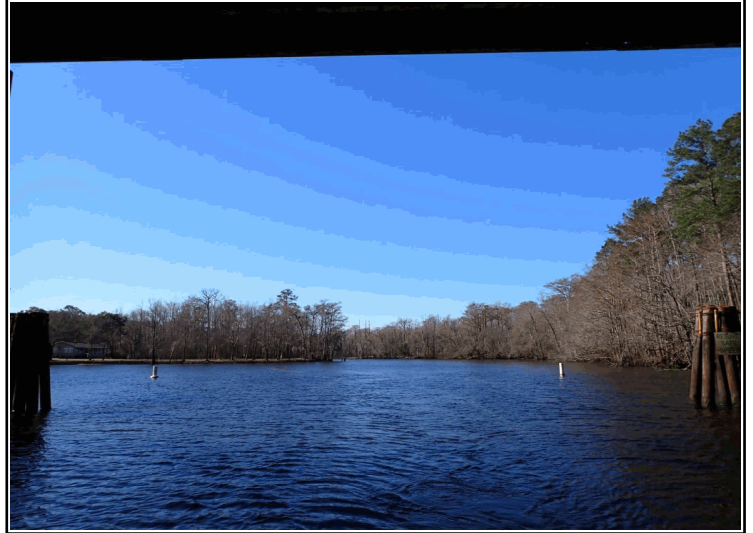


Photo 4:
Looking Downstream from under Bridge

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883



Photo 5:

Typical Pier Protection, SW Dolphin Pile Cluster shown



Photo 6:

Typical Concrete Condition at Waterline
(Bent 14, Column 2 shown)

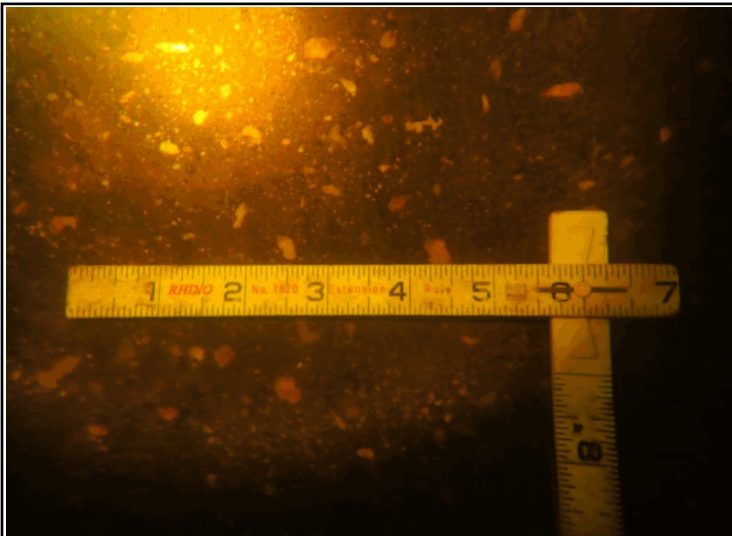


Photo 7:

Typical Concrete Condition below Waterline
(Bent 12, Column 3)

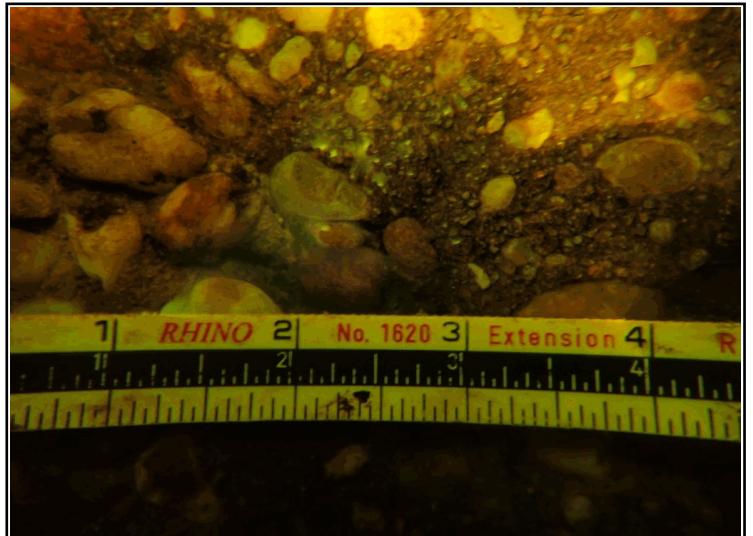


Photo 8:

Typical Concrete Condition below Waterline
(Bent 11, Footing 3)

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

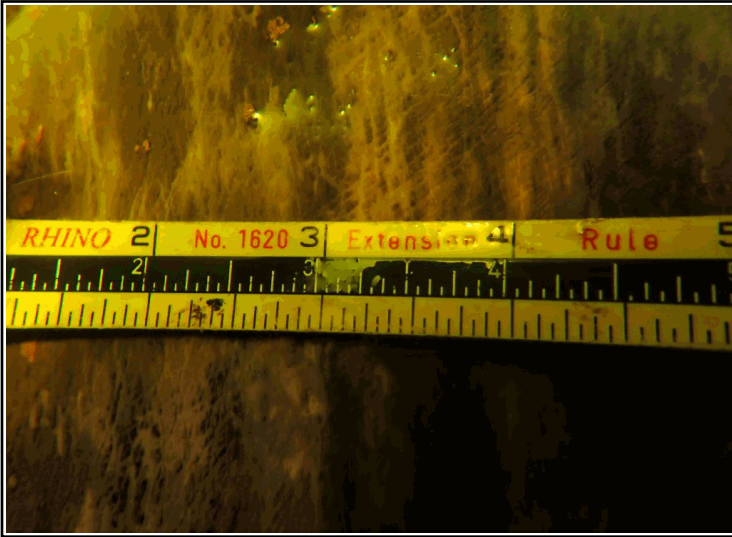


Photo 9:
Typical Timber Condition below Waterline
(Footing 11-3, NW Pile)



Photo 10:
Near/West Embankment



Photo 11:
Far/East Embankment



Photo 12:
West Channel Bank



Photo 13:
East Channel Bank



Photo 14:
West Floodplain, under bridge, minor scour (up to 1ft deep)

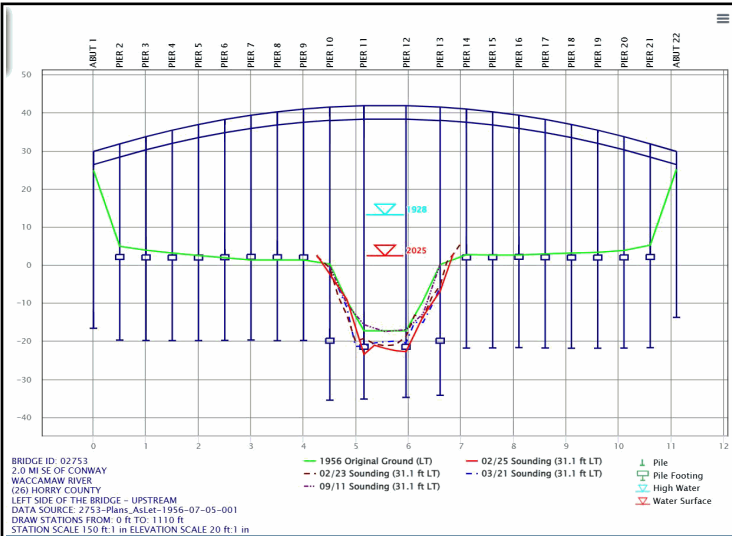


Photo 15:
Upstream Streambed Cross Section, Left View


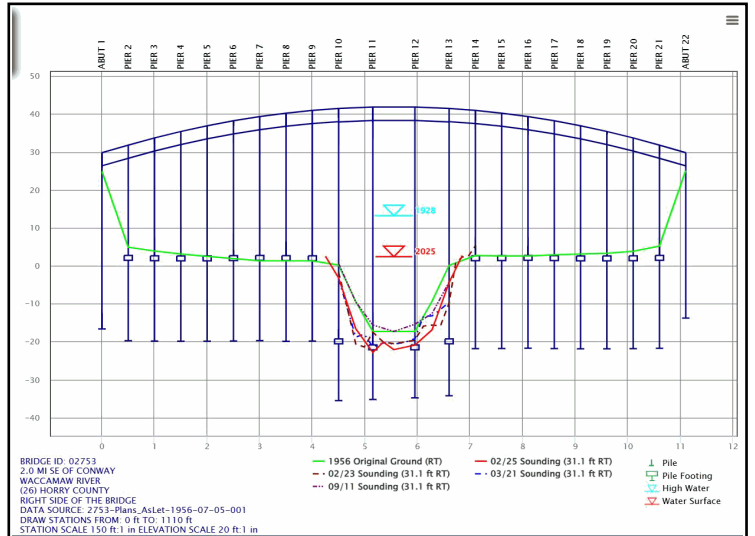


Photo 16:
Downstream Streambed Cross Section, Right View

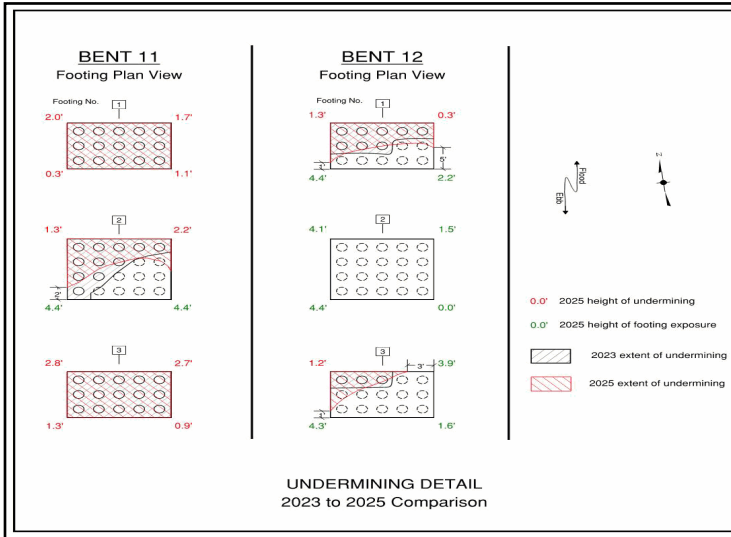

SSU	Northwest Corner (ft)		Northeast Corner (ft)		Southeast Corner (ft)		Southwest Corner (ft)		*No. of Exposed Piles	
	2023	2024	2023	2024	2023	2024	2023	2024	2023	2024
F11-1	3.2 (U)	2.0 (U)	2.2 (U)	1.7 (U)	1.8 (U)	1.1 (U)	2.8 (U)	0.3 (U)	15	15
F11-2	1.7 (U)	1.3 (U)	1.8 (U)	2.2 (U)	4.6 (F)	4.4 (F)	0.2 (U)	4.4 (F)	12	10
F11-3	2.9 (U)	2.8 (U)	2.3 (U)	2.7 (U)	0.9 (U)	0.9 (U)	1.3 (U)	1.3 (U)	15	15
F12-1	1.0 (U)	1.3 (U)	0.3 (U)	0.3 (U)	2.0 (F)	2.2 (F)	5.5 (F)	4.4 (F)	8	10
F12-2	4.4 (F)	4.1 (F)	1.4 (F)	1.5 (F)	0.2 (F)	0.0 (F)	4.5 (F)	4.4 (F)	0	0
F12-3	0.0 (U)	1.2 (U)	3.6 (F)	3.9 (F)	1.0 (F)	1.6 (F)	4.8 (F)	4.3 (F)	3	4

*	Interior piles could not be accessed due to pile spacing. Number of exposed interior piles is estimated based on extent of undermining and pile layout.									
#.# (F)	Partial footing exposure, measured from top of footing to mudline.									
#.# (U)	Complete footing exposure with undermining, measured from the bottom of footing to mudline.									

Photo 17:

Bents 11 and 12, Extent of Undermining
(2025 to 2023 comparison)

Photo 18:

Bents 11 and 12, Height of Footing Exposure/Undermining
(2025 to 2023 comparison)

SSU	Northwest Corner (ft)		Northeast Corner (ft)		Southeast Corner (ft)		Southwest Corner (ft)		*No. of Exposed Piles	
	2021	2024	2021	2024	2021	2024	2021	2024	2021	2024
F11-1	3.5 (U)	2.0 (U)	3.3 (U)	1.7 (U)	2.7 (U)	1.1 (U)	2.0 (U)	0.3 (U)	15	15
F11-2	1.7 (U)	1.3 (U)	2.2 (U)	2.2 (U)	5.0 (F)	4.4 (F)	0.5 (U)	4.4 (F)	12	10
F11-3	3.0 (U)	2.8 (U)	3.3 (U)	2.7 (U)	1.0 (U)	0.9 (U)	1.4 (U)	1.3 (U)	15	15
F12-1	1.3 (U)	1.3 (U)	0.5 (U)	0.3 (U)	2.0 (F)	2.2 (F)	5.5 (F)	4.4 (F)	8	10
F12-2	4.4 (F)	4.1 (F)	1.4 (F)	1.5 (F)	0.1 (F)	0.0 (F)	4.5 (F)	4.4 (F)	0	0
F12-3	1.4 (U)	1.2 (U)	3.6 (F)	3.9 (F)	1.0 (F)	1.6 (F)	4.8 (F)	4.3 (F)	3	4

*	Interior piles could not be accessed due to pile spacing. Number of exposed interior piles is estimated based on extent of undermining and pile layout.									
#.# (F)	Partial footing exposure, measured from top of footing to mudline.									
#.# (S)	Partial seal exposure, measured from top of seal to mudline.									
#.# (U)	Complete footing exposure with undermining, measured from the bottom of footing to mudline.									

Photo 19:

Bents 11 and 12, Height of Footing Exposure/Undermining
(2025 to 2021 comparison)

SSU	Northwest Corner (ft)		Northeast Corner (ft)		Southeast Corner (ft)		Southwest Corner (ft)		*No. of Exposed Piles	
	2016	2024	2016	2024	2016	2024	2016	2024	2016	2024
F11-1	0.5 (F)	2.0 (U)	3.5 (F)	1.7 (U)	1.5 (F)	1.1 (U)	0.0 (F)	0.3 (U)	0	15
F11-2	0.4 (F)	1.3 (U)	3.5 (F)	2.2 (U)	1.5 (F)	4.4 (F)	0.0 (F)	4.4 (F)	0	10
F11-3	1.5 (U)	2.8 (U)	1.5 (U)	2.7 (U)	2.0 (F)	0.9 (U)	0.0 (F)	1.3 (U)	5	15
F12-1	3.0 (F)	1.3 (U)	2.5 (F)	0.3 (U)	0.3 (F)	2.2 (F)	0.0 (F)	4.4 (F)	0	10
F12-2	2.5 (F)	4.1 (F)	0.0 (F)	1.5 (F)	0.0 (F)	0.0 (F)	0.5 (F)	4.4 (F)	0	0
F12-3	2.0 (F)	1.2 (U)	0.0 (F)	3.9 (F)	0.0 (F)	1.6 (F)	0.5 (F)	4.3 (F)	0	4

*	Interior piles could not be accessed due to pile spacing. Number of exposed interior piles is estimated based on extent of undermining and pile layout.									
#.# (F)	Partial footing exposure, measured from top of footing to mudline.									
#.# (U)	Complete footing exposure with undermining, measured from the bottom of footing to mudline.									

Photo 20:

Bents 11 and 12, Height of Footing Exposure/Undermining
(2025 to 2016 comparison)

SSU	Northwest Corner (ft)		Northeast Corner (ft)		Southeast Corner (ft)		Southwest Corner (ft)		*No. of Exposed Piles	
	2011	2024	2011	2024	2011	2024	2011	2024	2011	2024
F11-1	0.3 (F)	2.0 (U)	0.3 (F)	1.7 (U)	0.3 (F)	1.1 (U)	0.0 (F)	0.3 (U)	0	15
F11-2	0.0 (F)	1.3 (U)	0.0 (F)	2.2 (U)	0.3 (F)	4.4 (F)	0.3 (F)	4.4 (F)	0	10
F11-3	0.0 (F)	2.8 (U)	0.1 (F)	2.7 (U)	0.0 (F)	0.9 (U)	0.5 (F)	1.3 (U)	5	15
F12-1	1.0 (F)	1.3 (U)	0.0 (F)	0.3 (U)	0.0 (F)	2.2 (F)	1.0 (F)	4.4 (F)	0	10
F12-2	0.1 (F)	4.1 (F)	0.0 (F)	1.5 (F)	0.0 (F)	0.0 (F)	0.0 (F)	4.4 (F)	0	0
F12-3	0.0 (F)	1.2 (U)	0.0 (F)	3.9 (F)	0.1 (F)	1.6 (F)	0.0 (F)	4.3 (F)	0	4
*	Interior piles could not be accessed due to pile spacing. Number of exposed interior piles is estimated based on extent of undermining and pile layout.									
#.# (F)	Partial footing exposure, measured from top of footing to mudline.									
#.# (U)	Complete footing exposure with undermining, measured from the bottom of footing to mudline.									



Photo 21:

Bents 11 and 12, Height of Footing Exposure/Undermining (2025 to 2011 comparison)

Photo 22:

Typical Dolphin Timber Pile Condition at Waterline (SW cluster shown)



Photo 23:

Typical Dolphin Timber Pile Condition below Waterline (SW Cluster shown)



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

STREAMBED CROSS SECTIONS

Orientation:	Left View	Snding Date:	02/2025
Offset Remark:	Upstream Fascia	Location of BM:	BT10, Top of Strut
Elev Basis:	Plans	Offset:	31.10
Water Surface:	2.40		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
4 + 25.0	2.6	_____	1/2
4 + 50.0	-2.4	_____	BT10
4 + 82.5	-9.1	_____	1/2
5 + 15.0	-23.5	_____	BT11
5 + 35.0	-21.1	_____	1/4
5 + 55.0	-21.9	_____	1/2
5 + 75.0	-22.5	_____	3/4
5 + 95.0	-22.8	_____	BT12
6 + 27.5	-13.5	_____	1/2
6 + 60.0	-6.9	_____	BT13
6 + 85.0	2.9	_____	1/2

STREAMBED CROSS SECTIONS

Orientation:	Right View	Snding Date:	02/2025
Offset Remark:	Downstream Fascia	Location of BM:	BT10, Top of Strut
Elev Basis:	Plans	Offset:	31.10
Water Surface:	2.40		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
4 + 25.0	2.5	_____	1/2
4 + 50.0	-3.2	_____	BT10
4 + 82.5	-16.6	_____	1/2
5 + 15.0	-22.8	_____	BT11
5 + 35.0	-20.1	_____	1/4
5 + 55.0	-22.1	_____	1/2
5 + 75.0	-21.5	_____	3/4
5 + 95.0	-20.9	_____	BT12
6 + 27.5	-16.9	_____	1/2
6 + 60.0	-4.4	_____	BT13
6 + 85.0	2.7	_____	1/2



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

SCOUR AND WATERWAY

Request Scour Evaluation:	No	Request Waterway Adequacy:	No
<u>Request Scour Evaluation Reason:</u>		<u>Request Waterway Adequacy Evaluation Reason:</u>	
Inspection Information		Streambed Information	
(511) Bridge Over Tidal Waterway:	Yes	(519) Water Level:	1 - Within Banks
(512) Tide Status During Inspection:	2 - Falling	(520) Debris Buildup:	Yes
(513) Time During Tidal Inspection:	10:11 am	(521) Bed Deposits Downstream:	No
(517) Max Water Depth at Bent (ft)	25.9	(522) Up/Dwnstrm Ch. Stab.:	Channel Stable
(518) Dry Channel:	No	(523) Riprap (if any) Displaced:	No, Riprap Stable
		(524) Structure on a Channel Change:	Yes
		(525) Stream Aggradation or Degradation:	Degradation Observed
		(526) Lateral Movement of Stream:	No Movement
		(527) Lakes, dams near the bridge?	No Feature
Evidence of Scour		Underwater Bridge Inspection Only	
(528) Scour Holes at End Bents:	No	(534) SSU's Inspected:	Bents 10 through 13
(529) Scour Holes at Bents:	Yes		
(530) Scour Holes at Culvert Inlet:	No	(535) ADCI Dive Supervisor:	Adrian Marchand
(531) Scour Holes at Culvert Outlet:	No	(536) ADCI Tender/Diver(s):	Nicholas Schilling; Stephen Rowley
(532) Footing Exposed:	Yes		
(533) Bank Soil Material Washing Out:	No		
Scour Condition, POA and Vulnerability			
(442A) Scour Plan of Action Followed:	No	(537) Water Temperature:	47
(442B) POA Category 1:	0 - No POA	(538) Visibility:	2
(442C) POA Category 2:		(539) Flow Velocity:	.5
(450) Scour Risk Bin:	2		
(451) Monitoring / Scour Risk Bin:			

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:	(312) Responsible District:	5
(98A) Border Bridge FHWA Region:	(311) Responsible County:	26
(98A) Border Bridge State:	(439) Asset Management:	0
(101) Parallel Structure:	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:	(SBI) Topside Inspection Category:	SB7
(422) Date of Temporary Structure:	(SBI) Underwater Inspection Category:	UA2
(SBI) Island Mobility Bridge:		



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

JOINT				
Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter
10	Compression Seal	.38	.88	.50
Notes: SBL. Measurements shown are vertical differences (in). Span 10 is higher than Span 9.				
13	Compression Seal	.32	1.00	.75
Notes: NBL. Measurements shown are vertical differences (in). Span 12 is higher than Span 13.				

BEARINGS							
Bent #	Bearing #	Bearing Type	Temperature	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)
Notes:							

PILES							
Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness
Notes:							



Bridge Inspection Report

02753

Team Leader: William Cochran

(7) Facility Carried: US 501 BYP

Inspection Date: 02/21/2025

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

PROCEDURES FOR THIS INSPECTION

<u>Done</u>	<u>Insp Type</u>	<u>Procedure Type</u>	<u>Procedure Name</u>	<u>Details</u>
R	Underwater	Underwater (Custom)	Inspection: Footing Exposure	If footings are exposed, the amount of exposure and/or undermining shall be documented. Any exposed seals or footing piles shall be documented.
R	Underwater	Underwater (Typical)	Pre-Inspection: Review Items	Review the status of NBI Items 60, 61, 113 and any Scour POA's, previous inspection reports and scour analyses for special conditions to consider during inspection.
S	Underwater	Underwater (Custom)	Inspection: Level III Deterioration or Other	If significant deterioration is observed on sheet piles and/or steel H-piles, remaining section measurements shall be taken on a minimum of 10% of piles with deterioration. If applicable, other Level III testing or detailed measurements should be noted under the appropriate Element Table entry.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Plan	A dive plan for each inspection mobilization shall be uploaded to Bridge File prior to inspection efforts. The dive plan should consider any notable hazards and site conditions that are listed in the risk factor and hazard documentation located in BrM Consultant Inspection Task. from the previous underwater inspection, if applicable. The dive plan shall include ADCI certification for at least three dive team members, including the BITL. The dive plan is unique for each mobilization. The dive plan shall be uploaded to the Bridge File according to the BFP. If the dive plan was updated, or changed during the mobilization, a new revised plan should also be uploaded to the Bridge File.



Bridge Inspection Report

02753

Team Leader: William Cochran

Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

S	Underwater	Underwater (Custom)	Pre-Inspection: Penetration/Confined Space Dive	Inspections requiring penetration dives shall be planned, and performed following the ADCI consensus standards defined in Section 5.3.6. Additionally, all members of the dive team shall successfully completed OSHA confined space training.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Team	Dive team shall be comprised of, at minimum, three people meeting the requirements of SCDOT BIGD 3.1.1.4 and 3.1.3.4 as well as all applicable ADCI or OSHA standards.
R	Underwater	Underwater (Typical)	Inspection: Level I and II Inspections, Photograph	Perform a Level I visual and tactile inspection of 100% of the exterior surface of each submerged element and a Level II inspection (cleaning) on at least 10% of the underwater portion of the structure at selected areas or at areas with suspected deficiencies. Document significant areas of distress using appropriate methods of underwater photography. Perform a detailed channel survey in compliance with BIGD Sections 5.3.4.1.2.
<u>Inspector Procedure Notes</u> No steel sheet/H-piles observed. Penetration/Confined Space dive not required.				

EQUIPMENT USED IN THIS INSPECTION

<u>Name</u>	<u>Hours</u>	<u>Cost</u>
A06 Motor Boat	0.00	0
A09 Surface supplied air	0.00	0
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

02753

Team Leader: William Cochran
Inspection Date: 02/21/2025

(7) Facility Carried: US 501 BYP
(6) Crossing: WACCAMAW RIVER
Inspection Type(s): Underwater

(16) Latitude: 33.818083 (17) Longitude: -79.043883

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY William Cochran

Date 2/21/2025

QC Reviewed By: Stephen Rowley QC Completed: 3/12/2025

QA Reviewed By: Brian Rhett QA Completed: 4/24/2025