



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

IDENTIFICATION

Asset ID:	09697	(009) Location [B.L.11]:	11.5 MI E OF CONWAY
(468) Structure Number:	2640002241200	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(26) Horry
(42A) Type of Service On [B.F.01]:	1 Highway	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	WACCAMAW RIVER	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	5 Waterway	(011) Mile Post [B.H.07]:	19.343 mi (31.129 km)
(021) Custodian:	01 SCDOT	(106) Year Recon [B.W.02]:	0
(027) Year Built [B.W.01]:	2000	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL

(058) Deck Structure Condition [B.C.01]:	7 Good	(602) Bridge Railing Condition [B.C.05]	7 Good
(059) Superstructure Condition [B.C.02]:	7 Good	(603) Bridge Railing Trans. Condition [B.C.06]:	8 Very Good
(060) Substructure Condition [B.C.03]:	7 Good	(604) Bridge Bearing Condition [B.C.07]	8 Very Good
(062) Culvert Retaining Condition [B.C.04]:	N N/A (NBI)	(605) Bridge Joint Condition [B.C.08]:	7 Good
(600) UW Substructure Condition [B.C.15]:	8 Very Good	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	7 Minor Damage	(071) Waterway Adequacy [B.AP.02]:	8 Equal Desirable
(601) Channel Protection Condition [B.C.10]:	7 Good, Some Min Def	(113) Scour Condition:	3 - Scour Critical
(633) NSTM Condition:	N N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	7 - Minor


GEOMETRY

(034) Skew [B.G.11]:	40	(032) Approach Roadway [B.G.09]:	30.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	38.0
(049) Structure Length [B.G.02]:	1,276.5	(052) Deck Width Out-To-Out [B.G.05]:	40.8
(634) NBIS Bridge Length [B.G.01]	1,266.06	(441) Deck Area [B.G.16]:	52,123.32
(619) Curved Bridge [B.G.12]:	N - Not Curved	(033) Bridge Medians [B.G.10]:	0 No median
(620) Maximum Height Bridge [B.G.13]:	38	(50A) Curb Sidewalk Width/Left [B.G.07]:	0.0
(621) Side Hill Bridge [B.G.14]:	No	(50B) Curb Sidewalk Width/Right [B.G.08]:	0.0
		(606) Minimum Span Length [B.G.04]:	98.1

DECK

Deck Material and Type

(501) Deck Overburden Depth (in):	0.0
(107) Deck Type:	1 - Conc Cast-in-Place
(108A) Wearing Surface:	1 Monolithic Concrete
(108B) Membrane:	0 - None
(108C) Deck Protection:	0 None

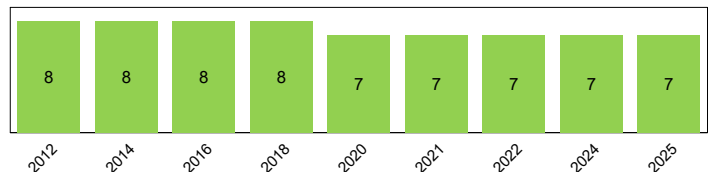

DECK CONDITION

Roadside Hardware

(36A) Bridge Rail:	1 Meets Standards
(36B) Transition:	1 Meets Standards
(36C) Approach Rail:	1 Meets Standards
(36D) Approach Rail Ends:	N N/A or not required



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

SUPERSTRUCTURE

Main Span Material and Type

(045) # of Main Spans: 13
(048) Max Span Length [B.G.03]: 98.8
(43A) Main Material: 6 P/S Conc Continuous
(43B) Main Design: 02 Stringer/Girder
(607) Main Number Of Beam Lines [B.SP.03]: 5
(607A) Main Number Of Precast Panels*: 0
(608) Main Span Continuity [B.SP.05]: 2 - Continuous
(609) Main Protection System [B.SP.07]: Unprotected Span
(610) Main Deck Interaction [B.SP.08]: CS - Composite Shored
(611) Main Deck Reinforcement Protect [B.SP.12]: 0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]: M01 - Metal


* = Main/Appr Number of Precast Panels only reports on precast slab bridges

Approach Span Material and Type

(046) # of Approach Spans: 0
(308) Appr Max Span Length: 0.0
(44A) Approach Span Material: 0 N/A (or Other)
(44B) Approach Span Design: 0 N/A (or Other)
(613) Appr Number Of Beam Lines [B.SP.03]: 0
(607B) Appr Number Of Precast Panels*: 0
(614) Appr Span Continuity [B.SP.05]: N/A (NBI) No Approach Sp
(615) Appr Protection System [B.SP.07]: N/A (NBI) No Approach Sp
(616) Appr Deck Interaction [B.SP.08]: N/A (NBI) No Approach Sp
(617) Appr Deck Reinforcement Protect [B.SP.12]: N/A (NBI) No Approach Sp
(618) Appr Deck Stay-In-Place Forms [B.SP.13]: N/A (NBI) No Approach Sp

SUPERSTRUCTURE CONDITION


(059) Superstructure Rating [B.C.02]: 7 Good

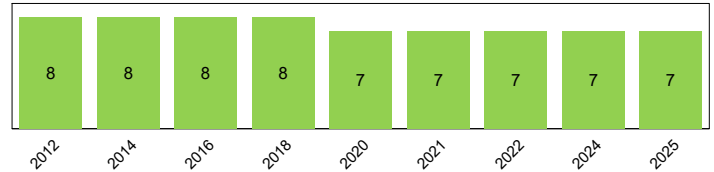

SUPERSTRUCTURE CONDITION

SUBSTRUCTURE

(060) Substructure Rating: 7 Good

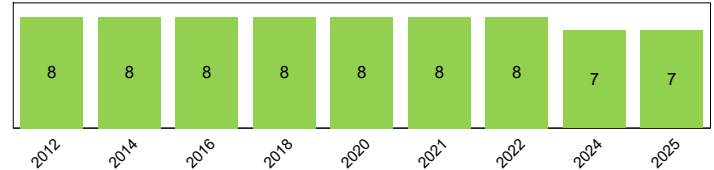

SUBSTRUCTURE CONDITION

PARKING LOCATION

Parking Latitude (if one provided): 33.898619 Parking Longitude (if one provided): 78.839833
Parking Notes (if provided):
Danny Knight Boat Ramp.



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

INSPECTION

(090) Date of Inspection: 10/7/2025
(091) Frequency: 24
Water over 4' but UW Inspection Not Needed (No Request): No
Temperature During Inspection (°F): 75
Weather During Inspection: 1 - Sunny
Team Members: Stephen Rowley, William Cochran,
Schedule Notes: Nicholas Schilling

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	24	11/14/2024	11/14/2026
NSTM (A)			
Underwater (B)	60	10/7/2025	10/7/2029
Special (C)			
Other Routine			
Complex Other			
Damage		8/21/2025	
Load Rating			



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

LOAD RATING AND POSTING

(070) Posting %:	5 - Equal/Abv Legal Load	(063) Opr Method [B.LR.04]:	6 LFR
(031) Design Load [B.LR.01]:	9 MS22.5(HS25)or greater	(064) Opr Rating [B.LR.06]:	1.95 rf
		(065) Inv Method [B.LR.04]:	6 LFR
		(066) Inv Rating [B.LR.05]:	1.17 rf
(411) Date Evaluated [B.LR.03]:	10/11/2020	(465) Alternative Inventory Rate Method:	6 LFR
(418A) Deck/Culvert Condition:	8	(466) Alternative Inventory Rating Factor:	0.96 rf
(418B) Superstructure Condition:	8	(463) Alternative Operating Rate Method:	6 LFR
(418C) Substructure Condition:	8	(464) Alternative Operating Rating Factor:	1.25 rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values

(443) Legal (non-EV) Single 2-3 Axles (tons):

(444) Legal (non-EV) Single 4+ Axles (tons):

(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values

(446) EV Single Axle (tons):

(447) EV Tandem Axle (tons):

(448) EV Gross (tons):

40T Combination Posting

(889) 40T Combination Sign Posted: Not Posted



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

ROADWAY AND CLEARANCES

Location

(05B) Kind of Hwy:	3 State Hwy	Route Posted Speed:	-1
(011) Milepost [B.H.07]:	19.343 mi (31.129 km)	(102) Direction of Traffic [B.RT.03]:	1 1-way traffic
(019) Detour Length [B.H.17]:	10 mi (15 km)	SCDOT Route Type:	4
		Evac Route:	Yes

Clearances

(28A) Lanes On Structure:	2	(622) Railroad Service Type [B.RR.01]:	
(28B) Lanes Under Structure:	0	(574) Railroad Min. Vert. Clearance:	
(053) Min. Vertical Clearance Over Bridge [B.H.13]:	99.99	(575) Railroad Min. Horiz. Offset:	
(054A) Under Vertical Clearance Ref. [B.H.13]:	N Feature not hwy or RR		
(055A) Under Horizontal Clearance Ref. [B.H.15&14]:	N Feature not hwy or RR	(038) Navigable Waterway [B.N.01]:	Permit Not Required
(54B) Minimum Vertical Underclearance [B.H.13]:	0.00	(039) Navigation Min Vertical Clearance [B.N.02]:	0.00
(055B) Minimum Lateral Underclearance R [B.H.15]:	0.00	(116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]:	
(056) Minimum Lateral Underclearance L [B.H.14]:	0.00	(040) Navigation Channel Width [B.N.04]:	0.00
(010) Wide Load Clearance Vertical:	99.99	(631) Nav. Channel Min. Horiz. Clearance [B.N.05]:	0.00
(047) Wide Load Clearance Horizontal [B.H.16]:	38.00	(111) Substructure Nav. Protection [B.N.06]:	

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.H.01]:	06 Rural Minor Arterial	(109) Pct Trucks [B.H.10]:	8%
(104) NHS:	1 On the NHS	(030) ADT Year [B.H.11]:	2024
(100) Defense Hwy:	0 Not a STRAHNET hwy	(114) Future ADT:	22,729
(029) ADT [B.H.09]:	11,900 Cars/Day	(115) Year Of Future ADT:	2044



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]:	1 Highway	(506) Signs/Utilities attached:	U - Utilities Attached
(42B) Type Of Service Under [B.F.02]:	5 Waterway	(630) Fatigue Details [B.IR.02]:	N/A - No D/E/E' details
(027) Year Built [B.W.01]:	2000	(507) Damaged Deck:	1 - New Damage
(106) Year Reconstructed [B.W.02]:	0	(508) Damaged Superstructure:	N - No Damage
(319) Paint Date:		(509) Damaged Substructure:	N - No Damage
(037) History [B.CL.04]:	5 Not eligible for NRHP	(510) Damaged Culvert:	N - No Damage
(112) NBIS Structure Length:	Y Long Enough		
Status of Consultant Repair Recommendations:	No Repair Recommendation	(502) Bent or Barrel Direction:	4 - North to South
		(503) Date of Inventory Photos:	11/14/2024
		(504) Asset ID Placard Location:	Bent 1 (NW Corner)
		(505) Stream Flow Direction:	4 - East to West

CURB REVEAL MEASUREMENTS

Curb Type: No Curb on Bridge*

* = A curb should be considered 12" high or less.
A barrier/railing/parapet is not considered a curb.

Curb Reveal Beginning Left (in):

Curb Reveal Beginning Right (in):

Curb Reveal End Left (in):

Curb Reveal End Right (in):

CULVERT FILL INVENTORY

Not a Culvert (N/A):	Yes	Max Fill (ft):	
Culvert Inlet (ft):		Culvert Outlet (ft):	
Edge of Roadway on Inlet Side of Road (ft):		Edge of Roadway on Outlet Side of Road (ft):	

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
12/3	Re Concrete Deck	52,121	68%	35,572	1%	432	31%	16,117	0%	0
1080/3	Delamination/Spall/Patched Area	18	0%	0	33%	6	67%	12	0%	0
1120/3	Efflorescence/Rust Staining	425	0%	0	100%	425	0%	0	0%	0
1130/3	Cracking (RC and Other)	16,104	0%	0	0%	0	100%	16,104	0%	0
109/3	Pre Opn Conc Girder/Beam	6,382	100%	6,380	0%	2	0%	0	0%	0
1080/3	Delamination/Spall/Patched Area	2	0%	0	100%	2	0%	0	0%	0
205/3	Re Conc Column	33	61%	20	36%	12	3%	1	0%	0
1080/3	Delamination/Spall/Patched Area	5	0%	0	100%	5	0%	0	0%	0
1190/3	Abrasion(PSC/RC)	6	0%	0	100%	6	0%	0	0%	0
6000/3	Scour	2	0%	0	50%	1	50%	1	0%	0
215/3	Re Conc Abutment	108	100%	108	0%	0	0%	0	0%	0
234/3	Re Conc Pier Cap	624	100%	623	0%	1	0%	0	0%	0
1120/3	Efflorescence/Rust Staining	1	0%	0	100%	1	0%	0	0%	0
300/3	Strip Seal Exp Joint	123	0%	0	59%	72	42%	51	0%	0
2350/3	Debris Impaction	123	0%	0	59%	72	42%	51	0%	0
310/3	Elastomeric Bearing	120	100%	120	0%	0	0%	0	0%	0
321/3	Re Conc Approach Slab	1,560	100%	1,560	0%	0	0%	0	0%	0
510/3	Wearing Surfaces	1,520	93%	1,406	0%	0	8%	114	0%	0
3210/3	Del/Spall/Patch/Pot(Wear Surf)	76	0%	0	0%	0	100%	76	0%	0
3220/3	Crack (Wearing Surface)	38	0%	0	0%	0	100%	38	0%	0
331/4	Re Conc Bridge Railing	2,554	83%	2,107	17%	425	1%	22	0%	0
1080/4	Delamination/Spall/Patched Area	22	0%	0	0%	0	100%	22	0%	0
1120/4	Efflorescence/Rust Staining	425	0%	0	100%	425	0%	0	0%	0



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
12/3	Re Concrete Deck	52,121	ft ²	35,572	432	16,117	0
(13) Spans for a total of 1276ft 5-3/8in L; Spans 1-4 are continuous, Spans 5-8 are continuous, Spans 9-11 are continuous, Spans 12 and 13 are Continuous; Reinforced Concrete Deck (40ft-10in W x 8in thick) with metal SIP forms. Top of Deck: * - Defects found during damage inspection. Throughout all spans, in North travel lane at average 5ft centers, transverse cracks (12ft W x FL x 1/32in W) [1130, CS3, Q15312] Over interior bents, in North travel lane and shoulder, spaced 4ft centers diagonal cracks (5ft L x 1/16in W). [1130, CS3, Q704] * Sand covering * Span 5 deck, 20ft from BT6 at left edge of travel lanes, spall (42in long x 3ft wide x up to 1in deep). [1080, CS3, Q12] Span 11, in South travel lane at midspan, spall (7in L x 4in W x 1/2in D). [1080, CS3, Q1] Span 12, North shoulder near midspan, shallow spalls (up to 3in diameter x 1/4in deep). [1080, CS2, Q6] Span 13, in North travel lane and shoulder, diagonal cracks (spaced 4ft x 5ft L x 1/16in W). [1130, CS3, Q88] Underside of Deck: Span 12, both overhangs, at average 6ft centers, transverse and diagonal cracks (2ft L x 1/32in W) with light efflorescence. [1120, CS2, Q425]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	18	ft ²	0	6	12	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	425	ft ²	0	425	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/3	Cracking (RC and Other)	16,104	ft ²	0	0	16,104	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
109/3	Pre Opn Conc Girder/Beam	6,382	ft	6,380	2	0	0
(5) Prestressed Concrete Beams (ASSHTO Type IV 5ft H x 2ft-2in W on bottom and 1ft-8in H on top) BM 5-1 bottom flange, North elevation at BT6, vertical crack (6in H x up to 0.02in W); delamination (full height bottom flange x 3in L) with hairline boundary crack and spall (3in H x 2in L x 1in D) at poured concrete section. [1080, CS2, Q1] BM 5-2 at North 1/4-point, South face, sound patch (8in diameter). [1080, CS2, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	2	ft	0	2	0	0



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
205/3	Re Conc Column	33	each	20	12	1	0
BTs 2 thru 4: (2) Reinforced Concrete Bullnose Columns (4ft W x 8ft L) per bent. BTs 5 thru 13: (3) Reinforced Concrete Columns (4ft diameter) per bent. Column 5-1, minor scour (up to 2ft H). [6000, CS2, Q1] Column 5-3, footing exposed (up to 4ft L x 1ft W x 18in H). [6000, CS3, Q1] Column 8-1, North face at groundline, spall (3in H x 8in W x 1/2in D). [1080, CS2, Q1] Column 10-1, Southwest face, 2ft above ground, spall (3in H x 8in W x 1/2in D). [1080, CS2, Q1] Column 13-1, East face, unsound patch (18in diameter). [1080, CS2, Q1] Column 13-2, West face, unsound patch (18in diameter). [1080, CS2, Q1] Column 13-3, West face, unsound patch (18in diameter). [1080, CS2, Q1] 10/07/2025 Underwater Inspection Findings: Bents 2 thru 4, all columns, at waterline, abrasion (up to 1/4in D) with exposed coarse aggregate. [1190, CS2, Q6, Photos 7 and 8]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	5	each	0	5	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1190/3	Abrasion(PSC/RC)	6	each	0	6	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
6000/3	Scour	2	each	0	1	1	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
215/3	Re Conc Abutment	108	ft	108	0	0	0
(2) Spill through abutment with Reinforced Concrete cap (53ft 3-5/8in L x 4ft W x 3ft-6in H) on (6) Prestressed Concrete Piles (18in x 18in) with rip rap slope protection. No significant deficiencies noted at time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
234/3	Re Conc Pier Cap	624	ft	623	1	0	0
(12) Interior Bents with Reinforced Concrete caps (52ft L x 5ft H) at Bents 2-4, 6-8, 10, 11, and 13 (5ft W) and at Bents 5, 9, and 12 (6ft W). BT 5 East face, below Bay keeper block, light efflorescence (1ft L). [1120, CS2, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	1	ft	0	1	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
300/3	Strip Seal Exp Joint	123	ft	0	72	51	0
(3) Strip Seal Expansion Joints (40ft-10in L) at BTs 5, 9, and 12. JTs at Bents 5, 9, and 12, in both shoulders, compacted gravel and debris; in travel lanes, scattered loose gravel and debris. [2350, CS2, Q72; CS3, Q51]							



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2350/3	Debris Impaction	123	ft	0	72	51	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
310/3	Elastomeric Bearing	120	each	120	0	0	0
(120) Elastomeric Bearings with Metal Plates							
All bearings at EB1, elastomeric sheets in front of pad, fully decayed.							

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
321/3	Re Conc Approach Slab	1,560	ft ²	1,560	0	0	0
(2) Reinforced Concrete Approach Slabs (39ft W x 20ft L x 12in thick).							
Both approach slabs covered by asphalt wearing surfaces.							

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
510/3	Wearing Surfaces	1,520	ft ²	1,406	0	114	0
Asphalt Wearing surface (38ft W x 20ft L x 2in thick) on both approach slabs							
Both approach asphalt wearing surface along joint at EB, spalls (FW x 1/2in L x 1/2in D). [3210, CS3, Q76]							
East approach asphalt wearing surface, transverse crack (FW x 1/8in W). [3220, CS3, Q38]							

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
3210/3	Del/Spall/Patch/Pot(Wear Surf)	76	ft ²	0	0	76	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
3220/3	Crack (Wearing Surface)	38	ft ²	0	0	38	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
331/4	Re Conc Bridge Railing	2,554	ft	2,107	425	22	0
(2) Reinforced Concrete Bridge Railings (1276ft x 2ft-8in H x 1ft-6in W)							
* - Defects found during damage inspection.							
Throughout all spans, both rails, vertical cracks (full height x HL) spaced 6ft, with light efflorescence. [1120, CS2, Q425]							
* Span 5 left rail, 10ft from BT6, fire damage with spall (20ft long x full height x 2in deep). [1080, CS3, Q20]							
* Span 7 left rail, midspan, impact damage with spall (18in long x 6in wide x 2in deep). [1080, CS3, Q2]							
* Left rail over BT7, impact scrapes (20ft long)							

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/4	Delamination/Spall/Patched Area	22	ft	0	0	22	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/4	Efflorescence/Rust Staining	425	ft	0	425	0	0



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

Traffic Signs

(2) Delineators in place at East Approach.

SE delineator leaning to the West

Encroachments

USGS monitoring system attached to exterior face of Left rail in Span 2

Waterway and Channel

Waterway Details:

- Stream flow is well aligned with bents in waterway.
- Waterline was 26ft below Bottom of Cap at Bent 3.
- Depth soundings collected from Waterline using a Digital Depth Sounder.
- Overall max. depth is (9.1ft) at the downstream side of Bent 3.
- High-water line is (8ft) above current waterline.

Debris/Obstructions:

- No significant debris buildup observed.

Streambed Material:

- Consists primarily of sand.
- Max. probe depth measurement (3in).

Channel Protection:

- Both embankments have (6in to 1ft diameter) riprap slope protection. [Photos 9 and 10]

Embankment Deterioration:

- South channel bank in Span 4, erosion due to scupper placement exposing Column 5-1 footing, washed away rubble riprap and near vertical slopes (up to 60ft long x 40ft wide x 6ft deep). [Photo 12 through 14]

Scour:

- No significant scour observed since construction based on available plans.
- No significant local scour observed.

Approach Roadway Condition

West approach roadway at southwest bridge corner undermined (4ft L x <4ft D x <4ft H) with curb footer settled south (12in)

Fender System

N/A

Median and Other Barriers

36A - 1: Reinforced concrete barrier rail (2ft-8in H x 1ft-5in W)
36B - 1: Metal Thrie-Beam Transitions with Metal Posts
36C - 1: "W" beam railing with steel posts on approaches
36D - N: Termination ends greater than 75' away from structure

Under Bridge Railings/Barriers

N/A

Curbs and Sidewalks

N/A

Drainage System

Drains in Spans 2 through 4, clogged

Diaphragms



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

Full Height Reinforced Concrete Diaphragms

Beam 5-2 end diaphragm at Bent 6, Bay 2, spall (2in L x 4in H x 1in D)

Beam 9-3 end diaphragm at Bent 10, Bay 2, delamination (10in L x 16in H)

Wingwalls

N/A

(623) Summary of Previously Performed Maintenance Work [B.W.03]

N/A

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

INSPECTION PHOTOS



Photo 1:
Upstream/East Elevation



Photo 2:
Downstream/West Elevation



Photo 3:
View Upstream/East from under Bridge



Photo 4:
View Downstream/West from under Bridge



Photo 5:
Asset ID Plaque at Bent 1 (NW Corner)



Photo 6:
Bent Configuration, Bents 2 through 4
(Bent 4 shown)



Photo 7:
Typical Concrete Condition at Waterline
(Column 3-1 shown)

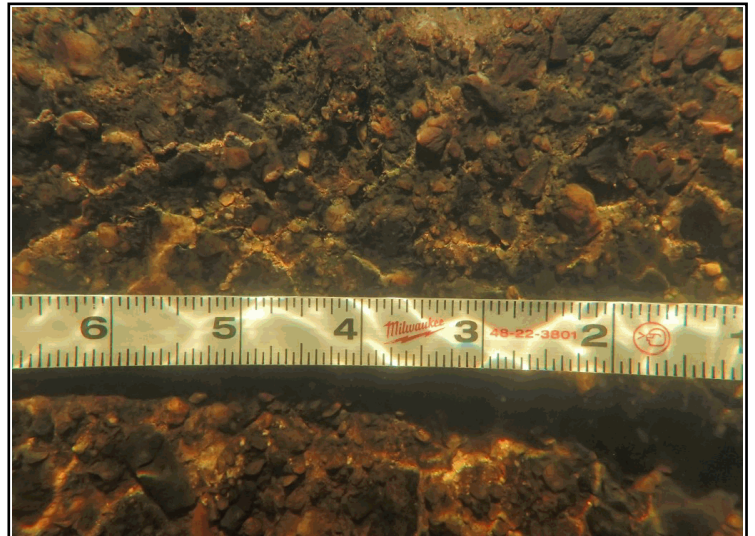


Photo 8:
Typical Concrete Condition below Waterline
(Column 3-1 shown)

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464



Photo 9:
Near/North Embankment



Photo 10:
Far/South Embankment



Photo 11:
South Channel Bank



Photo 12:
South channel bank erosion (approx. 60ft long x 40ft wide x 6ft deep) from scupper discharge at BT5

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464



Photo 13:

Scupper discharge attached to Column 5-2



Photo 14:

Footing 5-2, NW and NE corners, vertical exposure (up to 2ft high) due to bank erosion from scupper discharge



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

STREAMBED CROSS SECTIONS

Orientation:	Left View	Snding Date:	10/2025
Offset Remark:	Upstream Fascia	Location of BM:	Bottom of BT3 Cap
Elev Basis:	Plans	Offset:	20.40
Water Surface:	2.80		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
0 + 98.8	-0.1	_____	BT2
1 + 23.3	-1.8	_____	1/4
1 + 47.8	-5.2	_____	1/2
1 + 72.3	-5.3	_____	3/4
1 + 96.9	-4.7	_____	BT3
2 + 21.4	-3.6	_____	1/4
2 + 45.9	-3.1	_____	1/2
2 + 70.4	-0.4	_____	3/4
2 + 94.9	1.2	_____	BT4
3 + 19.5	5.8	_____	1/4

STREAMBED CROSS SECTIONS

Orientation:	Right View	Snding Date:	10/2025
Offset Remark:	Downstream Fascia	Location of BM:	Bottom of BT3 Cap
Elev Basis:	Plans	Offset:	20.40
Water Surface:	2.80		
SND/ELEV Ind.:	Elevations		

Streambed Details

Stations	SND/ELEV		Remarks
0 + 98.8	-3.8	_____	BT2
1 + 23.3	-1.9	_____	1/4
1 + 47.8	-4.0	_____	1/2
1 + 72.3	-3.3	_____	3/4
1 + 96.9	-5.4	_____	BT3
2 + 21.4	-3.1	_____	1/4
2 + 45.9	-2.4	_____	1/2
2 + 70.4	0.3	_____	3/4
2 + 94.9	2.7	_____	BT4
3 + 19.5	5.8	_____	1/4



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

SCOUR AND WATERWAY

Request Scour Evaluation:	No	Request Waterway Adequacy:	No
<u>Request Scour Evaluation Reason:</u>		<u>Request Waterway Adequacy Evaluation Reason:</u>	
Inspection Information		Streambed Information	
(511) Bridge Over Tidal Waterway:	No	(519) Water Level:	1 - Within Banks
(512) Tide Status During Inspection:		(520) Debris Buildup:	No
(513) Time During Tidal Inspection:		(521) Bed Deposits Downstream:	No
(517) Max Water Depth at Bent (ft)	8.2	(522) Up/Dwnstrm Ch. Stab.:	Channel Stable
(518) Dry Channel:	No	(523) Riprap (if any) Displaced:	No, Riprap Stable
		(524) Structure on a Channel Change:	No
		(525) Stream Aggradation or Degradation:	None Observed
		(526) Lateral Movement of Stream:	No Movement
		(527) Lakes, dams near the bridge?	No Feature
Evidence of Scour		Underwater Bridge Inspection Only	
(528) Scour Holes at End Bents:	No	(534) SSU's Inspected:	Bents 2 through 4.
(529) Scour Holes at Bents:	No		
(530) Scour Holes at Culvert Inlet:	No		
(531) Scour Holes at Culvert Outlet:	No	(535) ADCI Dive Supervisor:	Stephen Rowley
(532) Footing Exposed:	Yes	(536) ADCI Tender/Diver(s):	Nicholas Schilling; William Cochran
(533) Bank Soil Material Washing Out:	Yes		
Scour Condition, POA and Vulnerability			
(442A) Scour Plan of Action Followed:	No	(537) Water Temperature:	73
(442B) POA Category 1:	2 - Has POA	(538) Visibility:	1
(442C) POA Category 2:		(539) Flow Velocity:	.5
(450) Scour Risk Bin:			
(451) Monitoring / Scour Risk Bin:			

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	N	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:		(312) Responsible District:	5
(98A) Border Bridge FHWA Region:		(311) Responsible County:	26
(98A) Border Bridge State:		(439) Asset Management:	0
(101) Parallel Structure:	Left of bridge	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:		(SBI) Topside Inspection Category:	SB7
(422) Date of Temporary Structure:		(SBI) Underwater Inspection Category:	UA10
(SBI) Island Mobility Bridge:	Yes		

JOINT

Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter

Notes:



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

BEARINGS							
Bent #	Bearing #	Bearing Type	Temperature	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)
Notes:							

PILES							
Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness
Notes:							



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

PROCEDURES FOR THIS INSPECTION

Done	Insp Type	Procedure Type	Procedure Name	Details
S	Underwater	Underwater (Custom)	Inspection: Level III Deterioration or Other	If significant deterioration is observed on sheet piles and/or steel H-piles, remaining section measurements shall be taken on a minimum of 10% of piles with deterioration. If applicable, other Level III testing or detailed measurements should be noted under the appropriate Element Table entry.
S	Underwater	Underwater (Custom)	Pre-Inspection: Penetration/Confined Space Dive	Inspections requiring penetration dives shall be planned, and performed following the ADCI consensus standards defined in Section 5.3.6. Additionally, all members of the dive team shall successfully completed OSHA confined space training.
R	Underwater	Underwater (Typical)	Pre-Inspection: Review Items	Review the status of NBI Items 60, 61, 113 and any Scour POA's, previous inspection reports and scour analyses for special conditions to consider during inspection.
R	Underwater	Underwater (Typical)	Inspection: Level I and II Inspections, Photograph	Perform a Level I visual and tactile inspection of 100% of the exterior surface of each submerged element and a Level II inspection (cleaning) on at least 10% of the underwater portion of the structure at selected areas or at areas with suspected deficiencies. Document significant areas of distress using appropriate methods of underwater photography. Perform a detailed channel survey in compliance with BIGD Sections 5.3.4.1.2.



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

S	Underwater	Underwater (Custom)	Inspection: Footing Exposure	If footings are exposed, the amount of exposure and/or undermining shall be documented. Any exposed seals or footing piles shall be documented.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Team	Dive team shall be comprised of, at minimum, three people meeting the requirements of SCDOT BIGD 3.1.1.4 and 3.1.3.4 as well as all applicable ADCI or OSHA standards.
S	Underwater	Underwater (Custom)	Pre-Inspection: Dive Depths > 100'	Additional precautions and considerations must be outlined in the risk factor and hazard documentation located in BrM Consultant Inspection Task and the Dive Plan. Applicable OSHA requirements must be followed and a decompression chamber with a certified operator must be available on site.
R	Underwater	Underwater (Typical)	Pre-Inspection: Dive Plan	A dive plan for each inspection mobilization shall be uploaded to Bridge File prior to inspection efforts. The dive plan should consider any notable hazards and site conditions that are listed in the risk factor and hazard documentation located in BrM Consultant Inspection Task. from the previous underwater inspection, if applicable. The dive plan shall include ADCI certification for at least three dive team members, including the BITL. The dive plan is unique for each mobilization. The dive plan shall be uploaded to the Bridge File according to the BFP. If the dive plan was updated, or changed during the mobilization, a new revised plan should also be uploaded to the Bridge File.

Inspector Procedure Notes

No steel sheet/H-piles observed. Dive depths less than 100ft. Penetration/Confined Space dive not required. No exposed footings.



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

EQUIPMENT USED IN THIS INSPECTION

<u>Name</u>	<u>Hours</u>	<u>Cost</u>
A08 SCUBA	0.00	0
A06 Boat: Motorboat	0.00	0
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

09697

Team Leader: Adrian Marchand

Inspection Date: 10/07/2025

(7) Facility Carried: SC 22 WB

(6) Crossing: WACCAMAW RIVER

Inspection Type(s): Underwater

(16) Latitude: 33.899061 (17) Longitude: -78.856464

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY Adrian Marchand

Date 10/7/2025

QC Reviewed By: John Bogue

QC Completed: 10/15/2025

QA Reviewed By:

QA Completed: