



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

IDENTIFICATION

Asset ID:	09789	(009) Location [B.L.11]:	5 MI NE OF SOCASTEE
(468) Structure Number:	2640003111200	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(26) Horry
(42A) Type of Service On [B.F.01]:	1 Highway	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	SC 90	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	1 Highway	(011) Mile Post [B.H.07]:	1.917 mi (3.085 km)
(021) Custodian:		(106) Year Recon [B.W.02]:	0
(027) Year Built [B.W.01]:	2002	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL

(058) Deck Structure Condition [B.C.01]:	7 Good	(602) Bridge Railing Condition [B.C.05]	7 Good
(059) Superstructure Condition [B.C.02]:	7 Good	(603) Bridge Railing Trans. Condition [B.C.06]:	8 Very Good
(060) Substructure Condition [B.C.03]:	7 Good	(604) Bridge Bearing Condition [B.C.07]	8 Very Good
(062) Culvert Retaining Condition [B.C.04]:	N N/A (NBI)	(605) Bridge Joint Condition [B.C.08]:	6 Satisfactory
(600) UW Substructure Condition [B.C.15]:	N N/A (NBI)	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	N N/A (NBI)	(071) Waterway Adequacy [B.AP.02]:	N Not applicable
(601) Channel Protection Condition [B.C.09]:	N N/A (NBI)	(113) Scour Condition:	N - Not Over Waterway
(633) NSTM Condition:	N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	N - Does not cross water


GEOMETRY

(034) Skew [B.G.11]:	20	(032) Approach Roadway [B.G.09]:	52.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	56.3
(049) Structure Length [B.G.01]:	221.0	(052) Deck Width Out-To-Out [B.G.05]:	59.3
(619) Curved Bridge [B.G.12]:	N - Not Curved	(441) Deck Area [B.G.16]:	13,111.93
(620) Maximum Height Bridge [B.G.13]:	28	(033) Bridge Medians [B.G.10]:	0 No median
(621) Side Hill Bridge [B.G.14]:	No	(50A) Curb Sidewalk Width/Left [B.G.07]:	0.0
		(50B) Curb Sidewalk Width/Right [B.G.08]:	0.0
		(606) Minimum Span Length [B.G.04]:	60.5

DECK

Deck Material and Type

(501) Deck Overburden Depth (in):	0.0
(107) Deck Type:	1 - Conc Cast-in-Place
(108A) Wearing Surface:	1 Monolithic Concrete
(108B) Membrane:	0 - None
(108C) Deck Protection:	0 None

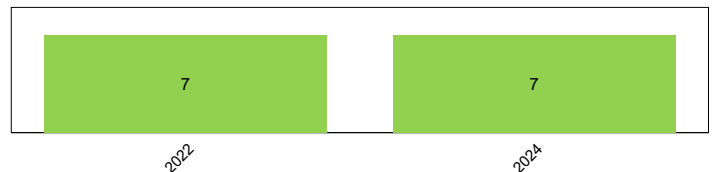

DECK CONDITION

Roadside Hardware

(36A) Bridge Rail:	0 Substandard
(36B) Transition:	1 Meets Standards
(36C) Approach Rail:	1 Meets Standards
(36D) Approach Rail Ends:	N N/A or not required



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

SUPERSTRUCTURE

Main Span Material and Type


(045) # of Main Spans: 3
(048) Max Span Length [B.G.03]: 100.0
(43A) Main Material: 5 Prestressed Concrete
(43B) Main Design: 02 Stringer/Girder
(607) Main Number Of Beam Lines [B.SP.03]: 7
(608) Main Span Continuity [B.SP.05]: 1 - Simple / Single Span
(609) Main Protection System [B.SP.07]: Unprotected Span
(610) Main Deck Interaction [B.SP.08]: CU - Composite Unshored
(611) Main Deck Reinforcement Protect [B.SP.12]: 0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]: M01 - Metal

Approach Span Material and Type

(046) # of Approach Spans: 0
(308) Appr Max Span Length: 0.0
(44A) Approach Span Material: 0 N/A (or Other)
(44B) Approach Span Design: 0 N/A (or Other)
(613) Appr Number Of Beam Lines [B.SP.03]: 0
(614) Appr Span Continuity [B.SP.05]: N/A (NBI) No Approach Sp
(615) Appr Protection System [B.SP.07]: N/A (NBI) No Approach Sp
(616) Appr Deck Interaction [B.SP.08]: N/A (NBI) No Approach Sp
(617) Appr Deck Reinforcement Protect [B.SP.12]: N/A (NBI) No Approach Sp
(618) Appr Deck Stay-In-Place Forms [B.SP.13]: N/A (NBI) No Approach Sp

SUPERSTRUCTURE CONDITION


(059) Superstructure Rating [B.C.02]: 7 Good

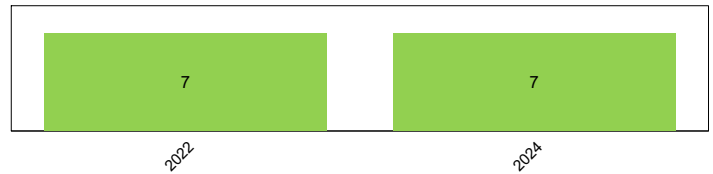

SUPERSTRUCTURE CONDITION

SUBSTRUCTURE

(060) Substructure Rating: 7 Good

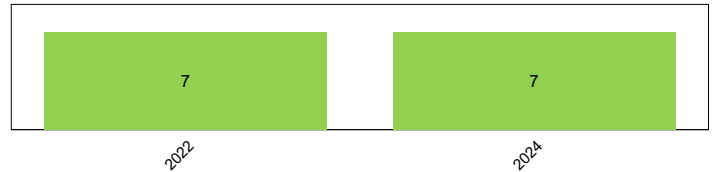

SUBSTRUCTURE CONDITION

PARKING LOCATION

Parking Latitude (if one provided): 33.852363 Parking Longitude (if one provided): -78.698256
Parking Notes (if provided):
under the parallel structure, North shoulder of SC 90



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

INSPECTION

(090) Date of Inspection: 10/10/2024
(091) Frequency: 24
Temperature During Inspection (°F): 63
Weather During Inspection: 2 - Cloudy
Team Members: Jihad Libbus
Schedule Notes:

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	24	10/10/2024	10/10/2026
NSTM (A)			
Underwater (B)			
Special (C)			
Other Routine			
Complex Other			
Damage			
Load Rating			

LOAD RATING AND POSTING

(070) Posting %: 5 - Equal/Abv Legal Load
(031) Design Load [B.LR.01]: 9 MS22.5(HS25)or greater

(411) Date Evaluated [B.LR.03]: 10/01/2020
(418A) Deck/Culvert Condition: 8
(418B) Superstructure Condition: 8
(418C) Substructure Condition: 8

(063) Opr Method [B.LR.04]: 8 LRFR
(064) Opr Rating [B.LR.06]: 1.75 rf
(065) Inv Method [B.LR.04]: 8 LRFR (HL93)
(066) Inv Rating [B.LR.05]: 1.20 rf
(465) Alternative Inventory Rate Method: 5 No Rating or Eval
(466) Alternative Inventory Rating Factor: rf
(463) Alternative Operating Rate Method: 5 No Rating or Eval
(464) Alternative Operating Rating Factor: rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values

(443) Legal (non-EV) Single 2-3 Axles (tons):
(444) Legal (non-EV) Single 4+ Axles (tons):
(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values

(446) EV Single Axle (tons):
(447) EV Tandem Axle (tons):
(448) EV Gross (tons):

40T Combination Posting

(889) 40T Combination Sign Posted: 0 - No, Not Posted

ROADWAY AND CLEARANCES

Location

(05B) Kind of Hwy: 3 State Hwy
(011) Milepost [B.H.07]: 1.917 mi (3.085 km)
(019) Detour Length [B.H.17]: 1 mi (2 km)

Route Posted Speed: -1
(102) Direction of Traffic [B.RT.03]: 1 1-way traffic
SCDOT Route Type: 4
Evac Route: 0

Clearances

(28A) Lanes On Structure: 3 (622) Railroad Service Type [B.RR.01]:
(28B) Lanes Under Structure: 3 (574) Railroad Min. Vert. Clearance:
(053) Min. Vertical Clearance Over Bridge [B.H.13]: 99.99 (575) Railroad Min. Horiz. Offset:
(054A) Under Vertical Clearance Ref. [B.H.13]: H Hwy beneath struct
(055A) Under Horizontal Clearance Ref. [B.H.15&14]: H Hwy beneath struct (038) Navigable Waterway [B.N.01]: NA-no waterway
(54B) Minimum Vertical Underclearance [B.H.13]: 21.08 (039) Navigation Min Vertical Clearance [B.N.02]: 0.00
(055B) Minimum Lateral Underclearance R [B.H.15]: 21.00 (116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]: 0.00
(056) Minimum Lateral Underclearance L [B.H.14]: 0.00 (040) Navigation Channel Width [B.N.04]: 0.00
(010) Wide Load Clearance Vertical: 99.99 (631) Nav. Channel Min. Horiz. Clearance [B.N.05]: 0.00
(047) Wide Load Clearance Horizontal [B.H.16]: 56.25 (111) Substructure Nav. Protection [B.N.06]:



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra
Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL
(6) Crossing: SC 90
Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.N. 01&02]:	12 Urban Fwy/Expwy	(109) Pct Trucks [B.H.10]:	5%
(104) NHS:	1 On the NHS	(030) ADT Year [B.H.11]:	2023
(100) Defense Hwy:	0 Not a STRAHNET hwy	(114) Future ADT:	50,864
(029) ADT [B.H.09]:	17,600 Cars/Day	(115) Year Of Future ADT:	2043



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]:	1 Highway	(506) Signs/Utilities attached:	N - Nothing Attached
(42B) Type Of Service Under [B.F.02]:	1 Highway	(630) Fatigue Details [B.IR.02]:	No E/E' details
(027) Year Built [B.W.01]:	2002	(507) Damaged Deck:	N - No Damage
(106) Year Reconstructed [B.W.02]:	0	(508) Damaged Superstructure:	N - No Damage
(319) Paint Date:		(509) Damaged Substructure:	N - No Damage
(037) History [B.CL.04]:	5 Not eligible for NRHP	(510) Damaged Culvert:	N - No Damage
(112) NBIS Structure Length:	Y Long Enough		
Status of Consultant Repair Recommendations:	Submitted but Unsigned	(502) Bent or Barrel Direction:	4 - North to South
		(503) Date of Inventory Photos:	10/10/2024
		(504) Asset ID Placard Location:	Bent 1 (NW Corner)
		(505) Stream Flow Direction:	N/A

CURB REVEAL MEASUREMENTS

No Curb:	Yes	Hidden Curb:	No
Curb Reveal Beginning Left (in):		Curb Reveal Beginning Right (in):	
Curb Reveal End Left (in):		Curb Reveal End Right (in):	

CULVERT FILL INVENTORY

Not a Culvert (N/A):	Yes	Max Fill (ft):	
Culvert Inlet (ft):		Culvert Outlet (ft):	
Edge of Roadway on Inlet Side of Road (ft):		Edge of Roadway on Outlet Side of Road (ft):	

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
12/3	Re Concrete Deck	13,113	90%	11,802	10%	1,311	0%	0	0%	0
1130/3	Cracking (RC and Other)	1,311	0%	0	100%	1,311	0%	0	0%	0
109/2	Pre Opn Conc Girder/Beam	1,547	99%	1,533	1%	14	0%	0	0%	0
521/2	Conc Prot Coating	1,059	100%	1,059	0%	0	0%	0	0%	0
1120/2	Efflorescence/Rust Staining	14	0%	0	100%	14	0%	0	0%	0
205/2	Re Conc Column	6	100%	6	0%	0	0%	0	0%	0
521/2	Conc Prot Coating	1,358	100%	1,358	0%	0	0%	0	0%	0
215/2	Re Conc Abutment	126	97%	122	3%	4	0%	0	0%	0
1130/2	Cracking (RC and Other)	4	0%	0	100%	4	0%	0	0%	0
234/2	Re Conc Pier Cap	120	100%	120	0%	0	0%	0	0%	0
521/2	Conc Prot Coating	1,380	100%	1,380	0%	0	0%	0	0%	0
301/3	Pourable Joint Seal	252	81%	204	0%	0	19%	48	0%	0
2330/3	Seal Damage	8	0%	0	0%	0	100%	8	0%	0
2350/3	Debris Impaction	40	0%	0	0%	0	100%	40	0%	0
310/2	Elastomeric Bearing	42	100%	42	0%	0	0%	0	0%	0
321/3	Re Conc Approach Slab	2,240	100%	2,240	0%	0	0%	0	0%	0
510/3	Wearing Surfaces	2,240	100%	2,240	0%	0	0%	0	0%	0
331/3	Re Conc Bridge Railing	442	73%	322	27%	120	0%	0	0%	0
1120/3	Efflorescence/Rust Staining	120	0%	0	100%	120	0%	0	0%	0



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
12/3	Re Concrete Deck	13,113	ft ²	11,802	1,311	0	0
(3) Spans (Span 1 and 3at 60ft 6in L, Span 2 at 100ft L) for a total length of 221ft L; Reinforced Concrete Deck (59ft-4in W x 8-1/4in thick) with SIP forms. Top of Deck: All spans, scattered throughout, map cracking (10% x hairline). [1130, CS2, Q1311]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/3	Cracking (RC and Other)	1,311	ft ²	0	1,311	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
109/2	Pre Opn Conc Girder/Beam	1,547	ft	1,533	14	0	0
(7) Prestressed Concrete Beams (XB-63-59) (5ft-3-1/2in H x 2ft-7in W at bottom x 4ft-11in W at top) in each span. BM 3-2 at EB4, scattered transverse cracks (0.004in W) with efflorescence on underside of top flange. [1120, CS2, Q8] BM 3-7 at midspan, scattered transverse cracks (0.004in W) with efflorescence on underside of top flange. [1120, CS2, Q6]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
521/2	Conc Prot Coating	1,059	ft ²	1,059	0	0	0
Concrete Protective Coating at exterior faces of Span 2 exterior Beams (average 5.29sf per linear foot). No significant deficiencies noted at time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/2	Efflorescence/Rust Staining	14	ft	0	14	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
205/2	Re Conc Column	6	each	6	0	0	0
(2) Interior Bents each with (3) Reinforced Concrete Columns (3ft-6in diameter). No significant deficiencies noted at time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
521/2	Conc Prot Coating	1,358	ft ²	1,358	0	0	0
Concrete Protective Coating at all Columns (average 226.2sf per Column). No significant deficiencies noted at time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
215/2	Re Conc Abutment	126	ft	122	4	0	0
(2) End Bents with Reinforced Concrete Caps (63ft L x 5ft-6in W x 4ft-8in H) on Reinforced Concrete Spread Footings (70ft-1-1/2in L x 12ft W x 3ft H) concealed by Reinforced Concrete slope protection. EB4, Bay 5, vertical crack (full height x 1/32in W) extending onto top face (similar at Bays 2, 3, and 6). [1130, CS2, Q4]							



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1130/2	Cracking (RC and Other)	4	ft	0	4	0	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
234/2	Re Conc Pier Cap	120	ft	120	0	0	0

(2) Interior Bents with Reinforced Concrete Caps (60ft L x 6ft W x 5ft H)

No significant deficiencies noted at time of inspection.

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
521/2	Conc Prot Coating	1,380	ft ²	1,380	0	0	0

Concrete Protective Coating at all Bent Caps (average 11.5sf per linear foot).

No significant deficiencies noted at time of inspection.

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
301/3	Pourable Joint Seal	252	ft	204	0	48	0

(4) Compression seal joints (63ft L) over all bent.

All Joints, both shoulders, debris accumulation (10lf total). [2350, CS3, Q40]

JT 1, scattered throughout both lanes, seal damaged and torn (8lf). [2330, CS3, Q8]

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2330/3	Seal Damage	8	ft	0	0	8	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2350/3	Debris Impaction	40	ft	0	0	40	0

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
310/2	Elastomeric Bearing	42	each	42	0	0	0

(42) Elastomeric bearing pads with metal plates; (14) at each interior bent, (7) at each end bent.

No significant deficiencies noted at time of inspection.

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
321/3	Re Conc Approach Slab	2,240	ft ²	2,240	0	0	0

(2) Reinforced Concrete Approach Slabs (20ft L x 56ft W x 1ft thick)

No significant deficiencies noted at time of inspection.

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
510/3	Wearing Surfaces	2,240	ft ²	2,240	0	0	0

(2) Asphalt Wearing Surface (20ft L x 56ft W x 2in thick)

No significant deficiencies noted at time of inspection.



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303

(17) Longitude: -78.698044

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
331/3	Re Conc Bridge Railing	442	ft	322	120	0	0
(2) Reinforced Concrete Bridge Rails (2ft-8in H x 1ft-5in W)							
All spans, both rails, scattered throughout, vertical cracks (full height x up to 1/32in) with efflorescence [1120, CS2, Q120]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	120	ft	0	120	0	0



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

SW corner, washout (5ft x 4ft x 2ft deep).
SE corner, vegetation growth.
Slope protection interface with End Bent 1 cap and abutment, missing joint sealant (full length).

Traffic Signs

(2) Delineators in place at the South approach.

Encroachments

N/A

Waterway and Channel

N/A

Approach Roadway Condition

Both approaches at end of approach slab, transverse cracks (full width x 1/4in thick).

Fender System

N/A

Median and Other Barriers

36A- 0: Reinforced Concrete rails (2ft-8in H x 1ft 5in W).
36B- 1: Metal Thrie Beam with metal posts on transitions at South approach.
36C- 1: Metal "W" beam with metal posts on approaches at SE, SW and NE Corner.
36D: N: Terminations end greater than 75ft from structure.

No significant deficiencies noted at time of inspection.

Under Bridge Railings/Barriers

N/A

Curbs and Sidewalks

N/A

Drainage System

(6) PVC lined weep holes (6in diameter) at each end bent.

No significant deficiencies noted at time of inspection.

Diaphragms

Reinforced Concrete End Diaphragm (full height) at all Bents with Seismic Restrainer at Bay 2 and 5; Reinforced Concrete Intermediate Diaphragms (full height) at midspan of Span 2.

No significant deficiencies noted at time of inspection.

Wingwalls

N/A

(623) Summary of Previously Performed Maintenance Work [B.W.03]

N/A

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

INSPECTION PHOTOS



Photo 1:
North Approach Looking South



Photo 2:
South Approach Looking North



Photo 3:
Backstation (North Approach Looking North)



Photo 4:
Upstation (South Approach Looking South)

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 5:
East Profile Looking West



Photo 6:
West Profile Looking East



Photo 7:
Feature Intersected (Looking West)



Photo 8:
Feature Intersected (Looking East)

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 9:
Asset ID Plaque at Bent 1 (NW Corner)



Photo 10:
Southeast Guardrail Transition



Photo 11:
Typical Bridge Rail (West Shown)



Photo 12:
Concrete Bridge Deck

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 13:
Typical Compression Joint (Bent 2 shown)



Photo 14:
Typical Superstructure (Span 2 shown)



Photo 15:
Typical Reinforced Concrete End Diaphragm



Photo 16:
Reinforced Concrete End Diaphragm with Seismic Restrainer at Bay 2 and 5

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 17:
Typical Reinforced Concrete Intermediate Diaphragm



Photo 18:
Typical Beams over Bent (Bent 2 Shown)



Photo 19:
Typical Elastomeric Bearing with Metal Plate (BRG 1-7 Shown)



Photo 20:
Typical End Bent (End Bent 1 shown)

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 21:
Typical Substructure (Bent 2 shown)



Photo 22:
Looking West thru Span 2 (SC 90)



Photo 23:
(6) PVC lined Weep holes (6in diameter) at each End Bent



Photo 24:
BM 3-2 at EB4, scattered transverse cracks (0.004in W) with efflorescence on underside of top flange.

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 25:

EB4, Bay 5, vertical crack (full height x 1/32in) extending onto top face.



Photo 26:

All Joints, both shoulders, debris accumulation (10lf total) (Bent 2 shown).



Photo 27:

JT 1, scattered throughout both lanes, seal damaged and torn (8lf).



Photo 28:

All spans, both rails, scattered throughout, vertical cracks (full height x up to 1/32in) with efflorescence.

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044



Photo 29:
SE corner, vegetation growth.



Photo 30:
SW corner, washout (5ft x 4ft x 2ft deep).



Photo 31:
Slope protection interface with End Bent 1 cap and abutment, missing joint sealant (full length).



Photo 32:
Both approaches at end of approach slab, transverse cracks (full width x 1/4in thick). (South Shown)



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.

STREAMBED CROSS SECTIONS

Orientation:
Offset Remark:
Elev Basis:
Water Surface:
SND/ELEV Ind.:

Snding Date: /
Location of BM:
Offset:

Streambed Details

Stations

SND/ELEV

Remarks



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

SCOUR AND WATERWAY

Request Scour Evaluation:	No	Request Waterway Adequacy:	No
<u>Request Scour Evaluation Reason:</u>		<u>Request Waterway Adequacy Evaluation Reason:</u>	
Inspection Information		Streambed Information	
(511) Bridge Over Tidal Waterway:	No	(519) Water Level:	N/A
(512) Tide Status During Inspection:		(520) Debris Buildup:	N/A
(513) Time During Tidal Inspection:		(521) Bed Deposits Downstream:	N/A
(517) Max Water Depth at Bent (ft)		(522) Up/Dwnstrm Ch. Stab.:	N/A
(518) Dry Channel:	Yes	(523) Riprap (if any) Displaced:	N/A (No Riprap)
		(524) Structure on a Channel Change:	N/A
		(525) Stream Aggradation or Degradation:	N/A
		(526) Lateral Movement of Stream:	N/A
		(527) Lakes, dams near the bridge?	No Feature
Evidence of Scour		Underwater Bridge Inspection Only	
(528) Scour Holes at End Bents:	No	(534) SSU's Inspected:	
(529) Scour Holes at Bents:	No		
(530) Scour Holes at Culvert Inlet:	No	(535) ADCI Dive Supervisor:	
(531) Scour Holes at Culvert Outlet:	No	(536) ADCI Tender/Diver(s):	
(532) Footing Exposed:	No		
(533) Bank Soil Material Washing Out:	No		
Scour Condition, POA and Vulnerability			
(442A) Scour Plan of Action Followed:	No	(537) Water Temperature:	
(442B) POA Category 1:		(538) Visibility:	
(442C) POA Category 2:		(539) Flow Velocity:	
(450) Scour Risk Bin:			
(451) Monitoring / Scour Risk Bin:			

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:	(312) Responsible District:	5
(98A) Border Bridge FHWA Region:	(311) Responsible County:	26
(98A) Border Bridge State:	(439) Asset Management:	0
(101) Parallel Structure:	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:	(SBI) Topside Inspection Category:	SD4
(422) Date of Temporary Structure:	(SBI) Underwater Inspection Category:	
(SBI) Island Mobility Bridge:		

JOINT

Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter

Notes:



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

BEARINGS						
Bent #	Bearing #	Bearing Type	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)
Notes:						

PILES							
Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness
Notes:							



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

PROCEDURES FOR THIS INSPECTION

<u>Done</u>	<u>Insp Type</u>	<u>Procedure Type</u>	<u>Procedure Name</u>	<u>Details</u>
R	Routine	Routine (Typical)	Inspection: Defect Photos	Any NBE (element) with CS3 or CS4 Any deterioration causing an NBE (element) to have a CS3 or CS 4 documented with a photograph. Per BIGD 5.4.4.2.
S	Routine	Routine (Typical)	Inspection: Timber Sounding	Sound full length of exposed timber piles (including through bolts) per BIGD 5.3.3.1 and 5.3.3.2.1.
R	Routine	Routine (Typical)	Post-Inspection: Data Verification	Verify the correct: 1) Traffic Status (NBI 041), 2) Inspection Intervals (NBI 090 to 093), 3) Bridge Condition (NBI 58, 59, 60 or 62), 4) Rating Values (NBI 064 and 066), and 5) Sign Posting Values (SBI 443 to 448 and 889).
S	Routine	Routine (Typical)	Inspection: Pile Sketch	Pile Sketch Table required when NBI Item 60 Condition Rating = 5. Per BIGD 5.3.3.1 and 5.4.4.5.



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

(7) Facility Carried: SC 31 NBL

Inspection Date: 10/10/2024

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

S	Routine	Routine (Typical)	Inspection: Posting Photos	Photographs of at bridge and advance (if present) posting or weight limit signs are required to be taken during all routine inspections. These requirements are applicable to the posting or weight limit signs at the bridge and in advance of the bridge which could require many signs to be photographed. These signs include R-12-6-48 and R-12-7-48 (legal loads), and R-12-9-36 (EV weight limit) at both ends of the bridge. Per BIGD 5.4.4.2 (TN03).
R	Routine	Routine (Typical)	Post-Inspection: Requests	Confirm that all Inspection Requests are included as both scheduled inspections in the Schedule Table and the Requests Table when needed. Confirm requests include Load Rating (if needed) (NBI GCR 7 to 5 or NBI GCR to 4, Element CS4, etc.). Confirm requests include Hydraulic Appraisal (if needed) (NBI 071 and NBI 113). Confirm requests include UW (Unscheduled) (Water Depth 4' or more at Bent).

Inspector Procedure Notes
Substructure Rating greater than 5, No Pile Sketch Needed; No Timber Piles; Bridge is not Posted

EQUIPMENT USED IN THIS INSPECTION		
Name	Hours	Cost
A11 Video pole	1.00	0
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

09789

Team Leader: Ramesh Mishra

Inspection Date: 10/10/2024

(7) Facility Carried: SC 31 NBL

(6) Crossing: SC 90

Inspection Type(s): Routine

(16) Latitude: 33.852303 (17) Longitude: -78.698044

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY Ramesh Mishra

Date 10/10/2024

QC Reviewed By: Bill Mitchell

QC Completed: 11/30/2024

QA Reviewed By:

QA Completed: