



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

IDENTIFICATION

Asset ID:	09967	(009) Location [B.L.11]:	II N OF MYRTLE BEACH
(468) Structure Number:	2640003110800	(041) Traffic Status: County [B.PS.01]:	A - Open, no restriction
(002) District [B.L.04]:	District 5	(003) County [B.L.02]:	(26) Horry
(42A) Type of Service On [B.F.01]:	6 2d level interchg	(004) Placecode [B.L.03]:	Unknown
(006) Feature Intersected:	SC 22	(022) Owner [B.CL.01]:	SCDOT
(42B) Type of Service Under [B.F.02]:	1 Highway	(011) Mile Post [B.H.07]:	7.866 mi (12.659 km)
(021) Custodian:	01 SCDOT	(106) Year Recon [B.W.02]:	0
(027) Year Built [B.W.01]:	2002	(037) Historical:	5 Not eligible for NRHP

CONDITION AND APPRAISAL

(058) Deck Structure Condition [B.C.01]:	7 Good	(602) Bridge Railing Condition [B.C.05]	7 Good
(059) Superstructure Condition [B.C.02]:	7 Good	(603) Bridge Railing Trans. Condition [B.C.06]:	7 Good
(060) Substructure Condition [B.C.03]:	7 Good	(604) Bridge Bearing Condition [B.C.07]	7 Good
(062) Culvert Retaining Condition [B.C.04]:	N N/A (NBI)	(605) Bridge Joint Condition [B.C.08]:	6 Satisfactory
(600) UW Substructure Condition [B.C.15]:	N N/A (NBI)	(072) Appr Roadway Align Appraisal [B.AP.01]	8 Equal Desirable Crit
(061) Channel Condition [B.C.09]:	N N/A (NBI)	(071) Waterway Adequacy [B.AP.02]:	N Not applicable
(601) Channel Protection Condition [B.C.09]:	N N/A (NBI)	(113) Scour Condition:	N - Not Over Waterway
(633) NSTM Condition:	N/A (NBI) (No NSTMs)	(631) Scour Condition Rating:	N - Does not cross water


GEOMETRY

(034) Skew [B.G.11]:	6	(032) Approach Roadway [B.G.09]:	60.0
(035) Structure Flared:	0 No flare	(051) Curb To Curb Width [B.G.06]:	64.0
(049) Structure Length [B.G.01]:	215.0	(052) Deck Width Out-To-Out [B.G.05]:	67.1
(619) Curved Bridge [B.G.12]:	N - Not Curved	(441) Deck Area [B.G.16]:	14,422.20
(620) Maximum Height Bridge [B.G.13]:	25	(033) Bridge Medians [B.G.10]:	0 No median
(621) Side Hill Bridge [B.G.14]:	No	(50A) Curb Sidewalk Width/Left [B.G.07]:	0.0
		(50B) Curb Sidewalk Width/Right [B.G.08]:	0.0
		(606) Minimum Span Length [B.G.04]:	107.6

DECK

Deck Material and Type

(501) Deck Overburden Depth (in):	0.0
(107) Deck Type:	1 - Conc Cast-in-Place
(108A) Wearing Surface:	1 Monolithic Concrete
(108B) Membrane:	0 - None
(108C) Deck Protection:	0 None

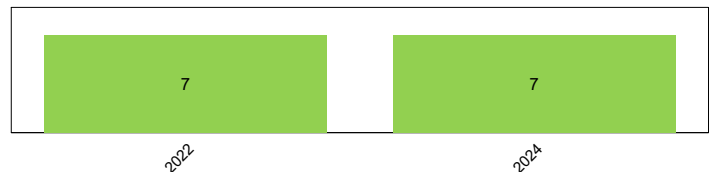

DECK CONDITION

Roadside Hardware

(36A) Bridge Rail:	1 Meets Standards
(36B) Transition:	1 Meets Standards
(36C) Approach Rail:	1 Meets Standards
(36D) Approach Rail Ends:	N N/A or not required



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

SUPERSTRUCTURE

Main Span Material and Type


(045) # of Main Spans: 2
(048) Max Span Length [B.G.03]: 107.6
(43A) Main Material: 6 P/S Conc Continuous
(43B) Main Design: 02 Stringer/Girder
(607) Main Number Of Beam Lines [B.SP.03]: 8
(608) Main Span Continuity [B.SP.05]: 3 - Continuous LL Only
(609) Main Protection System [B.SP.07]: Unprotected Span
(610) Main Deck Interaction [B.SP.08]: CU - Composite Unshored
(611) Main Deck Reinforcement Protect [B.SP.12]: 0 - No Protection
(612) Main Deck Stay-In-Place Forms [B.SP.13]: M01 - Metal

Approach Span Material and Type

(046) # of Approach Spans: 0
(308) Appr Max Span Length: 0.0
(44A) Approach Span Material: 0 N/A (or Other)
(44B) Approach Span Design: 0 N/A (or Other)
(613) Appr Number Of Beam Lines [B.SP.03]: 0
(614) Appr Span Continuity [B.SP.05]: N/A (NBI) No Approach Sp
(615) Appr Protection System [B.SP.07]: N/A (NBI) No Approach Sp
(616) Appr Deck Interaction [B.SP.08]: N/A (NBI) No Approach Sp
(617) Appr Deck Reinforcement Protect [B.SP.12]: N/A (NBI) No Approach Sp
(618) Appr Deck Stay-In-Place Forms [B.SP.13]: N/A (NBI) No Approach Sp

SUPERSTRUCTURE CONDITION


(059) Superstructure Rating [B.C.02]: 7 Good

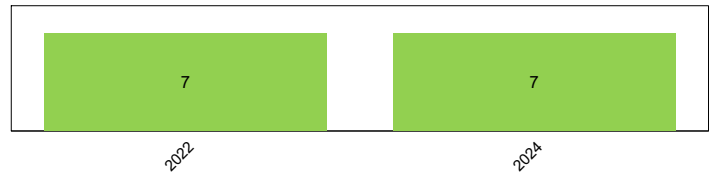

SUPERSTRUCTURE CONDITION

SUBSTRUCTURE

(060) Substructure Rating: 7 Good

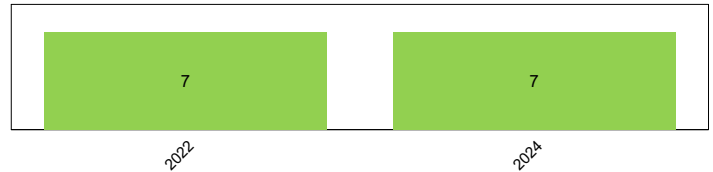

SUBSTRUCTURE CONDITION

PARKING LOCATION

Parking Latitude (if one provided): 33.809872 Parking Longitude (if one provided): -78.779981
Parking Notes (if provided):
North of structure in Gore Area on SC22 NB.



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

INSPECTION

(090) Date of Inspection: 10/7/2024
(091) Frequency: 24
Temperature During Inspection (°F): 80
Weather During Inspection: 1 - Sunny
Team Members: Christian Flores
Schedule Notes:

Inspection Type	Freq (92)	Last Insp (93)	Next Insp
Routine	24	10/7/2024	10/7/2026
NSTM (A)			
Underwater (B)			
Special (C)			
Other Routine			
Complex Other			
Damage			
Load Rating			

LOAD RATING AND POSTING

(070) Posting %: 5 - Equal/Abv Legal Load
(031) Design Load [B.LR.01]: 9 MS22.5(HS25) or greater

(063) Opr Method [B.LR.04]: 8 LRFR
(064) Opr Rating [B.LR.06]: 1.53 rf
(065) Inv Method [B.LR.04]: 8 LRFR (HL93)
(066) Inv Rating [B.LR.05]: 1.18 rf

(411) Date Evaluated [B.LR.03]: 02/01/2020
(418A) Deck/Culvert Condition: 8
(418B) Superstructure Condition: 8
(418C) Substructure Condition: 8

(465) Alternative Inventory Rate Method: 5 No Rating or Eval
(466) Alternative Inventory Rating Factor: rf
(463) Alternative Operating Rate Method: 5 No Rating or Eval
(464) Alternative Operating Rating Factor: rf

POSTING SIGN VALUES

R-12-6-48 Legal Load Posting and Sign Posted Values

(443) Legal (non-EV) Single 2-3 Axles (tons):
(444) Legal (non-EV) Single 4+ Axles (tons):
(445) Legal (non-EV) Combinations (tons):

R-12-9-36 Emergency Vehicle Posting and Sign Posted Values

(446) EV Single Axle (tons):
(447) EV Tandem Axle (tons):
(448) EV Gross (tons):

40T Combination Posting

(889) 40T Combination Sign Posted: 0 - No, Not Posted

ROADWAY AND CLEARANCES

Location	
(05B) Kind of Hwy: 3 State Hwy	Route Posted Speed: -1
(011) Milepost [B.H.07]: 7.866 mi (12.659 km)	(102) Direction of Traffic [B.RT.03]: 1 1-way traffic
(019) Detour Length [B.H.17]: 1 mi (2 km)	SCDOT Route Type: 4
	Evac Route: 0

Clearances

(28A) Lanes On Structure:	4	(622) Railroad Service Type [B.RR.01]:	
(28B) Lanes Under Structure:	6	(574) Railroad Min. Vert. Clearance:	
(053) Min. Vertical Clearance Over Bridge [B.H.13]:	99.99	(575) Railroad Min. Horiz. Offset:	
(054A) Under Vertical Clearance Ref. [B.H.13]:	H Hwy beneath struct	(038) Navigable Waterway [B.N.01]:	NA-no waterway
(055A) Under Horizontal Clearance Ref. [B.H.15&14]:	H Hwy beneath struct	(039) Navigation Min Vertical Clearance [B.N.02]:	0.00
(54B) Minimum Vertical Underclearance [B.H.13]:	17.42	(116) Movable Br. Max. Nav. Vert. Clearance [B.N.03]:	0.00
(055B) Minimum Lateral Underclearance R [B.H.15]:	13.50	(040) Navigation Channel Width [B.N.04]:	0.00
(056) Minimum Lateral Underclearance L [B.H.14]:	18.25	(631) Nav. Channel Min. Horiz. Clearance [B.N.05]:	0.00
(010) Wide Load Clearance Vertical:	99.99	(111) Substructure Nav. Protection [B.N.06]:	
(047) Wide Load Clearance Horizontal [B.H.16]:	64.00		



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

See Inspection > Clearances Page for additional values, OSOW measurements, and notes.

Classification

(026) Funct Class [B.N. 01&02]:	12 Urban Fwy/Expwy	(109) Pct Trucks [B.H.10]:	5%
(104) NHS:	1 On the NHS	(030) ADT Year [B.H.11]:	2023
(100) Defense Hwy:	0 Not a STRAHNET hwy	(114) Future ADT:	64,881
(029) ADT [B.H.09]:	22,450 Cars/Day	(115) Year Of Future ADT:	2043



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

OTHER BRIDGE DATA

(42A) Type Of Service On [B.F.01]:	6 2d level interchg	(506) Signs/Utilities attached:	N - Nothing Attached
(42B) Type Of Service Under [B.F.02]:	1 Highway	(630) Fatigue Details [B.IR.02]:	No E/E' details
(027) Year Built [B.W.01]:	2002	(507) Damaged Deck:	N - No Damage
(106) Year Reconstructed [B.W.02]:	0	(508) Damaged Superstructure:	Y2 - Exist Dm Same Cond
(319) Paint Date:		(509) Damaged Substructure:	N - No Damage
(037) History [B.CL.04]:	5 Not eligible for NRHP	(510) Damaged Culvert:	N - No Damage
(112) NBIS Structure Length:	Y Long Enough		
Status of Consultant Repair Recommendations:	No Repair Recommendation	(502) Bent or Barrel Direction:	3 - East to West
		(503) Date of Inventory Photos:	10/07/2024
		(504) Asset ID Placard Location:	Bent 1 (NE Corner)
		(505) Stream Flow Direction:	N/A

CURB REVEAL MEASUREMENTS

No Curb:	Yes	Hidden Curb:	No
Curb Reveal Beginning Left (in):		Curb Reveal Beginning Right (in):	
Curb Reveal End Left (in):		Curb Reveal End Right (in):	

CULVERT FILL INVENTORY

Not a Culvert (N/A):	Yes	Max Fill (ft):	
Culvert Inlet (ft):		Culvert Outlet (ft):	
Edge of Roadway on Inlet Side of Road (ft):		Edge of Roadway on Outlet Side of Road (ft):	

ELEMENT CONDITION SUMMARY

Elm/Env	Description	Total Qty	% in 1	Qty. St. 1	% in 2	Qty. St. 2	% in 3	Qty. St. 3	% in 4	Qty. St. 4
12/3	Re Concrete Deck	14,423	100%	14,423	0%	0	0%	0	0%	0
109/3	Pre Opn Conc Girder/Beam	1,720	100%	1,719	0%	0	0%	1	0%	0
1080/3	Delamination/Spall/Patched Area	1	0%	0	0%	0	100%	1	0%	0
205/3	Re Conc Column	3	100%	3	0%	0	0%	0	0%	0
215/4	Re Conc Abutment	136	66%	90	34%	46	0%	0	0%	0
1120/4	Efflorescence/Rust Staining	46	0%	0	100%	46	0%	0	0%	0
234/3	Re Conc Pier Cap	66	88%	58	12%	8	0%	0	0%	0
1120/3	Efflorescence/Rust Staining	8	0%	0	100%	8	0%	0	0%	0
302/3	Compressn Joint Seal	128	43%	55	39%	50	2%	3	16%	20
2320/3	Seal Adhesion	23	0%	0	0%	0	13%	3	87%	20
2350/3	Debris Impaction	50	0%	0	100%	50	0%	0	0%	0
310/3	Elastomeric Bearing	32	100%	32	0%	0	0%	0	0%	0
321/3	Re Conc Approach Slab	2,560	100%	2,560	0%	0	0%	0	0%	0
510/3	Wearing Surfaces	2,560	100%	2,560	0%	0	0%	0	0%	0
331/3	Re Conc Bridge Railing	430	75%	322	25%	108	0%	0	0%	0
1120/3	Efflorescence/Rust Staining	108	0%	0	100%	108	0%	0	0%	0



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

ELEMENT NOTES

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
12/3	Re Concrete Deck	14,423	ft ²	14,423	0	0	0
(2) Spans (Span 1 at 107ft 7-3/16in L, Span 2 at 107ft 4-13/16in L) for a total length of 215ft; Reinforced Concrete Deck (67ft-1in W x 8-1/4in thick) with SIP forms. Top of Deck: No significant deficiencies were noted at the time of inspection. Underside of Deck: No significant deficiencies were noted at the time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
109/3	Pre Opn Conc Girder/Beam	1,720	ft	1,719	0	1	0
(8) (AASHTO Type VI) Prestressed Concrete Girders (6ft H x 2ft-4in W at bottom x 3ft-6in W at top) per span. BM1-1 at midspan, South face of bottom flange, spall (8in L x 6in W x 1in deep). [1080, CS3, Q1]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1080/3	Delamination/Spall/Patched Area	1	ft	0	0	1	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
205/3	Re Conc Column	3	each	3	0	0	0
(1) Interior Bent with (3) Reinforced Concrete Columns (3ft-6in diameter) per bent. No significant deficiencies were noted at the time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
215/4	Re Conc Abutment	136	ft	90	46	0	0
(2) Stub End Bents with Reinforced Concrete Caps (67ft 6-3/8in L x 4ft-1in W x 7ft-3in H) on (34) Prestressed Concrete Piles (18in x 18in) concealed by Reinforced Concrete slope protection. Both end bents, along caps, vertical cracks (up to FH x up to 1/32in W) with efflorescence, up to (2-3) per bay. [1120, CS2, Q46]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/4	Efflorescence/Rust Staining	46	ft	0	46	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
234/3	Re Conc Pier Cap	66	ft	58	8	0	0
(1) Interior Bent with Reinforced Concrete Hammerhead Caps (66ft L x 4ft-6in W x 3ft H). BT2 Cap, both faces, vertical cracks (up to FH x up to 0.012in W) with efflorescence. [1120, CS2, Q8]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	8	ft	0	8	0	0



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
302/3	Compressn Joint Seal	128	ft	55	50	3	20
(2) Compression Joint Seal Joints (64ft L) at End Bents. Throughout JT1, debris accumulation (50ft total). [2350, CS2, Q44] JT1, beginning at South edge of ramp lane, loss of adhesion (20ft L x full depth). [2320, CS4, Q20] JT3, at center, loss of adhesion (3ft L x partial depth) with settlement (up to 1-1/2in). [2320, CS3, Q3]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2320/3	Seal Adhesion	23	ft	0	0	3	20
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
2350/3	Debris Impaction	50	ft	0	50	0	0
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
310/3	Elastomeric Bearing	32	each	32	0	0	0
(32) Elastomeric bearing pads with metal plates; (16) per interior bent and (8) per end bent. No significant deficiencies were noted at the time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
321/3	Re Conc Approach Slab	2,560	ft ²	2,560	0	0	0
(2) Reinforced Concrete Approach Slabs (20ft L x 64ft W x 12in thick). No significant deficiencies were noted at the time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
510/3	Wearing Surfaces	2,560	ft ²	2,560	0	0	0
Asphalt Wearing Surface (20ft L x 64ft W x 2in thick). No significant deficiencies were noted at the time of inspection.							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
331/3	Re Conc Bridge Railing	430	ft	322	108	0	0
(2) Reinforced Concrete Bridge Rails (2ft-8in H x 1ft-5in W). Throughout all spans, both rails, spaced 4ft apart, vertical cracks (FH x up to 1/32in W) with efflorescence. [1120, CS2, Q108]							
ELEM/ENV	ELEMENT NAME	QUANTITY	UNITS	QTY ST 1	QTY ST 2	QTY ST 3	QTY ST 4
1120/3	Efflorescence/Rust Staining	108	ft	0	108	0	0



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

SECTION 4: NON-ELEMENT INSPECTION NOTES

Miscellaneous Notes

N/A

Traffic Signs

(2) delineator signs at West approach corners.

Encroachments

N/A

Waterway and Channel

N/A

Approach Roadway Condition

N/A

Fender System

N/A

Median and Other Barriers

36A - 1: Reinforced Concrete Bridge Rails (2ft-8in H x 1ft-5in W)

36B - 1: Metal Thrie-Beam Transitions with Metal Posts

36C - 1: "W" beam railing with steel posts on approaches

36D - N: Termination ends greater than 75 ft away from structure

No significant deficiencies were noted at the time of inspection.

Under Bridge Railings/Barriers

W-Beam Rails along the roadway at End Bent 1 and 3.

W-Beam Rails along both faces of Bent 2.

No significant deficiencies were noted at the time of inspection.

Curbs and Sidewalks

N/A

Drainage System

(6) Weep holes at each End Bents 1 and 3.

Diaphragms

Reinforced Concrete End and Intermediate Diaphragms.

BT2, West face, Bay 5 end diaphragm, adjacent to BM2-6, delamination (up to 10in L x 1ft-4in W).

Wingwalls

(4) Reinforced Concrete Wingwalls at all corners.

No significant deficiencies were noted at the time of inspection.

(623) Summary of Previously Performed Maintenance Work [B.W.03]

N/A

INSPECTION PHOTOS



Photo 1:
East Approach Looking West



Photo 2:
West Approach Looking East



Photo 3:
Backstation (East Approach Looking East)



Photo 4:
Upstation (West Approach Looking West)

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136



Photo 5:
North Profile Looking South



Photo 6:
South Profile Looking North

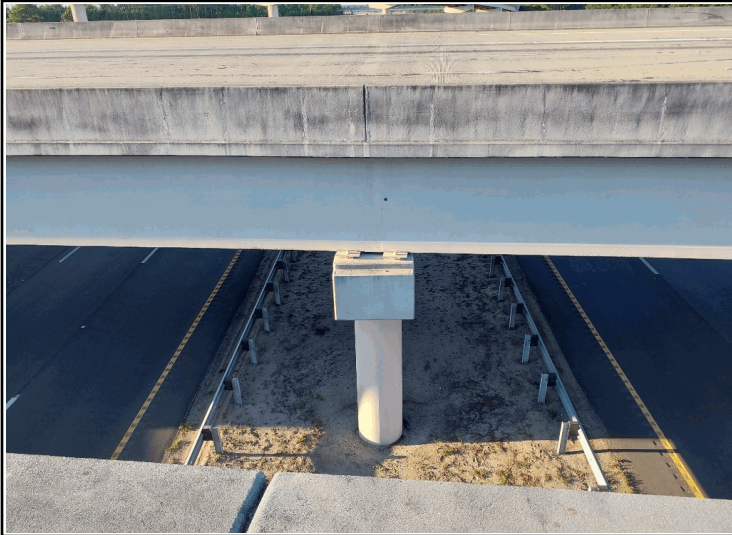


Photo 7:
Feature Intersected (Looking North)



Photo 8:
Feature Intersected (Looking South)

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136



Photo 9:
Asset ID Plaque at Bent 1 (NE Corner)



Photo 10:
Typical Rail Transition (Southwest Shown)



Photo 11:
Typical Bridge Rail (North Shown)



Photo 12:
Concrete Bridge Deck

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136



Photo 13:
Typical Compression Joint (End Bent 1 Shown)



Photo 14:
Typical Superstructure (Span 1 Shown)



Photo 15:
Typical Reinforced Concrete End Diaphragms with Shear Key



Photo 16:
Beams Over Bent

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136



Photo 17:
Typical Elastomeric Bearings



Photo 18:
Typical End Bent (End Bent 1 Shown)



Photo 19:
Interior Bent 2



Photo 20:
Looking West on SC 22 (Span 1)

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136



Photo 21:
Looking East on SC 22 (Span 2)



Photo 22:
Typical Wingwall (Southwest Shown)



Photo 23:
BM 1-1, South face of bottom flange, at midspan, spall (8in L x 6in W x 1in deep)



Photo 24:
Both end bents, along caps, vertical cracks (up to FH x up to 1/32in W) with efflorescence, up to (2-3) per bay. (EB1, below BM1-4 shown)



Photo 25:

JT1, beginning at South edge of ramp lane, loss of adhesion (20ft L x full depth).



Photo 26:

Throughout JT1, debris accumulation (50ft total).



Photo 27:

JT3, at center, loss of adhesion (3ft L x partial depth) with settlement (up to 1-1/2in).



Photo 28:

Throughout all spans, both rails, spaced 4ft apart, vertical cracks (FH x up to 1/32in W) with efflorescence.

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

**Photo 29:**

BT2, West face, Bay 5 end diaphragm, adjacent to BM2-6, delamination (up to 10in L x 1ft-4in W).



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

INSPECTION SKETCHES

Note: Not all bridge inspections have sketches. If no sketches are linked to this report. The image below will read: "Unable to locate graphic."

Unable to locate graphic.

STREAMBED CROSS SECTIONS

Orientation:
Offset Remark:
Elev Basis:
Water Surface:
SND/ELEV Ind.:

Snding Date: /
Location of BM:
Offset:

Streambed Details

Stations	SND/ELEV	Remarks
----------	----------	---------



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

SCOUR AND WATERWAY

Request Scour Evaluation: No Request Waterway Adequacy: No

Request Scour Evaluation Reason:

Request Waterway Adequacy Evaluation Reason:

Inspection Information

Streambed Information

(511) Bridge Over Tidal Waterway: No
(512) Tide Status During Inspection:
(513) Time During Tidal Inspection:
(517) Max Water Depth at Bent (ft) 0.0
(518) Dry Channel: Yes

(519) Water Level: N/A
(520) Debris Buildup: N/A
(521) Bed Deposits Downstream: N/A
(522) Up/Dwnstrm Ch. Stab.: N/A
(523) Riprap (if any) Displaced: N/A (No Riprap)
(524) Structure on a Channel Change: N/A
(525) Stream Aggradation or Degradation: N/A
(526) Lateral Movement of Stream: N/A
(527) Lakes, dams near the bridge? No Feature

Evidence of Scour

Underwater Bridge Inspection Only

(534) SSU's Inspected:

(528) Scour Holes at End Bents: No
(529) Scour Holes at Bents: No
(530) Scour Holes at Culvert Inlet: No
(531) Scour Holes at Culvert Outlet: No
(532) Footing Exposed: No
(533) Bank Soil Material Washing Out: No

(535) ADCI Dive Supervisor:
(536) ADCI Tender/Diver(s):

Scour Condition, POA and Vulnerability

(442A) Scour Plan of Action Followed: No
(442B) POA Category 1:
(442C) POA Category 2:
(450) Scour Risk Bin:
(451) Monitoring / Scour Risk Bin:

(537) Water Temperature:
(538) Visibility:
(539) Flow Velocity:

BRIDGE MAINTENANCE OFFICE FIELDS

(099) Border Bridge Structure Number:	(SBI) Bridge with Complex Feature:	0
(098) Border Bridge % Responsible:	(312) Responsible District:	5
(98A) Border Bridge FHWA Region:	(311) Responsible County:	26
(98A) Border Bridge State:	(439) Asset Management:	0
(101) Parallel Structure: Right of bridge	(412) Critical Security bridge (CSB):	No
(103) Temporary Structure:	(SBI) Topside Inspection Category:	SD4
(422) Date of Temporary Structure:	(SBI) Underwater Inspection Category:	
(SBI) Island Mobility Bridge: No		

JOINT

Bent Number	Joint Type	Joint Opening at Left Gutter	Joint Opening at Centerline Road	Joint Opening at Right Gutter

Notes:



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

BEARINGS						
Bent #	Bearing #	Bearing Type	Rotational movt. (°)	Longitudinal movt. (in)	Transverse movt. (in)	Vertical movt. (in)
Notes:						

PILES							
Bent #	Pile #	Pile Material	Splice	Stud-Up	Pile % Rem	Pile Marked	Pile Size / Thickness
Notes:							



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

PROCEDURES FOR THIS INSPECTION

Done	Insp Type	Procedure Type	Procedure Name	Details
S	Routine	Routine (Typical)	Inspection: Timber Sounding	Sound full length of exposed timber piles (including through bolts) per BIGD 5.3.3.1 and 5.3.3.2.1.
R	Routine	Routine (Typical)	Inspection: Defect Photos	Any NBE (element) with CS3 or CS4 Any deterioration causing an NBE (element) to have a CS3 or CS 4 documented with a photograph. Per BIGD 5.4.4.2.
R	Routine	Routine (Typical)	Post-Inspection: Requests	Confirm that all Inspection Requests are included as both scheduled inspections in the Schedule Table and the Requests Table when needed. Confirm requests include Load Rating (if needed) (NBI GCR 7 to 5 or NBI GCR to 4, Element CS4, etc.). Confirm requests include Hydraulic Appraisal (if needed) (NBI 071 and NBI 113). Confirm requests include UW (Unscheduled) (Water Depth 4' or more at Bent).
S	Routine	Routine (Typical)	Inspection: Posting Photos	Photographs of at bridge and advance (if present) posting or weight limit signs are required to be taken during all routine inspections. These requirements are applicable to the posting or weight limit signs at the bridge and in advance of the bridge which could require many signs to be photographed. These signs include R-12-6-48 and R-12-7-48 (legal loads), and R-12-9-36 (EV weight limit) at both ends of the bridge. Per BIGD 5.4.4.2 (TN03).



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

(7) Facility Carried: SC 31 NB

Inspection Date: 10/07/2024

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

R	Routine	Routine (Typical)	Post-Inspection: Data Verification	Verify the correct: 1) Traffic Status (NBI 041), 2) Inspection Intervals (NBI 090 to 093), 3) Bridge Condition (NBI 58, 59, 60 or 62), 4) Rating Values (NBI 064 and 066), and 5) Sign Posting Values (SBI 443 to 448 and 889).
S	Routine	Routine (Typical)	Inspection: Pile Sketch	Pile Sketch Table required when NBI Item 60 Condition Rating = 5. Per BIGD 5.3.3.1 and 5.4.4.5.

Inspector Procedure Notes
Substructure rating greater than 5, No Pile sketch needed; No exposed timber piles; Bridge is not posted

EQUIPMENT USED IN THIS INSPECTION

<u>Name</u>	<u>Hours</u>	<u>Cost</u>
<u>Inspector Equipment Notes</u>		



Bridge Inspection Report

09967

Team Leader: Emmanuel Cooper

Inspection Date: 10/07/2024

(7) Facility Carried: SC 31 NB

(6) Crossing: SC 22

Inspection Type(s): Routine

(16) Latitude: 33.810972 (17) Longitude: -78.780136

INSPECTOR SIGNATURE AND QC/QA INFORMATION

INSPECTED BY Emmanuel Cooper

Date 10/7/2024

QC Reviewed By: Ramesh Mishra QC Completed: 11/27/2024

QA Reviewed By: QA Completed: