



Bridge Inspection Report

180610008113133

IH 35W NBML

over

KSC Railroad



Inspection Date: 02/15/2025

Inspected By: Srinteg Corporation [F-20066]

Jason Barnett (Team Leader)

Donald Cartwright, PE

Inspection Type(s): Routine

TABLE OF CONTENTS

	PAGE NUMBER
LOCATION MAP	1
BRIDGE INSPECTION FOLLOW-UP ACTION	2
BRIDGE INSPECTION RECORD (1085)	4
BRIDGE INVENTORY RECORD	7
UNDERCLEARANCE RECORD	8
ELEMENTS	9
PICTURES	10

Inspector: Barnett, Jason

Inspection Date: 02/15/2025

Parent Contract: 88-2IDP5044- Srinteg Corporation-RT




Bridge Inspection Report

Structure Number: 180610008113133

Facility Carried: IH 35W NBML

Features Intersected: KSC Railroad

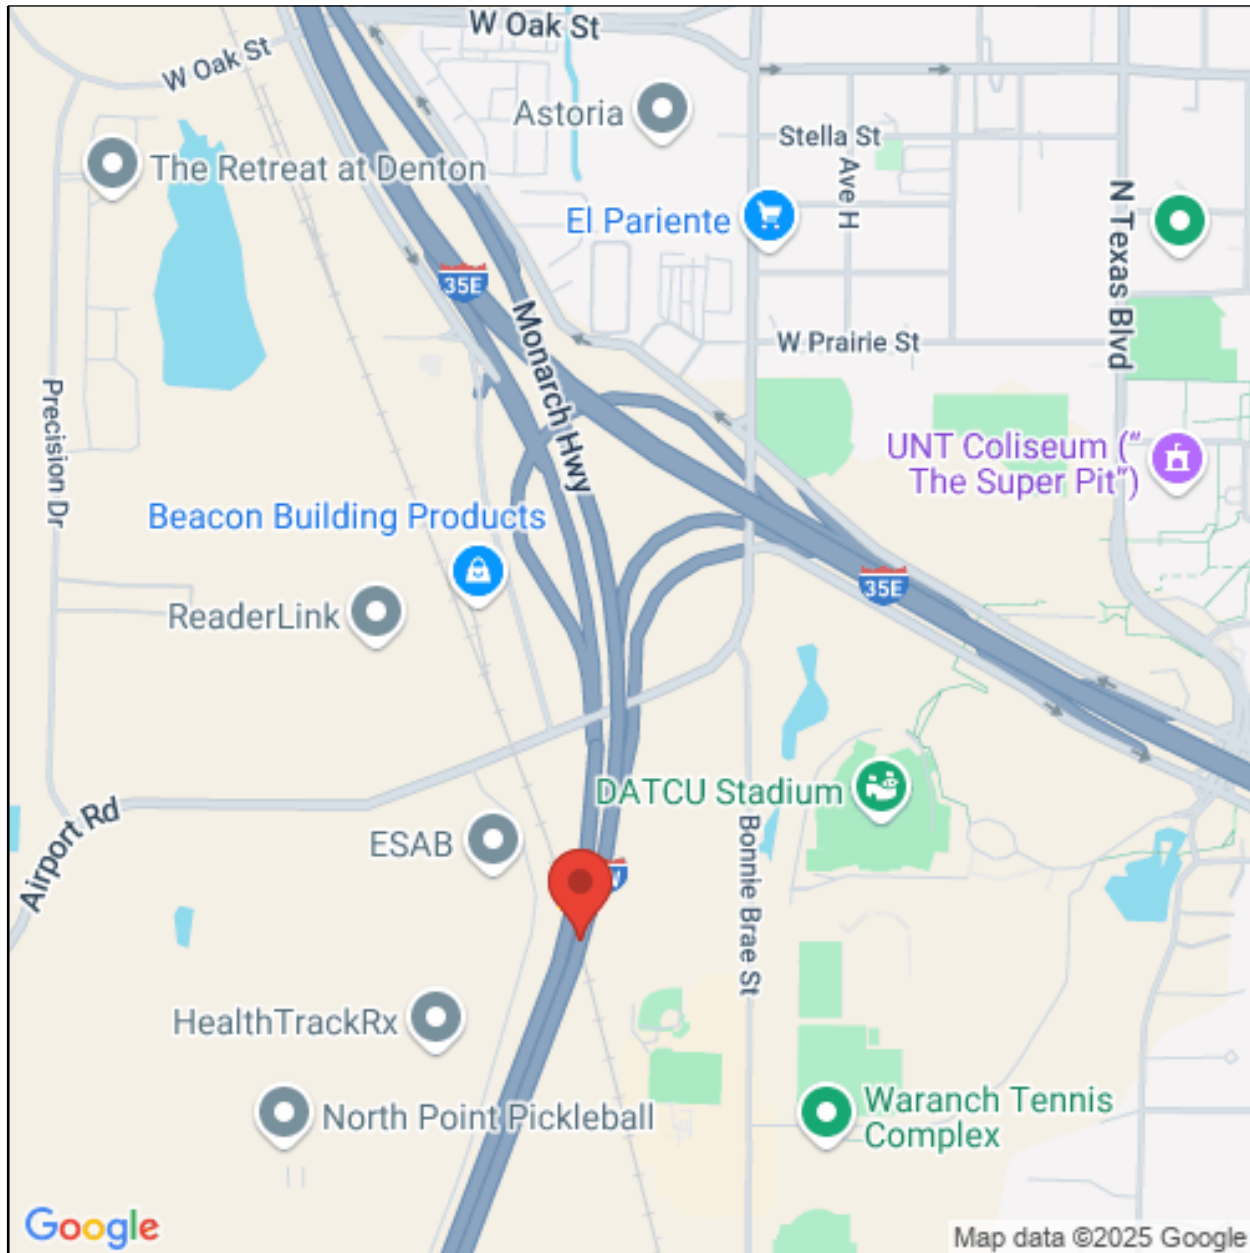

Latitude: 33.20223231

Longitude: -97.16439765

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Bridge Inspection Follow-Up Action

FUA ID 556781

Location Information

Bridge ID# 180610008113133 Latitude 33.20223231 Longitude -97.16439765
County 061-DENTON Location 0.10 MI S OF FM 1515
Facility Carried IH 35W NBML Feature Crossed KSC Railroad

Ownership/Responsibility

District DAL Area Office Denton Co Maintenance Section 04
System Designation 1 Control - Section 0081 - 13 Bridge Owner TxDOT Precinct

Issue Information

Inspection Date 02/15/2025 Priority Level: Level 4 Critical Finding? N Previously Recommended? Y
Bridge Component Superstructure Repair Category Repair Diaphragm Other:

Description of Issue and Recommendation

2023: Several nuts are missing at diaphragm connections.

2025 Update: Nuts are missing at multiple diaphragm connections.

Recommendation: Replace missing nuts and washers at diaphragm connections.

District Bridge Office Comments

District Area or Assigned Maintenance Office Comments

District Bridge is reviewing multiple bridges along IH35W for repairs. Will review this location to determine if repairs can be handled in house or with a future contract by August 2025.

Follow-up Action Resolution Comments

+Optional Fields

Work to be Completed Via: +Project Status: Design Phase +District Estimated Letting Date: August 2025
+District Proposed Funding Source: +CSJ / WO / Project ID:
Action Taken: Date Verified By
+Additional Comments if Necessary:

CRITICAL FINDING FOLLOW UP INFORMATION (BLANK IF FOLLOW UP ACTION IS NOT A CRITICAL FINDING)

Condition Rating (Affected elements only) New Load Rating / Analysis Required? Overall Recommendation:
Date Bridge Owner notified of Critical Finding: Bridge Owner Rep: Co-Inspection Date w/ Bridge Owner:
TxDOT Inspector: Concur with findings: Critical Finding Temp Measures Taken:

Tracking Comments:
Description of completed, temporary and/or planned corrective actions to address critical finding, updated at least monthly.

Critical Finding Resolution:

Target Date to Resolve Critical Finding: Critical Finding Resolved Date:
TxDOT Inspector:

Inspector: Robert Pearson

Structure Number: 180610008113133

Inspection Date:

Facility Carried:

Bridge Inspection Report

Pictures



PHOTO 1 Recommended Maintenance Needs, Defect

Description Missing diaphragm nut on exterior face of Beam 1 in Span 7 near Abutment 8, looking east.
(Condition Rating: 7)



BRIDGE INSPECTION RECORD

Structure Number
Facility Carried
Feature Intersected

180610008113133
IH 35W NBML
KSC Railroad

Inspector
Inspection Date
Maint. Section

Barnett, Jason
02/15/2025
04

Condition Rating	Description*
N	Not Applicable
9	Excellent Condition
8	Very Good Condition - no problems noted
7	Good Condition - some minor problems
6	Satisfactory Condition - minor deterioration of structural elements (limited)
5	Fair Condition - minor deterioration of structural elements (extensive)
4	Poor Condition - deterioration significantly affects structural capacity
3	Serious Condition - deterioration seriously affects structural capacity, local failures possible
2	Critical Condition - advance deterioration of primary elements, bridge should be closed until repaired
1	Failing Condition - bridge closed but repairable
0	Failed Condition - bridge closed and beyond repair

*These descriptions are for items 58, 59, 60 and 65. Code Items 61 and 62 according to the TxDOT Coding Guide.

Bridge Description:

7 simple span prestressed concrete I-beam bridge on concrete supports (variable skew)

Seal:

Signature & Date:

Prime Firm Name & Number:

Sub Firm Name & Number:

General Comments:

Nomenclature is from south to north as per the bridge plans.

DECK (ITEM 58)

Structure ID: 180610008113133

Inspection Date:

02/15/2025

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Deck - Component Rating		1	7	
Wearing Surface	~2" Asphalt	6	7	The deck underside exhibits isolated insignificant transverse cracks with isolated light efflorescence and isolated minor honeycombing. Deck overhang soffits exhibit minor spalls at bents and at the southwest bridge corner. Spans have shifted laterally up to 1/2" along joints. Asphalt wearing surface has minor to moderate wear. The asphalt wearing surface exhibits up to 1/8" wide transverse cracks and isolated up to 6" wide by full depth potholes over the full width of the bridge at deck joints.
Surfacing Thickness:	2 inches			
Fill Height:	inches			
Joints, Expansion, Open		6	N	
Joints, Expansion, Sealed		6	7	Deck joints are paved over. Visible portions of the deck joints have missing seals.
Joints, Other		6	N	
Drainage System		6	8	
Curbs, Sidewalk & Parapets		6	N	
Median Barrier		6	N	
Railings		6	7	Concrete bridge railings have medium (<1/32" wide) transverse cracks.
Railing Type:	SSTR			
Railing Protective Coating		7	N	
Delineation		7	N	
Other		-	N	

SUPERSTRUCTURE (ITEM 59)

Structure ID: 180610008113133

Inspection Date:

02/15/2025

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Main Members - Steel		0	N	
Main Members - Concrete		0	7	Beam ends exhibit isolated minor spalls, some with exposed reinforcement.

Beam 1 in Span 1 exhibits several shallow impact spalls and scrapes. Beam 4 in Span 1 has a minor spall with exposed reinforcement in the east face of the bottom flange at the abutment.

Main Members - Timber	0	N
Main Members - Connections	0	N
Floor System Members	1	N
Floor System Connections	1	N
Secondary Members	5	8
Secondary Mem. Connections	5	7
Expansion Bearings	6	8
Fixed Bearings	6	8
Steel Protective Coating	6	N
Other	-	N

Nuts are missing at multiple diaphragm connections.

Overall Component Rating	7
---------------------------------	----------

SUBSTRUCTURE (ITEM 60)

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Abutment Caps		0	7	Abutment caps exhibit isolated insignificant vertical cracks and minor delaminations. There is a full width by 18" high by 6" deep spall in the west end of the Abutment 8 cap, and a similar, but less significant, spall is present in the west end of the Abutment 1 cap.
Above Ground		0	N	
Below Ground or Foundation		0	8	
Backwalls & Wingwalls		0	6	Backwalls exhibit insignificant to medium (<1/32" wide) vertical and diagonal cracks, some with light efflorescence. The backwalls also have several up to 1/8" wide vertical and diagonal cracks with light to moderate efflorescence and light rust staining, and minor to moderate delaminations at the wingwall connections. The wingwalls exhibit insignificant diagonal cracks with light efflorescence.
Intermediate Supports:				
Caps - Concrete		-	7	Bent caps exhibit isolated insignificant flexural cracks near midspan between columns and isolated minor delaminations and spalls with exposed reinforcement.
Caps - Steel		-	N	
Caps - Timber		-	N	
Above Ground - Concrete		-	7	Columns at Bents 2, 3, 4, and 7 exhibit isolated insignificant to medium (<1/32" wide) horizontal cracks. Column 4 at Bent 5 exhibits minor honeycombing and a moderate (15" wide by 12" high by 1 1/2" deep) honeycomb/spall with exposed and corroded reinforcement near the base. Column 2 at Bent 6 exhibits a 30" wide by 6" high by 1" deep spall with exposed reinforcement at the top.
Above Ground - Steel		-	N	
Above Ground - Timber		-	N	
Above Ground - Masonry		-	N	
Below Ground or Foundation		-	8	
Collision Protection System		5	N	
Steel Protective Coating		6	N	
Overall Component Rating			6	

CHANNEL (ITEM 61)

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Channel Banks		0	N	
Channel Bed		0	N	
Rip Rap, Toe Walls & Apron		5	N	
Dikes		5	N	
Jetties		5	N	
Other		-	N	
Overall Component Rating			N	

CULVERTS (ITEM 62)

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
-----------	-------------	------	--------	---------

Top Slabs	0	N
Bottom Slab or Footing	0	N
Abutments, Intermed. Supports	0	N
Headwalls & WingWalls	5	N
Other	-	N

Overall Component Rating	N
---------------------------------	----------

APPROACHES (ITEM 65)

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Embankments		0	7	The edges of the concrete rip rap are exposed up to 6" high and the rip rap have settled up to 6" along the wingwalls.
Embankment Retaining Walls		4	N	
Slope Protection		5	7	See Embankments comment. The rip rap slopes exhibit up to 1/16" wide random cracks, minor spalls, and minor settlement along joints. There are several up to 3' long fractured portions of the rip rap curbs.
Roadway		5	7	Asphalt approach roadways have minor to moderate wear. Up to 1/8" wide by full width transverse cracks are present in the asphalt approach roadways at the relief joints.
Relief Joints		6	8	
Drainage		6	8	
Guardfence		6	7	The northeast corner approach guardfence has minor impact damage at the transition.
Delineation		7	8	
Sight Distance		7	8	
Other		-	N	
Overall Component Rating			7	

MISCELLANEOUS

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Signs		N	N	
Illumination		N	N	
Warning Devices		N	N	
Utility Lines		7	N	
Other		N	N	

APPRAISAL RATINGS

Structure ID: 180610008113133 Inspection Date: 02/15/2025
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

TRAFFIC SAFETY FEATURES (ITEM 36)		Rating		Comment
0 - Does not meet current standards	Bridge Rails:	1	SSTR	
1 - Meets current standards	Transitions:	1	Thrie Beam	
N - Not applicable	Appr. Rails:	1	MBGF	
	Appr. Rail Ends:	1	Continuous	
WATERWAY ADEQUACY (ITEM 71)		N		
APPROACH ROADWAY ALIGNMENT (ITEM 72)		8	Regulatory / Advisory Speeds: 70 mph / 70 mph	



BRIDGE INVENTORY RECORD

Structure Number	180610008113133	Inspector	Barnett, Jason
Facility Carried	IH 35W NBML	Inspection Date	02/15/2025
Feature Intersected	KSC Railroad	Maint. Section	04

District	18-Dallas	County	061-DENTON	Latitude	33.20223231
Milepoint	84.446	System	1 - On System	Longitude	-97.16439765
General Description: 7 simple span prestressed concrete I-beam bridge on concrete supports (variable skew)					
Bridge Length (ft.)	435	Deck Width (ft.)	34.9		
Skew Angle (degrees)	99	Clear Width Between (ft.)	32.5		
Right / Left Forward	Left Forward	Measurement Feature	Rails		
Vertical Over-Clearance	99.99	☒ Unimpaired Over-Clearance			
Surfacing Type	~2" Asphalt	Deck Type	1 - Concrete Cast-in-Place		
Lanes On	02	Lanes Under	00		
Bridge Rail	36" SSTR	Approach Roadway Width (ft.)	32.5		
Seal:					
Signature & Date:					
Prime Firm Name & Number:					
Sub Firm Name & Number:					

Superstructure:	Spans	1 through 3 and 5 through 7			
Main:	Type	Prestressed Concrete Beams	Size	Type C	Number 5
	Spacing	See Plans	Controlling Span Length (C-C bearings)	75.8	
Superstructure:	Spans	4			
Major Approach:	Type	Prestressed Concrete Beams	Size	Type C	Number 5
	Spacing	See Plans	Controlling Span Length (C-C bearings)	51.8	
Superstructure:	Spans	N/A			
Minor Approach:	Type		Size		Number
	Spacing		Controlling Span Length (C-C bearings)		

Estimated Deck Overtopping Frequency	Comments:
Estimated Approach Overtopping Frequency	
Horizontal / Vertical Alignment	Good / Good
Regulatory / Advisory Speeds	70 mph / 70 mph
Year Built 1970	Year(s) Widened
Posted Load Restriction	NNN ☒ No Restriction
Design Load	5 - HS 20 (Also used for plans with MS 18 and H 20-S16)
Design Method	LFD

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.




Underclearance Record

Form 2601
(03/16)
Page 1 of 1

02/15/2025 - Strintec Corporation [F-20066] - No change - *Jason Barnett*

District: 18 County: 061 Control-Section: 0081 - 13 Structure: 133 Route: IH 35W NB ML
Feature Crossed: KSC RR Inspector's Signature: *[Signature]* Date: 2/22/2021
Company Name: WPS Engineering, LLC (F-7158)

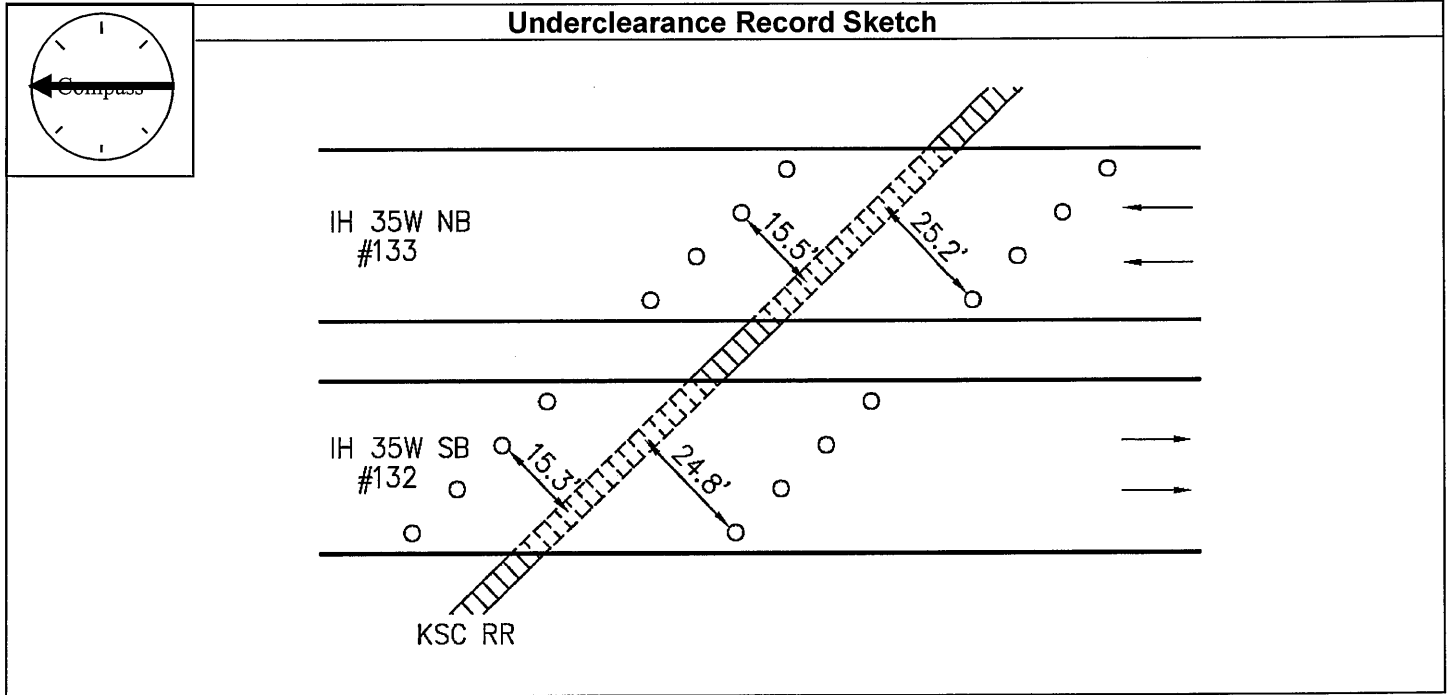

Controlling Item No.: 54.2 - Min. Vertical Clearance 10 or 10A - Max. 10' Wide Vertical Clearance 55.2 - Right Lateral Clearance 56 - Left Lateral Clearance 47 or 47A - Total Horizontal Clearance

Reference Features:
A. Beam C. Cap E. Guard fence G. Pole I. Toe of >3:1 Slope K. Middle of Yellow Stripe M. Centerline of Railroad
B. Slab D. Railing F. Column H. Curb J. Barrier L. Middle of White Stripe N. _____

Feature Xed →	KSC RR											
PSN: 0081-13-133	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.
Right Lateral Clearance	15.5'	M - F	55.2									
Left Lateral Clearance	-	-	-									
Total Horizontal Clr	-	-	-									
Max Practical Vert Clr	-	-	-									
Min Measured Vert Clr	-	-	-									
Signed Vertical Clr	-	Tolerance			Tolerance			Tolerance			Tolerance	

PSN: 0081-13-132	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.	Field Data	Refer.	Item No.
Right Lateral Clearance	15.3'	M - F	55.2									
Left Lateral Clearance	-	-	-									
Total Horizontal Clr	-	-	-									
Max Practical Vert Clr	-	-	-									
Min Measured Vert Clr	-	-	-									
Signed Vertical Clr	-	Tolerance			Tolerance			Tolerance			Tolerance	

PSN = Permanent Structure Number DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: Barnett,Jason

Inspection Date: 02/15/2025

Parent Contract: 88-2IDP5044- Srinteg Corporation-RT



Structure Number: 180610008113133

Facility Carried: IH 35W NBML

Features Intersected: KSC Railroad

	Environment	Total Quantity	Units	Condition State 1	Condition State 2	Condition State 3	Condition State 4
12-Reinforced Concrete Deck	3 - Mod.	15182	sq. ft.	15022	160	0	0
1080-Delamination/Spall/Patched Area		10		0	10	0	0
1120-Efflorescence/Rust Staining		150		0	150	0	0
109-Prestressed Concrete Open Girder/Beam	3 - Mod.	2175	ft.	2152	23	0	0
1080-Delamination/Spall/Patched Area		20		0	20	0	0
1090-Exposed Rebar		3		0	3	0	0
205-Reinforced Concrete Column	3 - Mod.	22	each	11	9	2	0
1080-Delamination/Spall/Patched Area		1		0	0	1	0
1090-Exposed Rebar		1		0	0	1	0
1130-Cracking (RC and Other)		9		0	9	0	0
215-Reinforced Concrete Abutment	3 - Mod.	125	ft.	98	25	2	0
1080-Delamination/Spall/Patched Area		7		0	5	2	0
1120-Efflorescence/Rust Staining		20		0	20	0	0
234-Reinforced Concrete Pier Cap	3 - Mod.	338	ft.	324	14	0	0
1080-Delamination/Spall/Patched Area		10		0	10	0	0
1090-Exposed Rebar		4		0	4	0	0
310-Elastomeric Bearing	3 - Mod.	70	each	70	0	0	0
331-Reinforced Concrete Bridge Railing	3 - Mod.	870	ft.	820	50	0	0
1130-Cracking (RC and Other)		50		0	50	0	0

Inspector: Jason Barnett
Inspection Date: 02/15/2025



Structure Number: 180610008113133
Facility Carried: IH 35W NBML

Pictures



PHOTO 1 Roadway View

Description Roadway view, looking north.



PHOTO 2 Elevation View

Description West bridge elevation, looking southeast.

Inspector: Jason Barnett
Inspection Date: 02/15/2025



Structure Number: 180610008113133
Facility Carried: IH 35W NBML

Pictures



PHOTO 3 Superstructure View

Description Underside of superstructure in Span 2, looking south.



PHOTO 4 Railroad Under View

Description Railroad (KCS) under view in Span 4, looking northwest.

Inspector: Jason Barnett
Inspection Date: 02/15/2025



Structure Number: 180610008113133
Facility Carried: IH 35W NBML

Pictures



PHOTO 5 Recommended Maintenance Needs, Defect

Description Missing diaphragm nut on exterior face of Beam 1 in Span 7 near Abutment 8, looking east.
(Condition Rating: 7)