



Asbestos Demolition Survey

SITE LOCATION: Tauraroa Area School

ISSUED ON: 27 Oct 2022

JOB ID: 4578

JOB REF: Asbestos Demolition Survey

PREPARED FOR: Scope Projects



Consultex
Environmental

Table of Contents

Report Details	3
Totals	3
Introduction	4
Site Images	4
Executive Summary	8
Variations to Scope	8
Summary of Asbestos-Containing Materials	8
High	9
Medium	9
Low	10
Very Low	10
Summary of Non-Asbestos-Containing Materials	10
Summary of Areas or Items of Limited Access or No Access	11
Register	13
Survey Inspection Detail	15
Material and Priority Assessments	17
Appendices	39
Floor Plans	39
Lab Results, Certificates & Evidence	43
Types of Asbestos Survey	46
Class A and Class B Asbestos Meaning	46
Material Assessment Scores	47
Priority Assessment Scores	48
Risk Assessment Scores	50
Asbestos Materials	50

Report Details

Report By	Consultex Environmental
Client	Scope Projects
Project	Asbestos Demolition Survey
Site Address	Tauraroa Area School
Site Location	
Scope of Work	Asbestos demolition survey of Rooms 10-16 and 22-24. The school consists of many buildings which are not within this projects scope of works. The walkway attached to rooms 22-24 will all be removed. This walkway will be removed up to room 20 structure. The walkway adjacent rooms 10-16 will be removed. This walkway is attached to several structures which will remain in situ. Building elements which will be disturbed in their removal is included in this survey scope.
Purpose of Survey	Determine as far as possible the presence of asbestos in all rooms. The rooms will remain in use after the survey and must be safe for occupation.
Surveyors	Daven Illenberger
Survey Dates	9 Oct 2022
QC Date	27 Oct 2022
Issue Date	27 Oct 2022

Surveyed by	Daven K. I. Asbestos Surveyor	
Reviewed by	William Morris-Whyte Principal Consultant	

Totals

An overview of the data collected on site, during the survey

Total Records	Suspect ACM	NAD	Very Low	Low	Medium	High
21	21	8	0	2	8	3

Introduction

This survey was conducted in accordance with following New Zealand's literature the good practice guidelines for asbestos survey's October 2016, Worksafe's Approve code of practice 2016 for managing asbestos and the UK standard HSG 264 (Asbestos: The Survey Guide). Consultex Environmental cannot accept any liability for loss, injury, damage or penalty issues that arise for reasons of survey scope limitations. Consultex Environmental cannot be held responsible for asbestos potentially present in areas of the building not explicitly specified within the client instruction, not indicated on provided site plans or not physically possible to access. Consultex Environmental cannot be held responsible for any damage caused as part of this survey carried out on your behalf. Due to the nature and necessity of sampling for asbestos some damage is unavoidable and will be limited to that necessary for taking of the samples.

Site Images



[R10-11]



[R10-11] Beneath carpet- checked multiple locations beneath 10-11, particle board present.



[R10-11] Gap between rooms



[R10-11] Roof profile



[R10-11] Wallway cover



[R10] Sub floor



[R11] Sub floor



[R12-14] Cement panels used to infill between classrooms - non asbestos cement (modern addition). These panels have been added later to fill gaps between classrooms.



[R12-16] Beneath flooring checked - no ACM identified in R12-16.



[R12-16] Roof profile



[R12-16] Roof profile - vent above room 12 seen



[R12-16] Roof profile- joints between rooms



[R12-16] Roof profile- vent above room 12



[R12-16] Sub floor - area beneath R15-16. No acm observed



[R12-16] Sub floor - evidence of non asbestos panels clad over asbestos



[R12-16] Sub floor - insulation polystyrene and modern fibre products



[R14] Countertop vinyl - non asbestos item



[R16] Inside old chimney collar. No acm observed.



[R22-24] Profile



[R22-24] Roof Profile



[R22-24] Sub floor



[R22-24] Sub floor



[R22/23] Joint between R22 and 23



[R23] Ceiling cavity



[R24] 3 Flooring layers with two layers of modern vinyl



[R24] Ceiling cavity

Executive Summary

Variations to Scope

Where necessary, the surveyor may deviate from the defined scope - see below for additional information.

Notes	Photo
n/a	

Summary of Asbestos-Containing Materials

These suspected materials were assessed as **asbestos-containing**.

High

Building / Level / Location	Item	Material	Material Score	Recommendation	Page
[R10] / 0 - Ground Floor / Inside room	Power box	Power box and systems	12 High	Further investigation required	19
[R12-16] / 0 - Ground Floor / Inside room	Power boxes in R12-16	Power box and systems	12 High	Further investigation required	23
[R24] / 0 - Ground Floor / Inside room	Power board box	Power box and systems	12 High	Further investigation required	33

Medium

Building / Level / Location	Item	Material	Material Score	Recommendation	Page
[R10-11] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	7 Medium	Removal by licensed contractor	18
[R11] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	7 Medium	Prohibit access pending planned works	21
[R12-16] / External / BE2 and 4 Building Envelopes of rooms 12-16	Power boxes between classrooms	Bakelite	7 Medium	Removal by licensed contractor	24
[R12-16] / External / Building Envelope	External Cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	7 Medium	Removal by licensed contractor	25
[R12] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	9 Medium	Removal by licensed contractor	26
[R14] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	8 Medium	Removal by licensed contractor	27
[R16] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	9 Medium	Remove if planned works may disturb	28
[R24] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	7 Medium	Removal by licensed contractor	35

Low

Building / Level / Location	Item	Material	Material Score	Recommendation	Page
[R23-24] / External / BE1,3,4 Building Envelope	Eave panels	Fibre Cement Sheet - Flat Sheet	6 Low	Removal by licensed contractor	31
[R23] / External / Building Envelope (including hidden between R22 and 23)	Cladding of R23	Fibre Cement Sheet - Flat Sheet	6 Low	Removal by licensed contractor	32

Very Low

Building / Level / Location	Item	Material	Material Score	Recommendation	Page
n/a					

Summary of Non-Asbestos-Containing Materials

These suspected materials were assessed as **non-asbestos-containing**.

Building / Level / Location	Item	Material	Page
[R10] / 0 - Ground Floor / Inside room	Roof paper (inside ceiling)	Building paper (bitumen based)	20
[R11] / 0 - Ground Floor / Inside room	Roof paper (inside ceiling)	Building paper (bitumen based)	22
[R22] / External / BE3 Building Envelope (back wall)	Eaves	Fibre Cement Sheet - Flat Sheet	29
[R22] / External / Building Envelope (including hidden between R22 and 23)	Cladding of R22	Fibre Cement Sheet - Flat Sheet	30
[R24] / External / Building Envelope	Bitumen building paper	Building paper (bitumen based)	34
Walkway outside [R10] / External / Stand alone walkway - outside R10	Walkway eave panels	Fibre Cement Sheet - Flat Sheet	36
Walkway outside [R16] / External / Cladding attached to Walkway structure	Cement sheeting cladding which walkway is attached to	Fibre Cement Sheet - Flat Sheet	37

table continued from previous page...

Building / Level / Location	Item	Material	Page
Walkway outside [R22] / External / Walkway outside R22 (attached to R22 and R20)	Walkway eave panels (and supporting cladding structures)	Fibre Cement Sheet - Flat Sheet	38

Summary of Areas or Items of Limited Access or No Access

These areas or items could not be fully accessed during survey. Asbestos should be presumed to be present until a further assessment can be undertaken. Note that the survey scope may exclude other areas - see **Report Details** (p. 3) and **Variations to Scope** (p. 8).

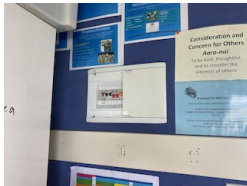
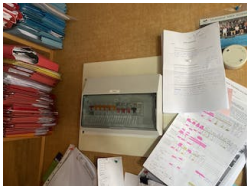
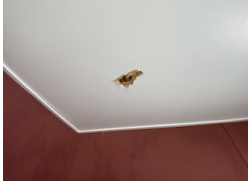
Building / Level / Location	Item	Access / Notes	Photo 1	Photo 2	Page
[R10] / 0 - Ground Floor / Inside room	Power box	No Access / Live Electricity - Inspect following power isolation			19
[R11] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.			21
[R12-16] / 0 - Ground Floor / Inside room	Power boxes in R12-16	No Access / No Access / Live Electricity - Inspect following power isolation			23
[R12] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.			26

table continued from previous page...

Building / Level / Location	Item	Access / Notes	Photo 1	Photo 2	Page
[R14] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.			27
[R16] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.			28
[R24] / 0 - Ground Floor / Inside room	Power board box	No Access / No Access / No Access / Live Electricity - Inspect following power isolation			33

Register

The register contains priority scoring, please see **Priority Assessment Scores (p. 48)** and **Risk Assessment Scores (p. 50)** for further information.

Building / Level / Location	Item	Material	Strategy / Sample Id	Extent	Fibre Type	Friability	Product Type	Extent of Damage	Surface Treatment	Material Score	Priority Score	Recommendation	Page
[R10-11] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	Sample S002	320 sqm	Amosite, Chrysotile and Crocidolite	Class B	1	2	1	7 Medium		Removal by licensed contractor	18
[R10] / 0 - Ground Floor / Inside room	Power box	Power box and systems	Presume	1 sqm	Crocidolite	Class B	3	3	3	12 High		Further investigation required	19
[R11] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Sample S003	4 pieces	Amosite and Chrysotile	Class A	2	1	2	7 Medium		Prohibit access pending planned works	21
[R12-16] / 0 - Ground Floor / Inside room	Power boxes in R12-16	Power box and systems	Presume	5 boxes, 1 in each classroom	Crocidolite	Class B	3	3	3	12 High		Further investigation required	23
[R12-16] / External / BE2 and 4 Building Envelopes of rooms 12-16	Power boxes between classrooms	Bakelite	Strongly Presume	7	Crocidolite	Class B	1	2	1	7 Medium		Removal by licensed contractor	24
[R12-16] / External / Building Envelope	External Cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	Cross Reference S002	920 sqm	Amosite, Chrysotile and Crocidolite	Class B	1	2	1	7 Medium		Removal by licensed contractor	25
[R12] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Cross Reference S003	1.5sqm total 5 pieces (badly damaged or missing entirely)	Amosite and Chrysotile	Class A	2	3	2	9 Medium		Removal by licensed contractor	26
[R14] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Cross Reference S003	4 pieces (presumed)	Amosite and Chrysotile	Class A	2	2	2	8 Medium		Removal by licensed contractor	27

table continued from previous page...

Building / Level / Location	Item	Material	Strategy / Sample Id	Extent	Fibre Type	Friability	Product Type	Extent of Damage	Surface Treatment	Material Score	Priority Score	Recommendation	Page
[R16] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Cross Reference S003	4 pieces	Amosite and Chrysotile	Class A	2	3	2	9 Medium		Remove if planned works may disturb	28
[R23-24] / External / BE1,3,4 Building Envelope	Eave panels	Fibre Cement Sheet - Flat Sheet	Sample S008	40 sqm	Amosite, Chrysotile and Crocidolite	Class B	1	1	1	6 Low		Removal by licensed contractor	31
[R23] / External / Building Envelope (including hidden between R22 and 23)	Cladding of R23	Fibre Cement Sheet - Flat Sheet	Sample S010	90 sqm	Amosite, Chrysotile and Crocidolite	Class B	1	1	1	6 Low		Removal by licensed contractor	32
[R24] / 0 - Ground Floor / Inside room	Power board box	Power box and systems	Presume	1 Box	Crocidolite	Class B	3	3	3	12 High		Further investigation required	33
[R24] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet	Cross Reference S002	130sqm	Amosite, Chrysotile and Crocidolite	Class B	1	2	1	7 Medium		Removal by licensed contractor	35

Survey Inspection Detail

A summary of all items and materials inspected during the survey, including ACMs, non-ACMs, items and areas that could not be fully accessed.

Building / Level / Location	Item	Material	Access / Notes	Material Score	Priority Score	Recommendation	Page
[R10-11] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet		7 Medium		Removal by licensed contractor	18
[R10] / 0 - Ground Floor / Inside room	Power box	Power box and systems	No Access / Live Electricity - Inspect following power isolation	12 High		Further investigation required	19
[R10] / 0 - Ground Floor / Inside room	Roof paper (inside ceiling)	Building paper (bitumen based)		0 None			20
[R11] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.	7 Medium		Prohibit access pending planned works	21
[R11] / 0 - Ground Floor / Inside room	Roof paper (inside ceiling)	Building paper (bitumen based)		0 None			22
[R12-16] / 0 - Ground Floor / Inside room	Power boxes in R12-16	Power box and systems	No Access / No Access / Live Electricity - Inspect following power isolation	12 High		Further investigation required	23
[R12-16] / External / BE2 and 4 Building Envelopes of rooms 12-16	Power boxes between classrooms	Bakelite		7 Medium		Removal by licensed contractor	24
[R12-16] / External / Building Envelope	External Cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet		7 Medium		Removal by licensed contractor	25
[R12] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.	9 Medium		Removal by licensed contractor	26
[R14] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.	8 Medium		Removal by licensed contractor	27

table continued from previous page...

Building / Level / Location	Item	Material	Access / Notes	Material Score	Priority Score	Recommendation	Page
[R16] / 0 - Ground Floor / Inside room	Chimney AIB (hidden)	Insulating Board	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.	9 Medium		Remove if planned works may disturb	28
[R22] / External / BE3 Building Envelope (back wall)	Eaves	Fibre Cement Sheet - Flat Sheet		0 None			29
[R22] / External / Building Envelope (including hidden between R22 and 23)	Cladding of R22	Fibre Cement Sheet - Flat Sheet		0 None			30
[R23-24] / External / BE1,3,4 Building Envelope	Eave panels	Fibre Cement Sheet - Flat Sheet		6 Low		Removal by licensed contractor	31
[R23] / External / Building Envelope (including hidden between R22 and 23)	Cladding of R23	Fibre Cement Sheet - Flat Sheet		6 Low		Removal by licensed contractor	32
[R24] / 0 - Ground Floor / Inside room	Power board box	Power box and systems	No Access / No Access / No Access / Live Electricity - Inspect following power isolation	12 High		Further investigation required	33
[R24] / External / Building Envelope	Bitumen building paper	Building paper (bitumen based)		0 None			34
[R24] / External / Building Envelope	Flat cladding (all cement cladding of envelopes)	Fibre Cement Sheet - Flat Sheet		7 Medium		Removal by licensed contractor	35
Walkway outside [R10] / External / Stand alone walkway - outside R10	Walkway eave panels	Fibre Cement Sheet - Flat Sheet		0 None			36
Walkway outside [R16] / External / Cladding attached to Walkway structure	Cement sheeting cladding which walkway is attached to	Fibre Cement Sheet - Flat Sheet		0 None			37
Walkway outside [R22] / External / Walkway outside R22 (attached to R22 and R20)	Walkway eave panels (and supporting cladding structures)	Fibre Cement Sheet - Flat Sheet		0 None			38

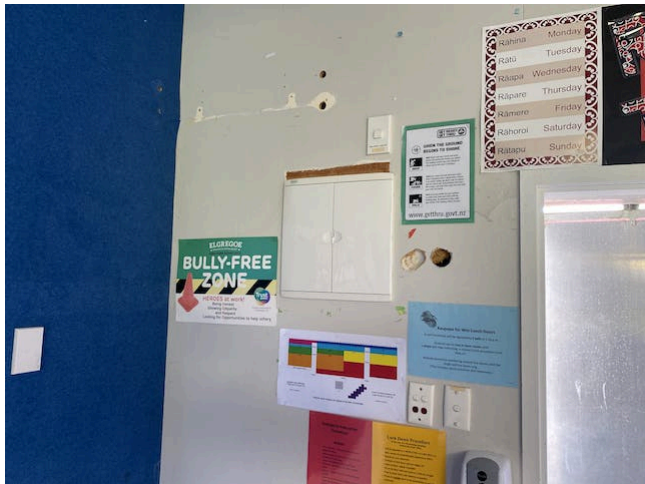
Material and Priority Assessments

See following pages for material and priority assessments.

Building	[R10-11]	Level	External
Location	Building Envelope	Item	Flat cladding (all cement cladding of envelopes)
Material	Fibre Cement Sheet - Flat Sheet	Extent	320 sqm
			
			
Strategy / Sample Id	Sample / S002	Fibre Type	Amosite, Chrysotile and Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Fibre cement paneling to R10 and 11 exterior. Includes all cement panels, window infills and overlaying strips to join cladding. Some cladding panels have been replaced with plywood (along low level paneling where panels have been replaced). Total estimated 340m2 (including timber panels in calculation for building envelope total square area).		

Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	2
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	7 / Medium		

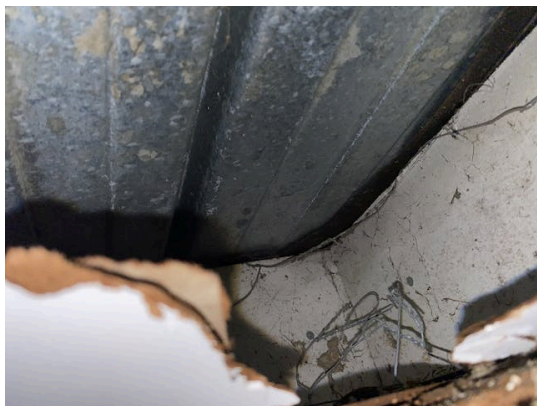
Building	[R10]	Level	0 - Ground Floor
Location	Inside room	Item	Power box
Material	Power box and systems	Extent	1 sqm
			
Access / Notes	No Access / Live Electricity - Inspect following power isolation		
Strategy / Sample Id	Presume	Presumed Fibre Type	Crocidolite
Recommendation	Further investigation required		
General Comments	Power system strongly presumed to contain asbestos due to live wires. Consultex can inspect these areas following power isolation.		

Material Assessment

Product Type (or Debris from Product)	3	Extent of Damage / Deterioration	3
Surface Type / Treatment	3	Asbestos Type	3
Material Score / Category	12 / High		

Building	[R10]	Level	0 - Ground Floor
Location	Inside room	Item	Roof paper (inside ceiling)
Material	Building paper (bitumen based)	Extent	70 sqm
			
Strategy / Sample Id	Cross Reference / S001	Fibre Type	NADIS
General Comments	Bitumen based building paper laid beneath roofing to roof framing. Layer of chicken mesh between paper and framing.		

No Asbestos Detected in Sample

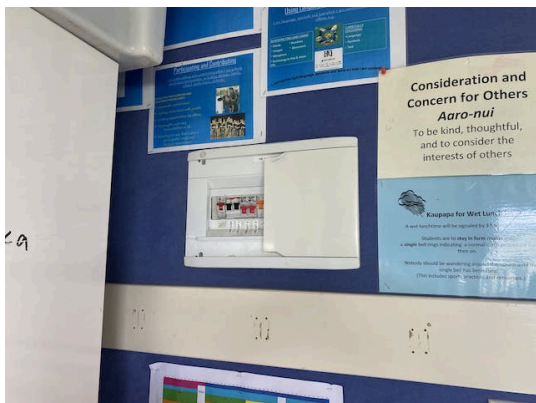
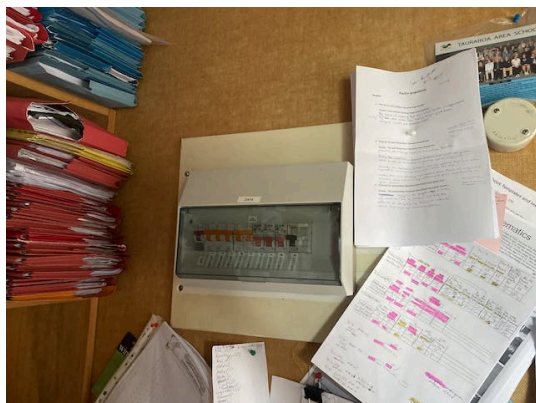
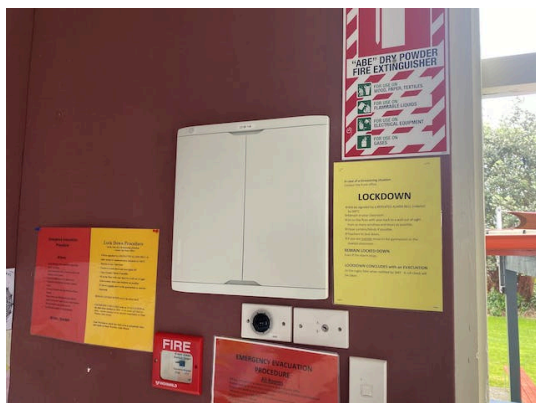
Building	[R11]	Level	0 - Ground Floor
Location	Inside room	Item	Chimney AIB (hidden)
Material	Insulating Board	Extent	4 pieces
			
			
Access / Notes	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.		
Strategy / Sample Id	Sample / S003	Fibre Type	Amosite and Chrysotile
Recommendation	Prohibit access pending planned works		
General Comments	Insulation boards between original chimney stack hole and timber roofing framing. The hole is currently covered by plasterboard paneling and fibre board paneling (as pictured). The insulation boards seem to be fastened in place with nails.		

Material Assessment

Product Type (or Debris from Product)	2	Extent of Damage / Deterioration	1
Surface Type / Treatment	2	Asbestos Type	2
Material Score / Category	7 / Medium		

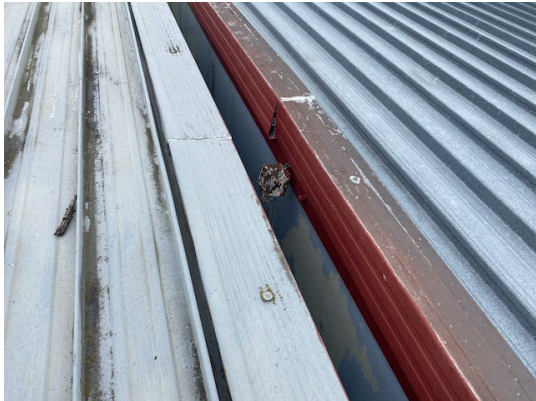
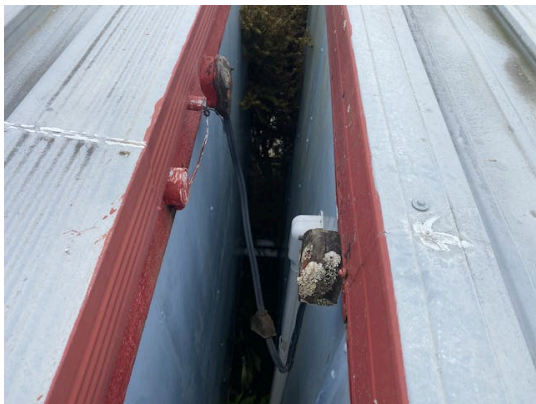
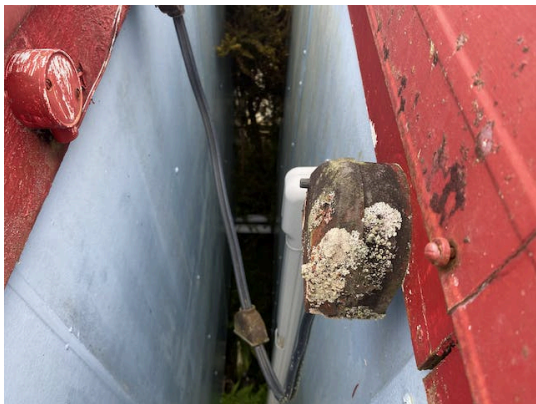
Building	[R11]	Level	0 - Ground Floor
Location	Inside room	Item	Roof paper (inside ceiling)
Material	Building paper (bitumen based)	Extent	70 sqm
			
		No photograph to display	
Strategy / Sample Id	Sample / S001	Fibre Type	NADIS
General Comments	Bitumen based building paper laid beneath roofing to roof framing. Layer of chicken mesh between paper and framing.		

No Asbestos Detected in Sample

Building	[R12-16]	Level	0 - Ground Floor
Location	Inside room	Item	Power boxes in R12-16
Material	Power box and systems	Extent	5 boxes, 1 in each classroom
			
			
Access / Notes	No Access / No Access / Live Electricity - Inspect following power isolation		
Strategy / Sample Id	Presume	Presumed Fibre Type	Crocidolite
Recommendation	Further investigation required		
General Comments	Power system strongly presumed to contain asbestos due to live wires. Each room in this row has power box system. Consultex can inspect these areas following power isolation.		

Material Assessment

Product Type (or Debris from Product)	3	Extent of Damage / Deterioration	3
Surface Type / Treatment	3	Asbestos Type	3
Material Score / Category	12 / High		

Building	[R12-16]	Level	External
Location	BE2 and 4 Building Envelopes of rooms 12-16	Item	Power boxes between classrooms
Material	Bakelite	Extent	7
			
			
Strategy / Sample Id	Strongly Presume	Presumed Fibre Type	Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Power inlet box between rooms. Difficult to access. Recommend removing in one piece.		

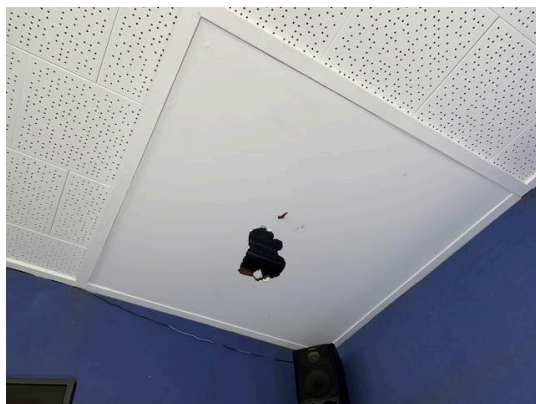
Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	2
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	7 / Medium		

Building	[R12-16]	Level	External
Location	Building Envelope	Item	External Cladding (all cement cladding of envelopes)
Material	Fibre Cement Sheet - Flat Sheet	Extent	920 sqm
			
			
Strategy / Sample Id	Cross Reference / S002	Fibre Type	Amosite, Chrysotile and Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Fibre cement paneling to R12-16 exterior. Includes all cement panels, window infills and overlaying strips to join cladding. Some cladding panels have been replaced with plywood/modern cement, but all buildings present with acm cement cladding to varying degrees of non acm replacement. The acm cladding is overlaid with non acm cement or plywood in places across all buildings envelopes (see additional photos of R12-16 sub floor where panels over clad). Total square meters is estimated for total square meterage of building envelopes.		

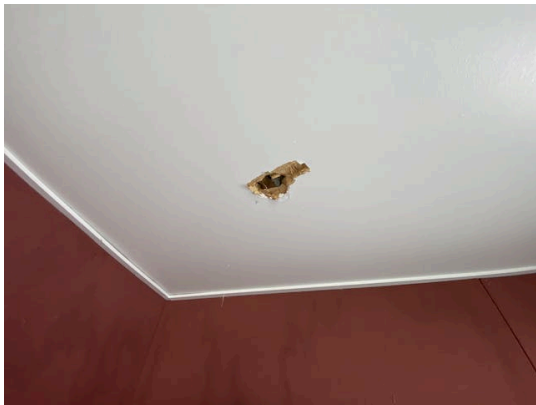
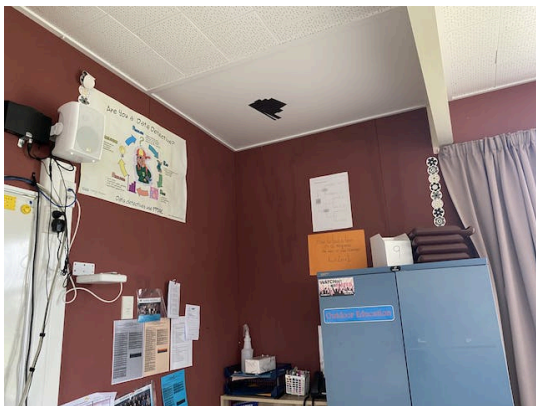
Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	2
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	7 / Medium		

Building	[R12]	Level	0 - Ground Floor
Location	Inside room	Item	Chimney AIB (hidden)
Material	Insulating Board	Extent	1.5sqm total 5 pieces (badly damaged or missing entirely)
			
			
Access / Notes	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.		
Strategy / Sample Id	Cross Reference / S003	Fibre Type	Amosite and Chrysotile
Recommendation	Removal by licensed contractor		
General Comments	Insulation boards between original chimney stack hole and timber roofing framing. The hole is currently covered by fibre board paneling (as pictured). Additionally, there seems to be an AIB panel wedged between the fibreboard paneling and the ceiling framing which is hidden from view of the outside. The entire paneling system of this chimney stack should be treated as AIB, with a large board being sandwiched behind the current fibre board cover. The insulation boards seem to be fastened in place with nails. Photographs show evidence of AIB debris within ceiling cavity.		

Material Assessment

Product Type (or Debris from Product)	2	Extent of Damage / Deterioration	3
Surface Type / Treatment	2	Asbestos Type	2
Material Score / Category	9 / Medium		

Building	[R14]	Level	0 - Ground Floor
Location	Inside room	Item	Chimney AIB (hidden)
Material	Insulating Board	Extent	4 pieces (presumed)
			
		No photograph to display	
Access / Notes	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.		
Strategy / Sample Id	Cross Reference / S003	Fibre Type	Amosite and Chrysotile
Recommendation	Removal by licensed contractor		
General Comments	Insulation boards between original chimney stack hole and timber roofing framing. The hole is currently covered by fibre board paneling (as pictured). The insulation boards seem to be fastened in place with nails. Total quantity of AIB could not be determined without extensive damage and risk of contamination.		

Material Assessment

Product Type (or Debris from Product)	2	Extent of Damage / Deterioration	2
Surface Type / Treatment	2	Asbestos Type	2
Material Score / Category	8 / Medium		

Building	[R16]	Level	0 - Ground Floor
Location	Inside room	Item	Chimney AIB (hidden)
Material	Insulating Board	Extent	4 pieces
			
		No photograph to display	
Access / Notes	Limited Access / Due to health and safety reasons, limited access was made to ensure the friable material was not disturbed.		
Strategy / Sample Id	Cross Reference / S003	Fibre Type	Amosite and Chrysotile
Recommendation	Remove if planned works may disturb		
General Comments	Insulation boards between original chimney stack hole and timber roofing framing. The hole is currently covered by fibre board paneling (as pictured). The insulation boards seem to be fastened in place with nails. There is a second chimney collar in place which remains.		

Material Assessment

Product Type (or Debris from Product)	2	Extent of Damage / Deterioration	3
Surface Type / Treatment	2	Asbestos Type	2
Material Score / Category	9 / Medium		

Building	[R22]	Level	External
Location	BE3 Building Envelope (back wall)	Item	Eaves
Material	Fibre Cement Sheet - Flat Sheet	Extent	15 sqm
			
Strategy / Sample Id	Cross Reference / S006	Fibre Type	NADIS
General Comments	Back wall eave panels of R22		

No Asbestos Detected in Sample

Building	[R22]	Level	External
Location	Building Envelope (including hidden between R22 and 23)	Item	Cladding of R22
Material	Fibre Cement Sheet - Flat Sheet	Extent	130 sqm
			
		No photograph to display	
Strategy / Sample Id	Sample / S007	Fibre Type	NADIS
General Comments	Cement sheeting cladding of R22. Panels run in wall cavity between R22 and R23.		

No Asbestos Detected in Sample

Building	[R23-24]	Level	External
Location	BE1,3,4 Building Envelope	Item	Eave panels
Material	Fibre Cement Sheet - Flat Sheet	Extent	40 sqm
			
			
Strategy / Sample Id	Sample / S008	Fibre Type	Amosite, Chrysotile and Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Cement eave panels found around R23 and 24. The front of R23 has these eaves above a corrugated plastic sheet roofing which partially obscures it from sight.		

Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	1
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	6 / Low		

Building	[R23]	Level	External
Location	Building Envelope (including hidden between R22 and 23)	Item	Cladding of R23
Material	Fibre Cement Sheet - Flat Sheet	Extent	90 sqm
			
		No photograph to display	
Strategy / Sample Id	Sample / S010	Fibre Type	Amosite, Chrysotile and Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Cement sheeting cladding of R23. Panels run in wall cavity between R22 and R23.		

Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	1
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	6 / Low		

Building	[R24]	Level	0 - Ground Floor
Location	Inside room	Item	Power board box
Material	Power box and systems	Extent	1 Box
			
Access / Notes	No Access / No Access / No Access / Live Electricity - Inspect following power isolation		
Strategy / Sample Id	Presume	Presumed Fibre Type	Crocidolite
Recommendation	Further investigation required		
General Comments	Power board system placed over an old box. Treat back box as acm during removal. Consultex can inspect these areas following power isolation.		

Material Assessment

Product Type (or Debris from Product)	3	Extent of Damage / Deterioration	3
Surface Type / Treatment	3	Asbestos Type	3
Material Score / Category	12 / High		

Building	[R24]	Level	External
Location	Building Envelope	Item	Bitumen building paper
Material	Building paper (bitumen based)	Extent	120
			
		<i>No photograph to display</i>	
Strategy / Sample Id	Sample / S009	Fibre Type	NADIS
General Comments	Building paper in wall between cladding and framing.		

No Asbestos Detected in Sample

Building	[R24]	Level	External
Location	Building Envelope	Item	Flat cladding (all cement cladding of envelopes)
Material	Fibre Cement Sheet - Flat Sheet	Extent	130sqm
			
		No photograph to display	
Strategy / Sample Id	Cross Reference / S002	Fibre Type	Amosite, Chrysotile and Crocidolite
Recommendation	Removal by licensed contractor		
General Comments	Fibre cement paneling to R24 exterior. Includes all cement panels, window infills and overlaying strips to join cladding. Some cladding panels have been replaced with plywood/modern cement, but all external walls present with acm cement cladding.		

Material Assessment

Product Type (or Debris from Product)	1	Extent of Damage / Deterioration	2
Surface Type / Treatment	1	Asbestos Type	3
Material Score / Category	7 / Medium		

Building	Walkway outside [R10]	Level	External
Location	Stand alone walkway - outside R10	Item	Walkway eave panels
Material	Fibre Cement Sheet - Flat Sheet	Extent	16sqm
			
Strategy / Sample Id	Sample / S004	Fibre Type	NADIS
General Comments	Cement sheeting panels- eaves to walkway outside R10. Only present at the end of walkway. Rest of walkway not cement paneled.		

No Asbestos Detected in Sample

Building	Walkway outside [R16]	Level	External
Location	Cladding attached to Walkway structure	Item	Cement sheeting cladding which walkway is attached to
Material	Fibre Cement Sheet - Flat Sheet	Extent	17 sqm
			
		No photograph to display	
Strategy / Sample Id	Sample / S005	Fibre Type	NADIS
General Comments	Cement sheeting attached to framing for walkway which is to be removed. Removing walkway will disturb the cladding.		

No Asbestos Detected in Sample

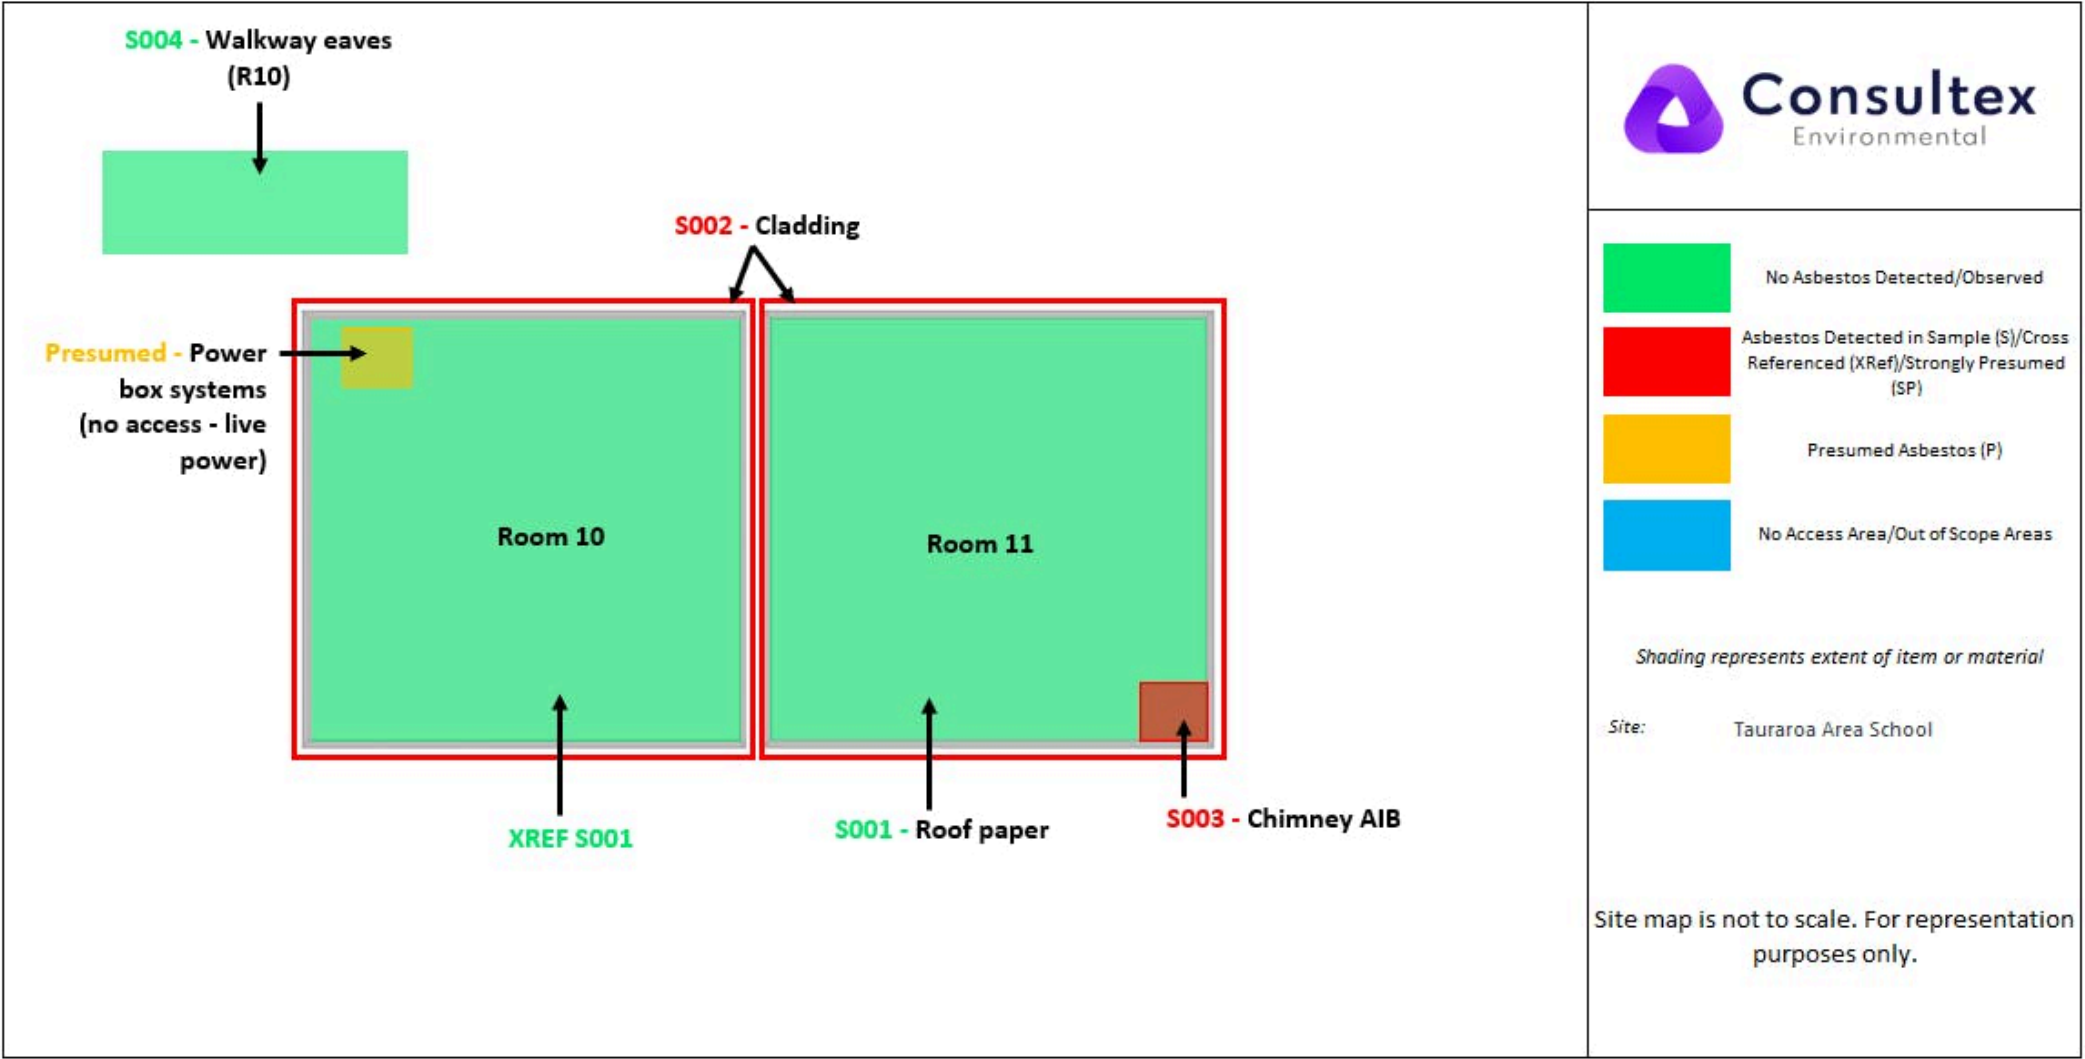
Building	Walkway outside [R22]	Level	External
Location	Walkway outside R22 (attached to R22 and R20)	Item	Walkway eave panels (and supporting cladding structures)
Material	Fibre Cement Sheet - Flat Sheet	Extent	50 sqm total
			
			
Strategy / Sample Id	Sample / S006	Fibre Type	NADIS
General Comments	Fibre cement sheeting used as eaves and surrounding cladding for eave structures. All cement panels for walkway outside R22 are the same material.		

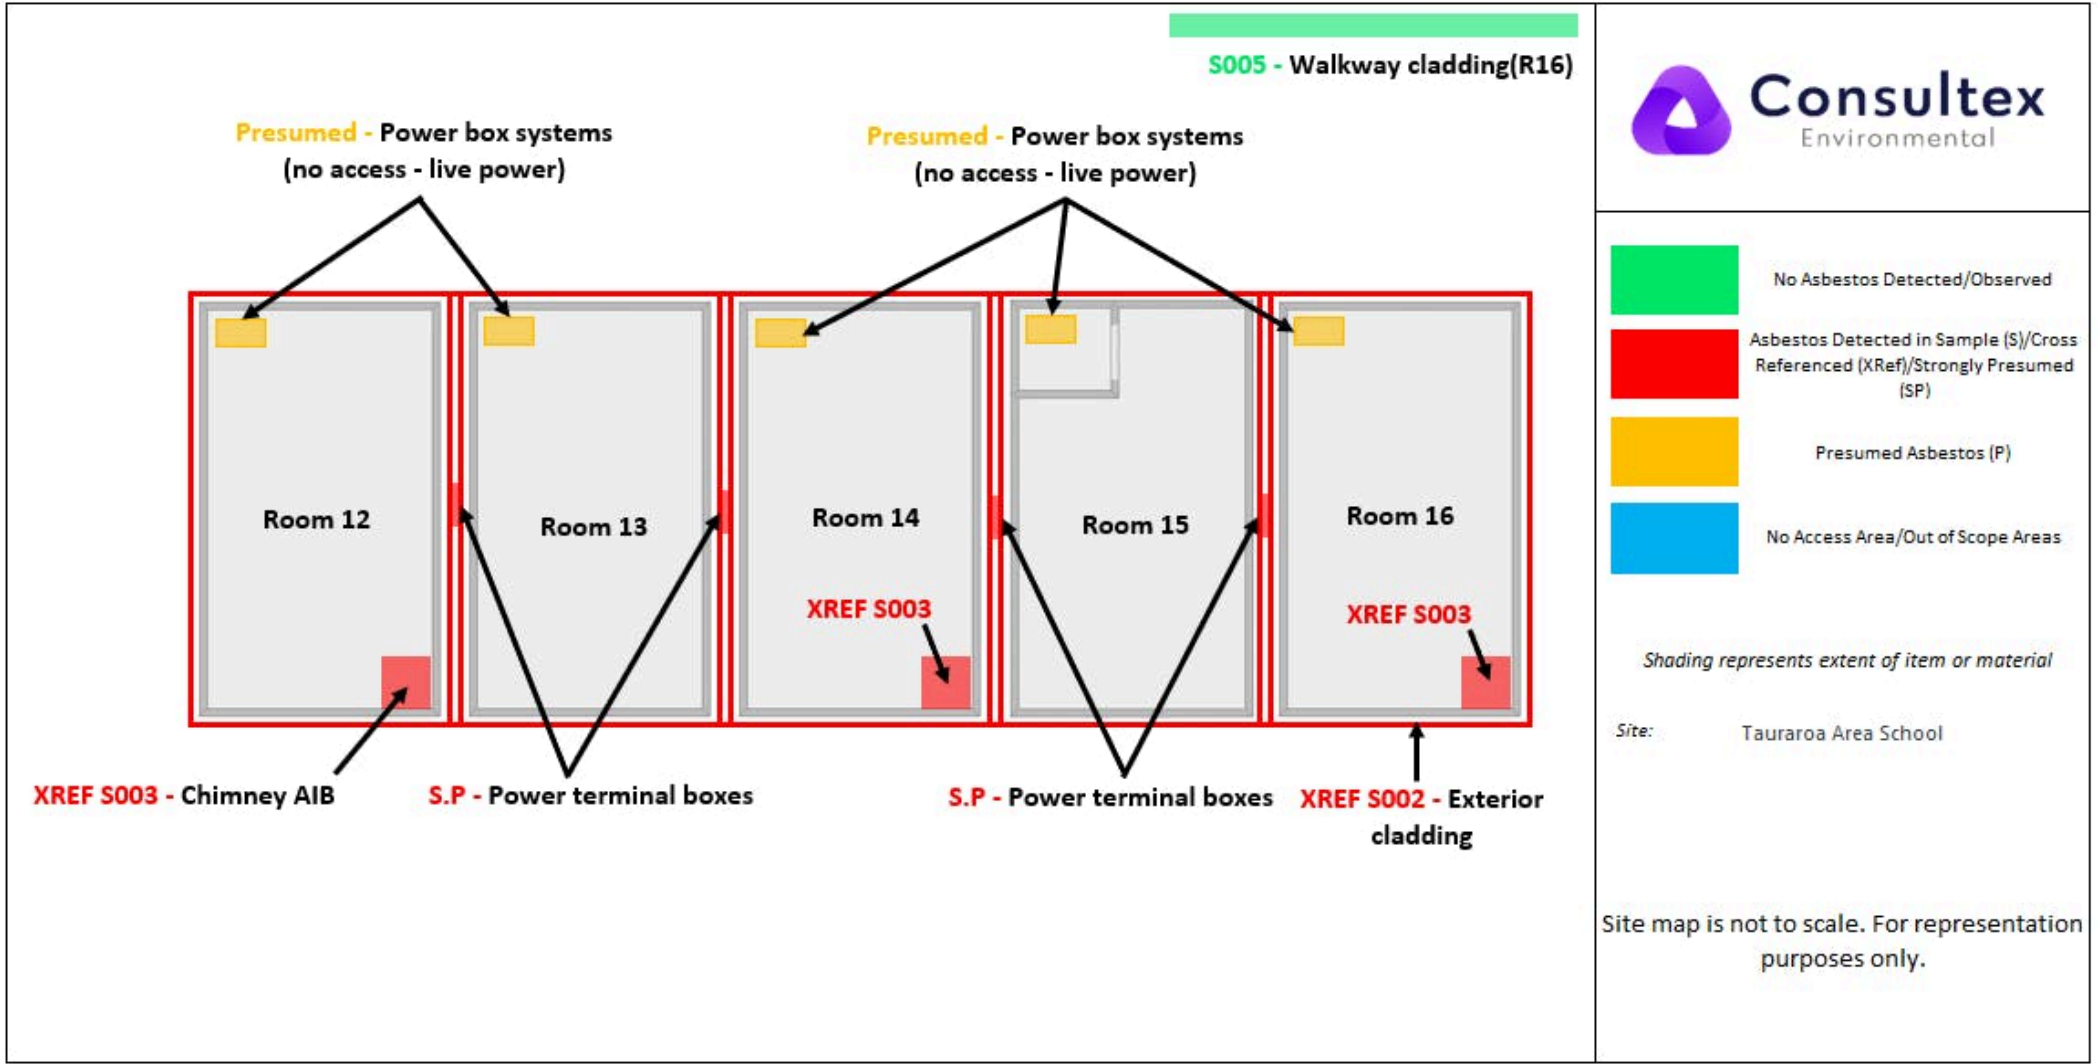
No Asbestos Detected in Sample

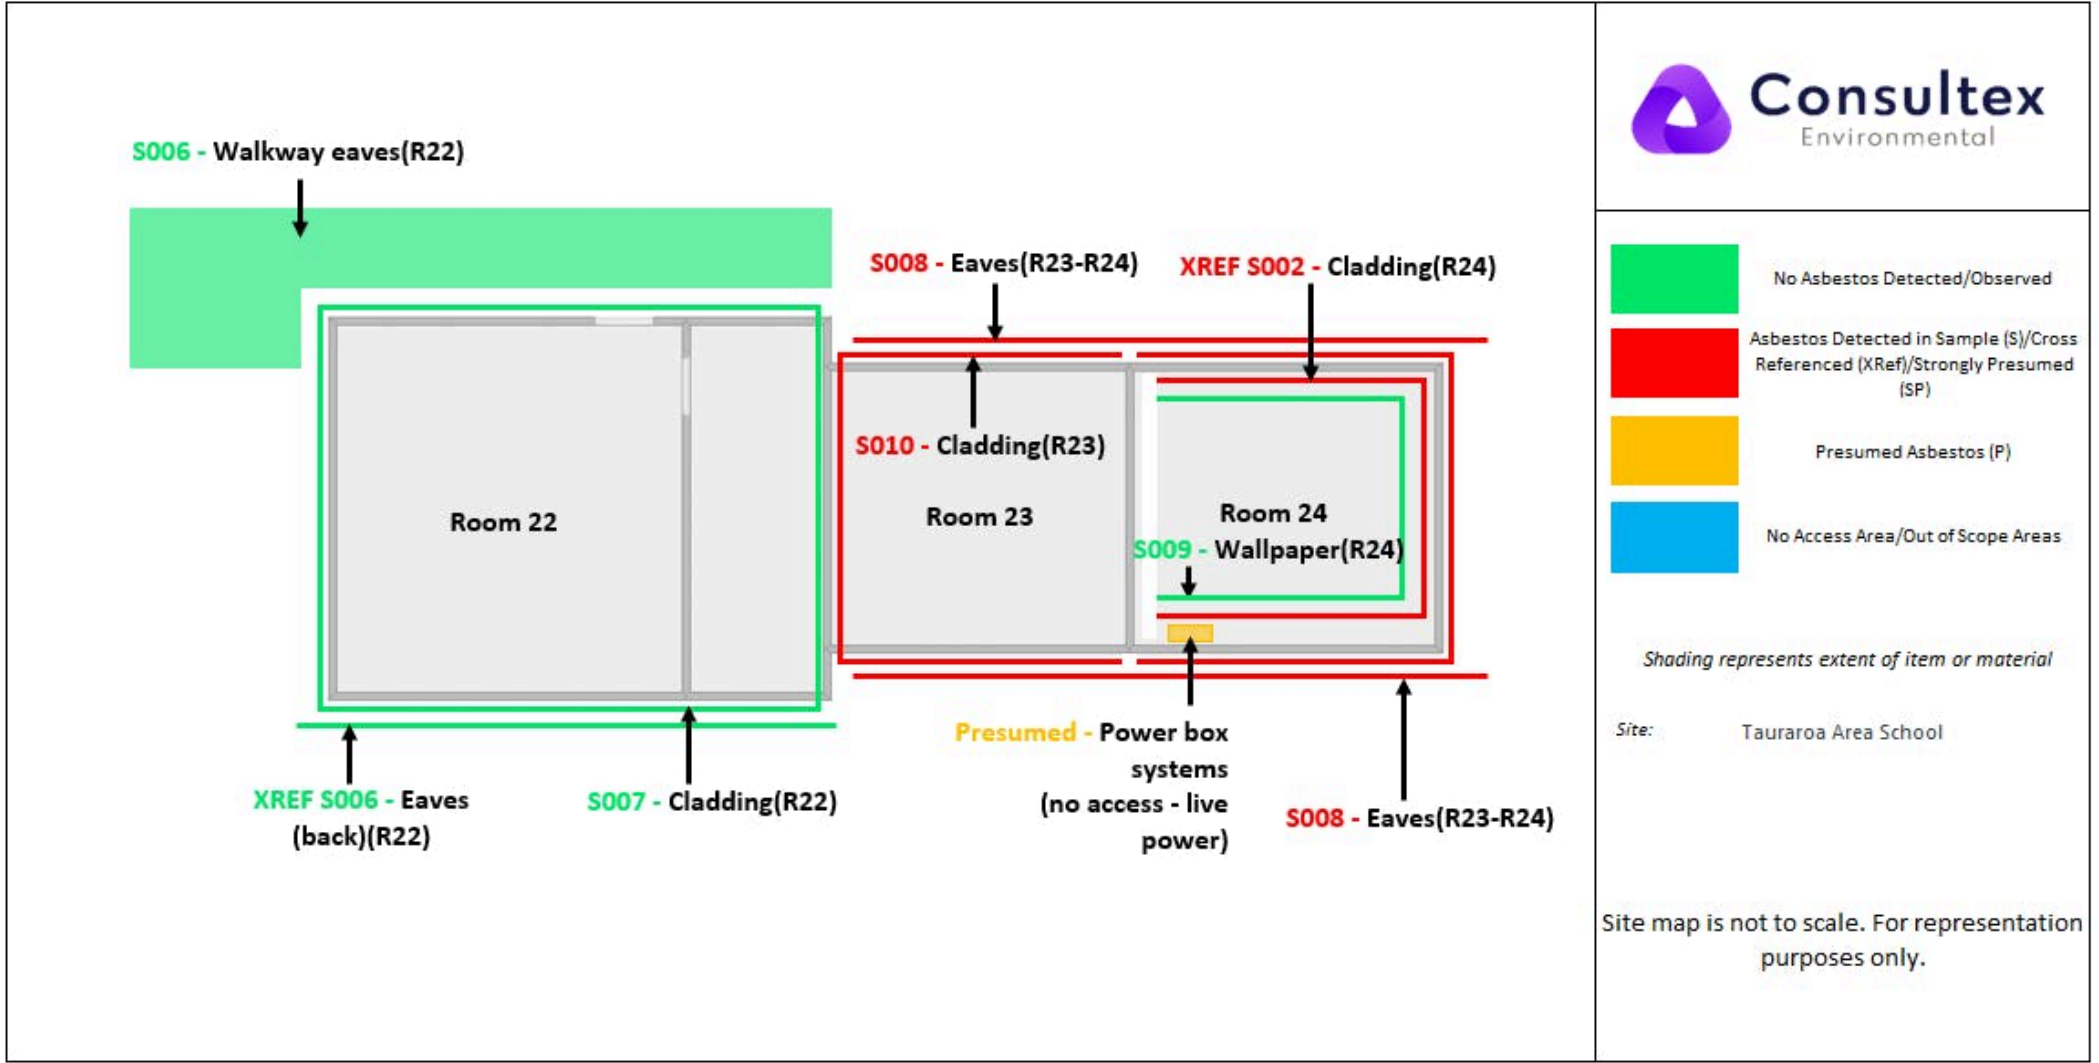
Appendices

Floor Plans

See following pages...







Lab Results, Certificates & Evidence

See following pages...

Asbestos Identification Report

Unit A7, 570 Mt Wellington Highway, Mount Wellington



Consultex Laboratories
0508 292 292
contact@consultexlab.co.nz
www.consultexnz.com

Certificate of Analysis / Lab Report No. 1525 - 1

Client / Company	Client Contact	PO / Client Reference	Company Address
Consultex Environmental	William Morris-Whyte 0508 292 292 results@consultexnz.com	Northland - ID4578	PO Box 17708, Ellerslie, Auckland

Site Address	Tauraroa Area School	Sampled / Submitted By	Daven Illenberger
Date Sampled	9th Oct 2022	Date Received	10th Oct 2022
Date Analysed	13th Oct 2022	Date Reported	13th Oct 2022

Method: Asbestos identification in bulk samples by polarised light microscopy and dispersion staining, in accordance with 'AS4964-2004 Method for the Qualitative Identification of Asbestos in Bulk Samples and Consultex laboratories in-house method TM002 [Detection Limit - 0.1g/kg (AS4964)].

Results only apply to the samples as received.

Lab Sample ID	Client Sample ID	Sample Description / Location	Sample type	Sample Weight on Receipt (g)	Fibres Identified / Asbestos Presence	Analyst's Comments
1525.1	S001	[R11] - Roof Paper	Bitumen	8.2	Asbestos NOT detected Organic Fibres detected	
1525.2	S002	[R10-11] Cladding	Fibre Cement	0.8	Amosite (Brown), Chrysotile (White) and Crocidolite (Blue) asbestos detected Organic Fibres detected	
1525.3	S003	[R11] Chimney AIB	Board	0.2	Amosite (Brown) and Chrysotile (White) asbestos detected Organic Fibres detected	AIB
1525.4	S004	[R10] Walkway Eaves	Fibre Cement	0.8	Asbestos NOT detected Organic Fibres detected	
1525.5	S005	[R16] Walkway Cladding	Fibre Cement	2.2	Asbestos NOT detected Organic Fibres detected	
1525.6	S006	[R22] Walkway Eaves & Supports	Fibre Cement	1.8	Asbestos NOT detected Organic Fibres detected	
1525.7	S007	[R22] Cladding	Fibre Cement	0.2	Asbestos NOT detected Organic Fibres detected	
1525.8	S008	[R23-24] Eaves	Fibre Cement	0.1	Amosite (Brown), Chrysotile (White) and Crocidolite (Blue) asbestos detected	
1525.9	S009	[R24] Wall Bitumen Paper	Bitumen	3.4	Asbestos NOT detected Organic Fibres detected	
1525.10	S010	[R23] Cladding	Fibre Cement	0.1	Amosite (Brown), Chrysotile (White) and Crocidolite (Blue) asbestos detected	

Consultex Laboratories Report No. 1525

Page 1 of 2

Asbestos Identification Report

Certificate of Analysis / Lab Report No. 1525 - 1



Analyst: Paramjeet Singh

Key Technical Person: Paramjeet Singh**Notes:**

- Testing was completed on 13th Oct 2022. For completion date of individual analyses please contact laboratory.
- Samples were collected by yourselves and analysed as received at Consultex Auckland laboratory - A7/570, Mt Wellington Highway, Auckland. Samples were in acceptable condition unless otherwise noted on this report.
- Any opinions and interpretation expressed in the report fall outside the scope of accreditation.
- This certificate of analysis must not be reproduced, except in full, without the written consent of the signatory.

Types of Asbestos Survey

HSG 264 (Asbestos: The Survey Guide) describes two types of survey:

Management Surveys

A management survey is the standard survey. Its purpose is to locate, as far as reasonably practicable, the presence and extent of any suspect ACMs in the building which could be damaged or disturbed during normal occupancy, including foreseeable maintenance and installation, and to assess their condition. Management surveys can involve a combination of sampling to confirm asbestos is present or presuming asbestos to be present.

Refurbishment and Demolition Surveys

A refurbishment and demolition survey is needed before any refurbishment or demolition work is carried out. This type of survey is used to locate and describe, as far as reasonably practicable, all ACMs in the area where the refurbishment work will take place or in the whole building if demolition is planned. The survey will be fully intrusive and involve destructive inspection, as necessary, to gain access to all areas, including those that may be difficult to reach. A refurbishment and demolition survey may also be required in other circumstances, eg when more intrusive maintenance and repair work will be carried out or for plant removal or dismantling.

Class A and Class B Asbestos Meaning

Class A Materials

Materials with the following characteristics are classified as Class A:

- Friable.
- More prone to damage.
- Easily broken or damaged by hand.
- More likely to release asbestos fibres into the air.

Class B Materials

Materials with the following characteristics are classified as Class B:

- Non-Friable.
- More resistant to damage and abrasion.
- Not easily disturbed.
- Less likely to release asbestos fibres into the air.

Material Assessment Scores

Where ACMs have been identified or presumed, a material score is calculated in accordance with HSG 264 (Asbestos: The Survey Guide). The value assigned to each of the four sample variables is added together to give a total material score between 2 and 12.

Sample Variable	Score	Examples of Score
Product Type (or Debris from Product)	1	Asbestos reinforced composites (plastics, resins, mastics, roofing felts, vinyl floor tiles, semi-rigid paints or decorative finishes, asbestos cement etc)
	2	Asbestos insulating board, mill boards, other low density insulation boards, asbestos textiles, gaskets, ropes and woven textiles, asbestos paper and felt
	3	Thermal insulation (eg pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing
Extent of Damage / Deterioration	0	Good condition: no visible damage
	1	Low damage: a few scratches or surface marks; broken edges on board, tiles etc.
	2	Medium damage: significant breakage of materials or several small areas where material has been damaged revealing loose asbestos fibres
	3	High damage or delamination of materials, sprays and thermal insulation. Visible asbestos debris.
Surface Treatment	0	Composite materials containing asbestos: reinforced plastics, resins, vinyl tiles
	1	Enclosed sprays and lagging, asbestos insulating board (with exposed face painted or encapsulated), asbestos cement sheets etc.
	2	Unsealed asbestos insulating board, or encapsulated lagging and sprays
	3	Unsealed laggings and sprays
Asbestos Type	1	Chrysotile
	2	Amphibole asbestos excluding crocidolite
	3	Crocidolite

The material score determines the potential for a material to release asbestos fibres when disturbed. This score is then categorised to describe the potential:

Material Score	2	3	4	5	6	7	8	9	10	11	12
Category	Very Low			Low		Medium			High		

Priority Assessment Scores

The priority assessment is determined by carrying out an assessment of the likelihood of the ACM being disturbed through: **Normal Occupant Activity**, **Likelihood of Disturbance**, **Human Exposure Potential** and **Maintenance Activity**. Guidance on Priority Assessments is provided in HSG 227 (A Comprehensive Guide to Managing Asbestos in Premises) and HSG 264 (Asbestos: The Survey Guide).

The surveyor has carried out a priority risk assessment on your behalf. This is based on the activities witnessed by the surveyor on the day of the survey. This information can contribute to the risk assessment, however **it is the duty holder's responsibility under CAR 2012 to complete the Risk Assessments using the Survey report and his / her own detailed knowledge of the activities carried out within the premises.**

Assessment Parameter	Score	Examples of Score
Normal Occupant Activity		
Main Type of Activity in Area	0	Rare disturbance activity (eg little used store room)
	1	Low disturbance activities (eg office type activity)
	2	Periodic disturbance (eg industrial or vehicular activity which may cause contact with ACMs)
	3	High levels of disturbance, (eg fire door with asbestos insulating board sheet in constant use)
Likelihood of Disturbance		
Location	0	Outdoors
	1	Large Rooms or well-ventilated areas
	2	Rooms up to 100 sq metres in area
	3	Restricted or confined areas
Accessibility	0	Usually inaccessible or unlikely to be disturbed
	1	Occasionally likely to be disturbed
	2	Easily disturbed
	3	Routinely disturbed
Extent / Amount	0	Small amounts or single items (eg strings, gaskets)
	1	Less than 10 sq metres area, or 10 metre pipe run
	2	10 to 50 sq metres area or 10 to 50 metres pipe run
	3	More than 50 sq metres, or 50 metres pipe run
Average Score		Average of scores for Location , Accessibility and Extent / Amount <i>Maximum score of 3</i>
Human Exposure Potential		
Number of Occupants	0	None
	1	1 to 3
	2	4 to 10
	3	More than 10
Frequency of Use of Area	0	Infrequent
	1	Monthly
	2	Weekly

table continued from previous page...

Assessment Parameter	Score	Examples of Score
	3	Daily
Average Time Area is in Use	0	Less than 1 hour
	1	1 to less than 3 hours
	2	3 to less than 6 hours
	3	More than 6 hours
Average Score		Average of scores for Number of Occupants , Frequency of Use of Area , and Average Time Area is in Use <i>Maximum score of 3</i>
Maintenance Activity		
Type of Maintenance Activity	0	Minor disturbance (eg possibility of contact when gaining access)
	1	Low disturbance (eg changing light bulbs in asbestos insulating board ceiling)
	2	Medium disturbance (eg lifting one or two asbestos insulating board ceiling tiles to access a valve)
	3	High levels of disturbance (eg removing a number of asbestos insulating board ceiling tiles to replace a valve or for recabling)
Frequency of Maintenance Activity	0	Unlikely - almost never
	1	Less than once a year
	2	Less than once a month
	3	More often than once a month
Average Score		Average of scores for Type of Maintenance Activity and Frequency of Maintenance Activity <i>Maximum score of 3</i>
Total Score		

Risk Assessment Scores

The material score is added to priority assessment score to give a total risk assessment score between 2 and 24. This score can be used to determine the items that require the most immediate attention.

Material Assessment Score + Priority Assessment Score = **Risk Assessment Score**

2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
Lowest Risk											Highest Risk											

Asbestos Materials

Asbestos is a naturally occurring mineral composed of soft and flexible fibers that are resistant to heat, electricity and corrosion. These qualities make the mineral useful, but they also make asbestos exposure highly toxic.

Asbestos is a group of six naturally occurring fibrous minerals composed of thin, needle-like fibers. Exposure to asbestos causes several cancers and diseases, including mesothelioma and asbestosis.

Asbestos Morphology

Mineral Group	Fibre Type	Common Name
Serpentine	Chrysotile	White
Amphibole	Amosite	Brown
	Crocidolite	Blue

Note: Anthophyllite was used in limited quantities for insulation products and construction materials. It also occurs as a contaminant in chrysotile asbestos, vermiculite and talc. Tremolite and actinolite are not used commercially, but they can be found as contaminants in chrysotile asbestos, vermiculite and talc.