



Vietnam Airlines



Reliability Report

ATR72

February 2025

Approved by Reliability Control Board

Vietnam Airlines
ATR72 Reliability Report
February 2025

Form VNA-MNT-F91-01
Issue 06/Rev 01
09Apr2024

Report Distribution List

Director Flight Safety Standard Department-CAAV:	Mr. Ta Minh Trong	Director Safety Quality:	Mr. Nguyen Dang Quang
Chairman of Management Board:	Mr. Dang Ngoc Hoa	Director Technical:	Mr. Tran Minh Hai
Chief Executive Officer:	Mr. Le Hong Ha	Director Supply:	Mr. Hoang Hai Ho
Vice President Technical:	Mr. Nguyen Chien Thang	General Director VAECO:	Mr. Tran Quoc Hoai
Vice President Safety / Post Holder Safety:	Mr. Dinh Van Tuan	ATR Representative	

Technical Director



Trần Minh Hải

Chairman of Reliability Board



Nguyễn Chiến Thắng

Vietnam Airlines
ATR72
EXECUTIVE SUMMARY IN FEBRUARY 2025

1. Tổng quan

Báo cáo này cung cấp thông tin về hiệu suất hoạt động và độ tin cậy của đội bay ATR72 của Vietnam Airlines trong tháng 2/2025. Tài liệu được phê duyệt bởi Hội đồng Độ tin cậy và dựa trên dữ liệu thu thập từ hệ thống AMOS.

2. Độ tin cậy kỹ thuật & Hiệu suất hoạt động

- Độ tin cậy cất cánh của đội bay ATR72 trong tháng 2/2025 đạt 99.77%, cao hơn so với mục tiêu đề ra (99.65%).
- Giờ bay trung bình mỗi ngày của một tàu bay trong tháng 2/2025 là 7,0 giờ, tăng 3,2% so với tháng 01/2025 (6,7 giờ). Trong khi đó, giờ bay trung bình mỗi chuyến đạt 0,76 giờ, giảm so với tháng trước (0,81 giờ).
- Tổng số chu kỳ bay: 1284 cycles.
- Không có bất kỳ Alert Notification Report (ANR) mới nào trong tháng này.

3. Chậm chuyến & Sự cố kỹ thuật

Trong tháng 2/2025, đã ghi nhận 03 chậm chuyến, trong đó có 01 sự kiện Rejected Take Off (RTO) và 01 quay lại GTB. Đối với các trường hợp gián đoạn khai thác này, tất cả các nguyên nhân đã đều được nhận diện/phân tích nguyên nhân và thực hiện các biện pháp khắc phục. Cụ thể:

(1). ATA 24-21: INVERTER:

- Ngày 20/1 thay 16PU, nhưng ngày 3/2 lỗi Inverter 1 tái diễn, phải thay Inverter PN 559-012D (TSN 9784FH, TSI 5267FH). Inverter có độ tin cậy tốt, MTBUR 38.524FH, lỗi chủ yếu do lão hóa sau 12–15 năm sử dụng, thường do quá nhiệt điện trở, diode. Trường hợp

1. Overview

This report provides information on the operational performance and reliability of Vietnam Airlines' ATR72 fleet for February 2025. The document has been approved by the Reliability Control Board and is based on data collected from the AMOS system.

2. Dispatch Reliability & Operational Performance

- The Dispatch Reliability of the ATR72 fleet in February 2025 was 99.77%, higher than the target (99.65%).
- Average Daily Utilisation in February 2025 reached 7.0 hours, representing a 3.2% increase compared to January 2025 (6.7 hours). Meanwhile, Average Flight Duration was 0.76 hours, showing a decrease from the previous month (0.81 hours).
- Total flight cycles: 1284 cycles.
- No new Alert Notification Reports (ANR) were issued this month.

3. Delays & Technical Issues

In February 2025, a total of 03 delay events were recorded, including 01 Rejected Take-Off (RTO) & 01 Ground Turn – Back (GTB). For these operational disruptions, all causes have been identified and analyzed, and corrective measures have been implemented. Specifically:

(1). ATA 24-21: INVERTER:

- The Inverter 1 fault on aircraft B225 recurred shortly after the 16PU Contactor was replaced, requiring inverter replacement (PN: 559-012D) with TSN 9,784 FH. Inverter reliability has been good fleetwide since 2015, with only 7 removals and MTBUR of 38,524 FH, with most failures linked to aging and overheating components.

Vietnam Airlines
ATR72
EXECUTIVE SUMMARY IN FEBRUARY 2025

B225 có thể ảnh hưởng bởi bảo quản dài hạn và T/S trước đó chưa triệt để.

(2). ATA 34-25: AHRU:

- AHRU#1 PN 7003360-946 (SN 09085259) lắp từ 2009, TSN 24.519FH, chưa từng sửa chữa, độ tin cậy tương đối tốt dù gần đây có một số lỗi do lão hóa linh kiện hoặc nhiễm bẩn chất lỏng. Sau khi thay thế, tàu vẫn bị lỗi sau 4 leg bay, nghi ngờ liên quan đến wiring hoặc connector, đặc biệt khi rung lắc lúc taxi/cất-hạ cánh. VAECO đã kiểm tra nguồn cấp AHRU, kết quả bình thường, tiếp tục theo dõi thêm.

(3). ATA 31-53: TAKE OFF CONFIG:

- Hỏng "T/O CONFIG" chỉ xảy ra trên B223, lắp lại nhiều lần và khó khắc phục triệt để dù đã thay thế nhiều thiết bị và kiểm tra wiring. Trường hợp ngày 16/02/2025 cảnh báo xuất hiện dù pitch trim nằm trong green band, nghi do sai chỉ thị từ đồng hồ pitch trim indicator mới thay. Thiết bị này có lịch sử khai thác cao, từng sửa lỗi chỉ thị tương tự, cần xem xét loại khỏi kho để tránh gây hỏng hóc lắp lại.

4. Hiệu suất động cơ & APU

- Không có trường hợp IFSD (tắt máy trên không) nào trong tháng.

5. Tháo lắp ngoài kế hoạch

Trong tháng 02/2025, một số thiết bị có tỷ lệ tháo lắp không theo kế hoạch cao nhất gồm:

- AIR-UNIT CYCLE (P/N 2205120-4) - 2 lần tháo lắp.
- TEMPERATURE CONTROL VALVE (P/N 5618C000-002) - 2 lần tháo lắp.

For B225, contributing factors may include long-term storage and possibly incomplete previous troubleshooting.

(2). ATA 34-25: AHRU:

- AHRU #1 (PN: 7003360-946) has been on-wing since 2009 with TSN 24,519 FH and no repair history; reliability is relatively good with 9 failures since 2020. Recent faults are mainly due to aging or external contamination. Post-replacement issues may involve wiring/connectors, as faults reappeared after 4 legs; VAECO found power supply normal and will continue monitoring.

(3). ATA 31-53: TAKE OFF CONFIG:

- The recurring "T/O CONFIG" fault on B223 has caused multiple disruptions and is difficult to troubleshoot, despite component replacements and wiring checks. The issue may involve a mismatched pitch trim indication, possibly due to a reused indicator (P/N: 4863-503-80-10) with prior faults and high usage history. Investigation with ATR is ongoing to determine the root cause.

4. Engine & APU Performance

- No instances of IFSD (In-Flight Shut Down) occurred this month.

5. Unscheduled Removals

February 2025, some components with the highest unscheduled removal rates included:

- AIR-UNIT CYCLE (P/N 2205120-4) - 2 removals.
- TEMPERATURE CONTROL VALVE (P/N 5618C000-002) - 2 removals.

Vietnam Airlines
ATR72
EXECUTIVE SUMMARY IN FEBRUARY 2025

- REF UNIT-HEADING, ATTITUDE (P/N 7003360-946) - 2 lần tháo lắp.

Các thiết bị này cũng nằm trong danh sách Top 30 thiết bị có tỷ lệ tháo lắp cao nhất trong 12 tháng qua.

6. Đánh giá – khuyến nghị

- Đội ATR72 là đội tàu cao tuổi, độ tin cậy cất cánh trong tháng 2/2025 của đội bay ATR72 đạt 99.77% tăng so với mục tiêu 99.65%, và cao hơn với trung bình của thế giới 99.07% (năm 2024).
- Đối với B225 quay trở lại khai thác sau thời gian dài bảo quản, tiềm ẩn nhiều rủi ro hỏng hóc phát sinh, cần giám sát chặt chẽ.
- Đề xuất tiếp tục phối hợp với ATR và các nhà cung cấp để đánh giá và nâng cao độ tin cậy của các thiết bị có tỷ lệ lỗi cao.



- REF UNIT-HEADING, ATTITUDE (P/N 7003360-946) - 2 removals.

These components are among the Top 30 unscheduled removal parts in the past 12 months.


6. Evaluation – Recommendations

- The ATR72 fleet consists solely of aging aircraft. The dispatch reliability for ATR72 in February 2025 reached 99.77%, higher than the target of 99.65%, and above the 2024 global average of 99.07%.
- For B225, which has resumed operations after a prolonged storage period, there is a high potential risk of emerging failures, requiring close monitoring;
- Continue coordinating with ATR and suppliers to assess and improve the reliability of components with high failure rates.



ATR72 HVN - Fleet Monthly Overview

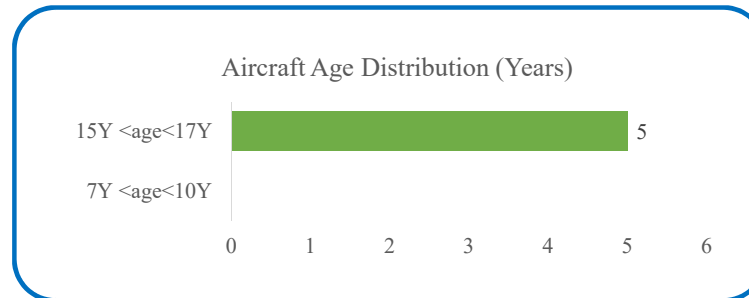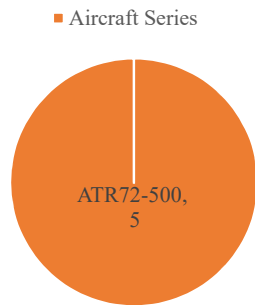

ATR72 Average Daily Utilisation (FH) & Average Flight Duration (FH)

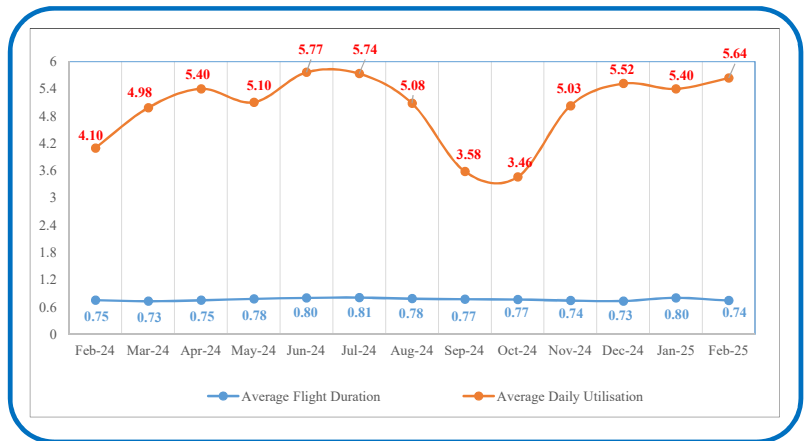


ATR72 Fleet Hour/ Cycles

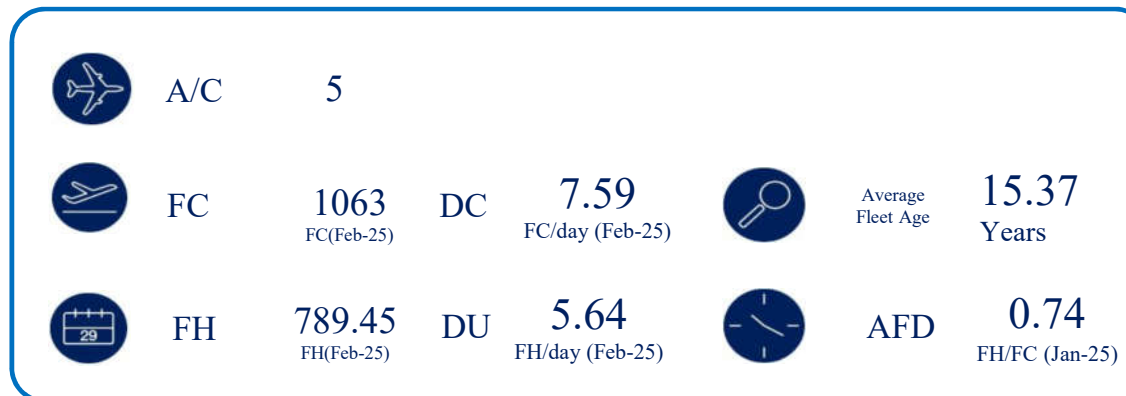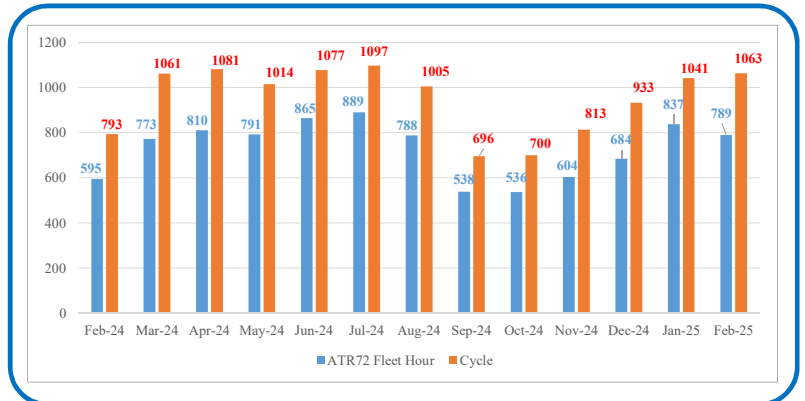


ATR72 HVN - Dispatch Reliability

Previous years DR

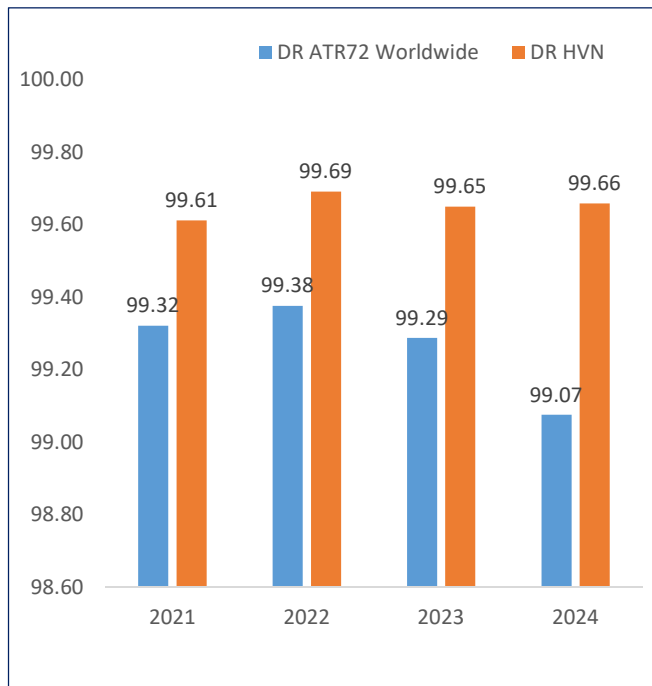

Source: ATR

DR Last 12 Months

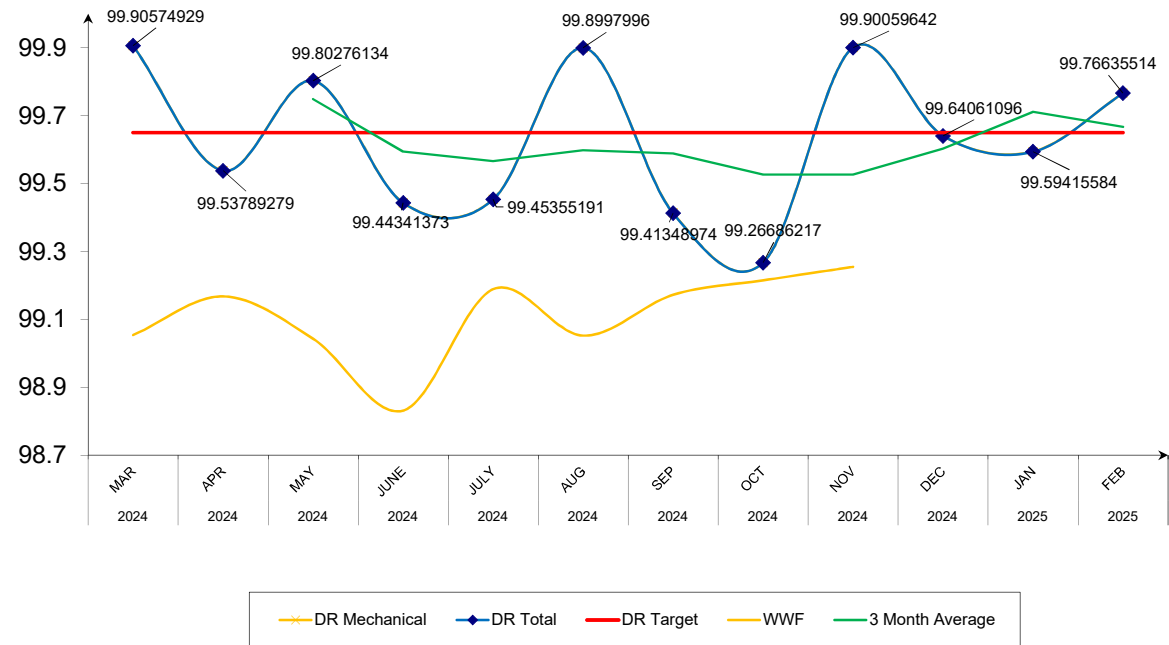

Dispatch Reliability Target: 99.65%
Dispatch Reliability in February 2025: 99.77%; increases in comparison with the Dispatch Reliability Target.

ATR72 Top 10 OI drivers HVN

Top OI last 12 months (Mar 2024 - Feb 2025)

