

LESLIE ELDRIDGE, CHMM, P.E.
WATER, CIVIL AND ENVIRONMENTAL INC.
514 North 16th Street
Boise, Idaho 83702

Project: **Gloria Ford Site, Garden Valley, Idaho – Asbestos Survey**

Ladies and Gentlemen:

Atlas Technical Consultants LLC (ATLAS) has conducted an asbestos survey of the former Gloria Ford Residence, a house near Garden Valley, Idaho, prior to demolition. The analysis results are attached. At the time of the survey, the buildings were vacant and in a state of disrepair. As a result, wiring was not sampled as part of the survey. Furthermore, much of the flooring materials in the building were covered in a 2 to 4-foot thick layer of dirt, and removing it to assess the flooring was not practical. Our survey identified the following Asbestos Containing Materials (ACM):

Sample Number	Material	Location	% Asbestos	Category ¹	Friable ¹	Quantity ²
2-03, 04, 05, 06, 07	Joint compound	Drywall throughout building	2% ³	RACM		
3-09, 10	Surfacing Layer on Greenboard Wall Backing	Living Room (Northeast corner)	2% ³	II	No	~200 ft ²
7-19, 20, 21, 22	Smooth Texture on Drywall	Ceilings in side room, bedroom; throughout hallway, bathroom, and kitchen.	2% ³	II	No	~2200 ft ²
8-24, 25	Orange Peel Texture on Drywall	Dining Room	2% ³	II	No	~800 ft ²

¹Category of building material as it exists in the building, as installed, and as observed during the inspection. Condition may change depending upon demolition or renovation techniques.

²Quantities are estimations only and must be verified by the Abatement Contactor.

³Based on the results being at or near the regulatory limit for abatement, ATLAS recommends point count analysis to aid in quantification.

The United States Environmental Protection Agency's National Emission Standard for Hazardous Air Pollutants (NESHAP), Asbestos Final Rule currently classifies asbestos under three separate categories; they are as follows:

Category I Non-friable ACM: This category includes all asphalt roofing products and resilient flooring products (floor tile and sheet flooring). In theory, these materials consist mostly of cohesive elements which rarely release significant numbers of asbestos fibers into the air, even when they are damaged. In practice, however, roofing and flooring can become brittle or crumbly with age and be damaged enough by construction equipment to release fibers into the air during removal. At this point, the EPA requires special methods during removal and handling of the materials to protect people against fiber release. If, on a specific renovation or demolition project, there is a chance of fiber release associated with roofing or flooring, we assume that special methods (abatement by

removal) will be required. In the case of intentional burning, all ACM, friable or non-friable, must be removed prior to any such activities.

Category II Non-friable ACM: This category includes all other non-friable asbestos containing materials. These materials must always be removed using special abatement methods if they are expected to be disturbed or damaged in any way during renovation or removal activities.

Regulated Asbestos Containing Materials (RACM): All friable asbestos containing materials, including Category I and II materials that have become or will become friable due to renovation or demolition activities. Friable asbestos is defined as any material containing more than one percent asbestos that, when dry, can be crumbled, pulverized, or reduced to powder by hand pressure. These materials must always be removed using special abatement methods prior to any renovation or demolition activity.

ATLAS was able to perform some limited destructive sampling, which included exposing walls, ceilings, removing floor coverings, etc. However, ATLAS cannot guarantee that hidden ACM is not still present in the building without complete deconstruction of the structure. Additional sampling may be necessary if demolition or renovation activities expose previously unidentified suspect materials. During demolition or renovation activities, a National Emission Standard for Hazardous Air Pollutants (NESHAP) Competent Person should be on site in the event additional ACM is discovered and/or disturbed as outlined in Environmental Protection Agency (EPA) regulations 40 CFR Part 61.

ATLAS is pleased to have this opportunity to serve you and looks forward to a continuing relationship as your environmental consultant. If you have any questions regarding this letter or the attached analysis result please feel free to contact ATLAS at **(208) 376-4748**.

Respectfully Submitted,

A handwritten signature in black ink, appearing to read "David Decker". The signature is fluid and cursive, with a long horizontal stroke extending to the right.

David Decker
Project Manager

A handwritten signature in black ink, appearing to read "Jennifer Babione". The signature is cursive and elegant, with a prominent loop at the end.

Reviewed by: Jennifer Babione
Environmental Services Asst. Manager

LESLIE ELDRIDGE
WATER, CIVIL, AND ENVIRONMENTAL INC.
514 N. 16TH ST.
BOISE, ID 83702

ATLAS FILE #: B211968e

Project: Gloria Ford Site

Date Received: 7/19/2021

P.O. Number: _____

Date Reported: 7/26/2021

Atlas Technical Consultants, LLC has conducted the following survey of the above-mentioned project per the client's request. Please reference the Cover Letter for location, quantity, and condition of each of the materials sampled below.

ASBESTOS BULK SAMPLE ANALYSIS REPORT

Sample Number	Lab Number	Sample Type, Location, and Description	Asbestos Fibers	Non-Asbestos Fibers	Non-Fibrous Materials	Comments
1-1	B180608	Layer 1 – sheet vinyl flooring-kitchen-stone mosaic pattern compact resilient	NAD		100% other	
		Layer 2 – backing-green fibrous	NAD	85% cellulose 10% synthetic fiber	5% other	
		Layer 3 – mastic-cream pliable	NAD		100% mastic	
1-2	B180609	Layer 1 – sheet vinyl flooring-dining room-stone mosaic pattern compact resilient	NAD		100% other	
		Layer 2 – backing-green fibrous	NAD	85% cellulose 10% synthetic fiber	5% other	
		Layer 3 – mastic-cream pliable	NAD		100% mastic	
2-3	B180610	Joint compound-side room ceiling-grey semi compact powdery with fibers	2% Chrysotile		98% other	
2-4	B180611	Joint compound-kitchen ceiling	PS			
2-5	B180612	Joint compound-hallway				
2-6	B180613	Joint compound-bathroom				
2-7	B180614	Joint compound-bathroom				
3-8	B180615	Paint on green board-living room north east corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No surfacing or felt present
3-9	B180616	Layer 1 – surfacing-living room north east corner-white semi compact powdery with fibers	2% Chrysotile		98% other	
		Layer 2 – green board-white semi compact powdery with fibers	NAD	10% cellulose	90% other	
		Layer 3 – felt-black bituminous fibrous	NAD	80% cellulose	20% other	
3-10	B180617	Green board-living room north east corner	PS			
4-11	B180618	Asphalt shingle-roof outside north east corner kitchen-black bituminous fibrous	NAD	40% cellulose	60% other	
4-12	B180619	Asphalt shingle-roof north east corner near bedroom-black bituminous fibrous	NAD	40% cellulose	60% other	
5-13	B180620	Felt-under cedar shake south east corner of roof- black bituminous fibrous	NAD	70% cellulose	30% other	
5-14	B180621	Felt-under cedar shake south west corner of roof- black bituminous fibrous	NAD	70% cellulose	30% other	
6-15	B180622	Paint on drywall-living room ceiling north west corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No surfacing present
6-16	B180623	Paint on drywall-living room ceiling north west corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No surfacing present

Sample Number	Lab Number	Sample Type, Location, and Description	Asbestos Fibers	Non-Asbestos Fibers	Non-Fibrous Materials	Comments
6-17	B180624	Paint on drywall-living room ceiling north west corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No surfacing present
7-18	B180625	Paint on drywall-side room ceiling-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No texture present
7-19	B180626	Layer 1 – smooth texture-kitchen south east corner-tan semi compact powdery with fibers	2% Chrysotile		98% other	
		Layer 2 – drywall-white semi compact powdery with fibers	NAD	10% cellulose	90% other	
7-20	B180627	Smooth texture on drywall-hall ceiling north side	PS			
7-21	B180628	Smooth texture on drywall-bedroom ceiling east wall				
7-22	B180629	Smooth texture on drywall-bathroom north west corner				
8-23	B180630	Paint on drywall-dining room ceiling south side-white semi compact powdery with fibers	NAD	10% cellulose	90% other	No texture present
8-24	B180631	Layer 1 – orange peel texture-dining room north west corner-tan semi compact powdery with fibers	2% Chrysotile		98% other	
		Layer 2 – drywall-white semi compact powdery with fibers	NAD	10% cellulose	90% other	
8-25	B180632	Orange peel texture on drywall-dining room south west corner	PS			
9-26	B180633	Unfinished drywall-shed north east corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	
9-27	B180634	Unfinished drywall-shed south east corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	
9-28	B180635	Unfinished drywall-shed south west corner-white semi compact powdery with fibers	NAD	10% cellulose	90% other	

Sample component percentages may not total 100% for multi-layered samples

Glossary of Acronyms

NAD - No Asbestos Detected

PS – Positive Stop – Not Analyzed

AFC - Asbestos Found As Contaminant

TRACE - Detectable but not quantifiable

IS - Insufficient Sample -percentages may be inaccurate

Sampled by: Client



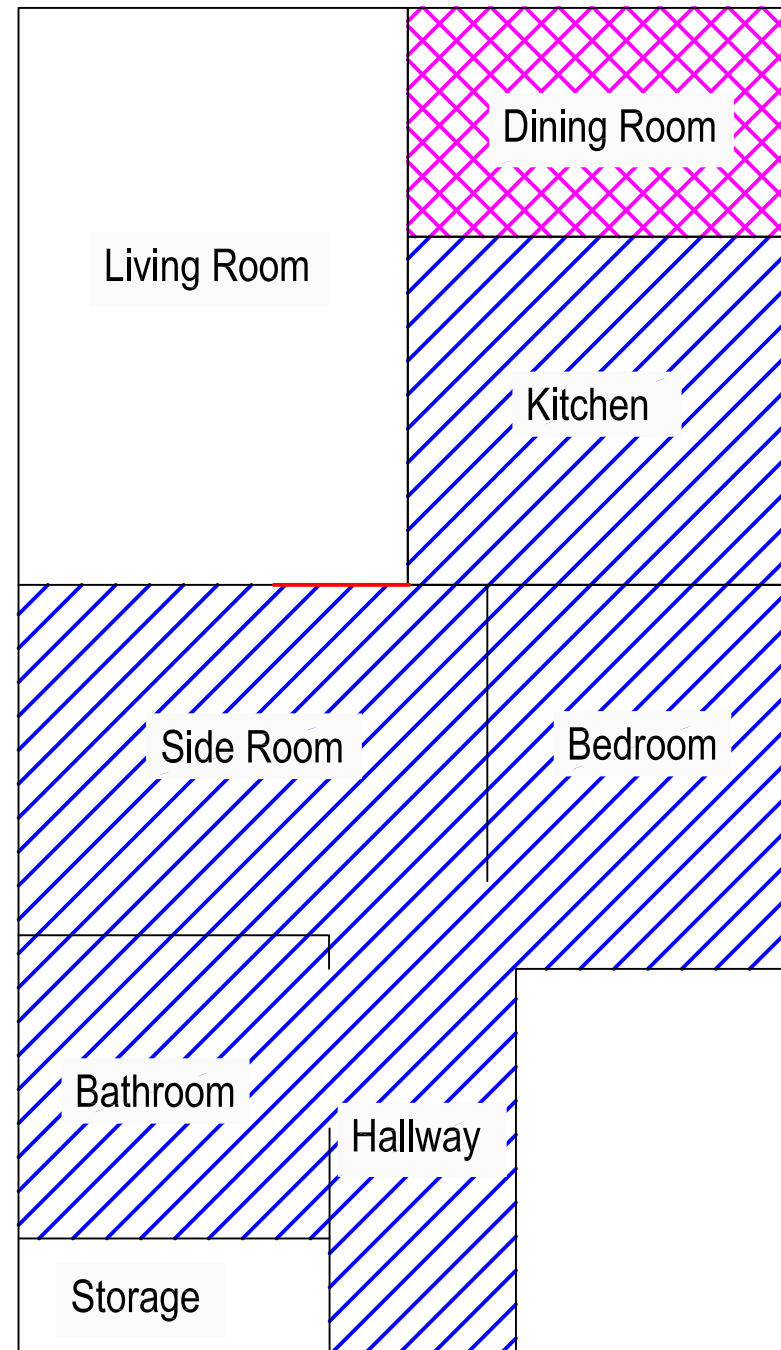
Analyzed by: David Kesner
Chief Microscopist

Sample components are identified using polarized light microscopy (PLM) coupled with dispersion staining methods as determined by visual estimation. Small asbestos fibers may not be detected by PLM due to the resolution limitations of the optical microscope. Detecting asbestos in non-friable organically bound materials is not consistently reliable using PLM analysis. This test report relates only to the items tested in the sample as submitted to the laboratory.

Analysis method: Polarized Light Microscopy (PLM) by EPA/600/R-93/116 with Central Stop Dispersion by NIOSH 9002
American Industrial Hygiene Association (AIHA) Performance Analytical Testing (PAT) Laboratory Number 101571

ACM Location Map

Plate 1

**MAP NOTES:**

- Not to Scale

LEGEND

Positive ACM: Joint
Compound Throughout
Surfacing on Greenboard
Wall Backing



Positive ACM: Smooth
Texture on Drywall



Positive ACM: Orange Peel
Texture on Drywall

**Gloria Ford Site**

Garden Valley, ID

Drawn by: TJ
July 28, 2021
Drawing: B21968e



2791 S. Victory View Way
Boise, ID 83709

Phone: (208) 376-4748
Fax: (208) 322-6515
Web: oneatlas.com