Proprietary to General Electric Company
Direction 5438996-8EN, **Rev#** 9
Brivo CT385 Series Service Methods (Adv)
Module Version 3.0, **Version Date** 6/7/13

HHS Scans (Adv)

(Click Here for Summary Version)

1 Personnel Requirements

Required Persons	Preliminary Reqs	Procedure	Finalization
1	Not Applicable	30 mins	Not Applicable


2 Overview

This module explains how to run the “HHS Scans” procedure, which runs an automated scan sequence and measures the kV and mA at times during the scan to ensure that the system is properly calibrated.

Last Revised:	6 June, 2013

3 Procedure

1. Launch the [Diagnostics] -> [X-Ray Generation] -> [GENERATOR TOOL] from the Service Desktop.

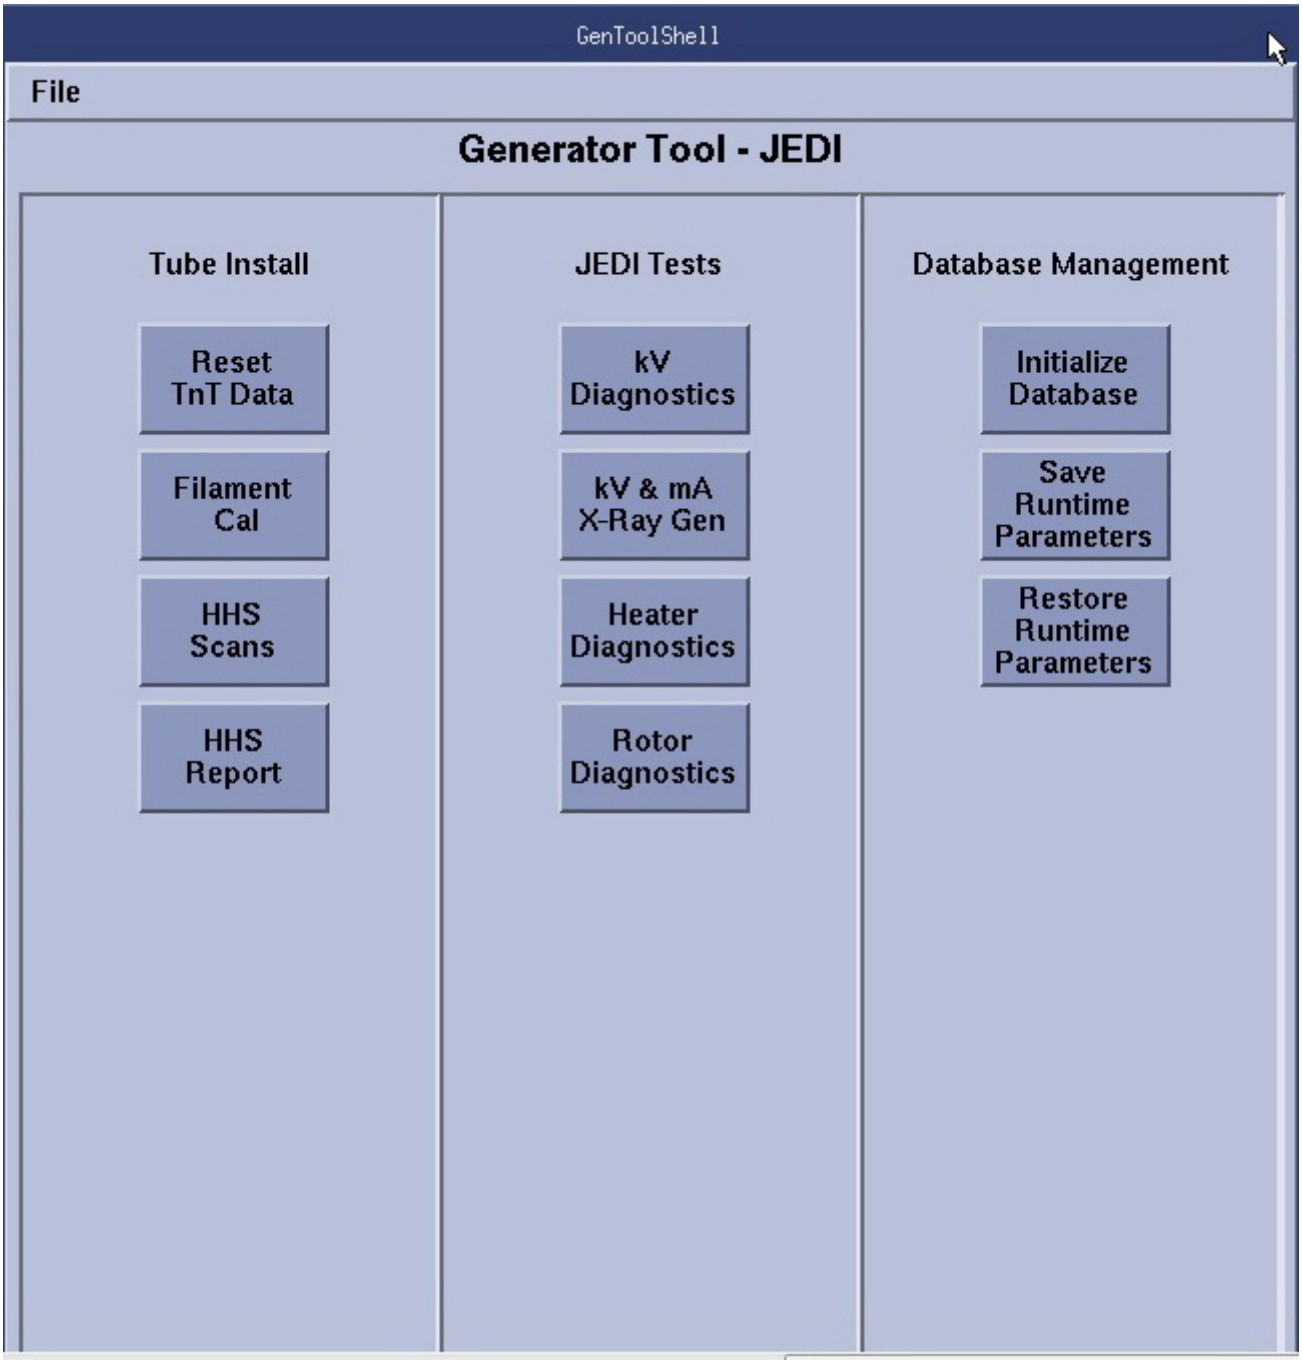

2. Launch the [HHS SCANS] tool.
3. Run the sequence.
4. The tool will let you know if it passes. The scan data will be stored on the system and can be viewed using the “HHS Reports” tool. Record results in the appropriate GE e4879 Certified Component Verification form or GE Data Report Planned Maintenance Schedule form.
5. For failed results, isolate root cause by running the following procedures in order shown below and perform appropriate corrective action.
    a. *Meter Verification*
    b. *HV Tank Feedback Resistor Verification*
    c. *Filament Calibration*

4 Finalization

Store data form with system history records.

Back to top