
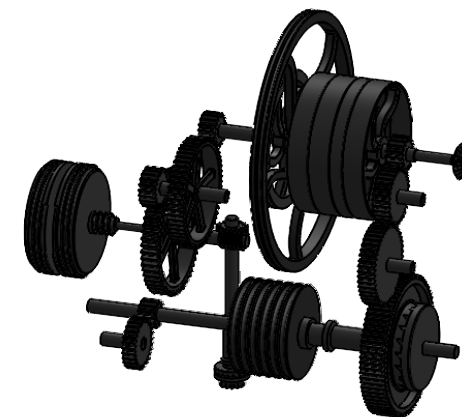


Part #	Description
F	Main shaft
F1	Neutral gear (loose pulley running on a sleeve)
F2	Pulley (connected by the sleeve to F8)
F3	Pulley (fastened to shaft with F7) (controls draw out)
F4	Pulley (attached to F5 run loosely on the shaft) (controls the accelerated speed)
F5	Grooved pulley (Attached to F4 runs loosely on shaft) (controls the accelerated speed)
F6	Grooved pulley (Fast to the shaft) (when belt is on F3, drives spindles during delivery and drawing of the roving i.e. till the carriage has reached the end of the stretch)
F7	Gear (fast to shaft)
F8	Gear (controls back off and draw in)
F9	Bevel Gear
F10	Gear (on a stud meshed with F7)
F11	Gear (fast to F10 meshes with F12)
F12	Gear (loose on draw out shaft G)
F13	Part of clutch (fast to F12)
F14	Second part of clutch (slides on a key set into the shaft G)
G	Drawing out Shaft
G1	Draw out scroll (fixed to G when G winds Rope G2 winds up one side and Rope G3 unwinds on the other side)
H	Second drawing out shaft bound to F by I band
H1	Clutch Pulley fast to shaft H
H2	Friction clutch (engages into H1 with force from H3)
H3	Shaft sleeve (forces H2 with force from H4)
H4	Gear (transfers power from H5 to H3 sleeve)
H5	Gear (Transfers power from H6 to H4)
H6	Gear (Transfer power from F8 to H5)
H7	Clutch (meshes with clutch H8)
H8	Clutch (when engaged with H7 drives H shaft and engages to reverse the spindles)
J	Shaft (connected to G shaft by clutch F14)
J1	Gear on the end of upright shaft (meshes with worm gear on L shaft)
J2	Upright shaft, lower end is half of clutch L3
J4	Clutch (when engaged drives J5)
J5	Gear that spins an external rack that eases up the carriage

Exploded View

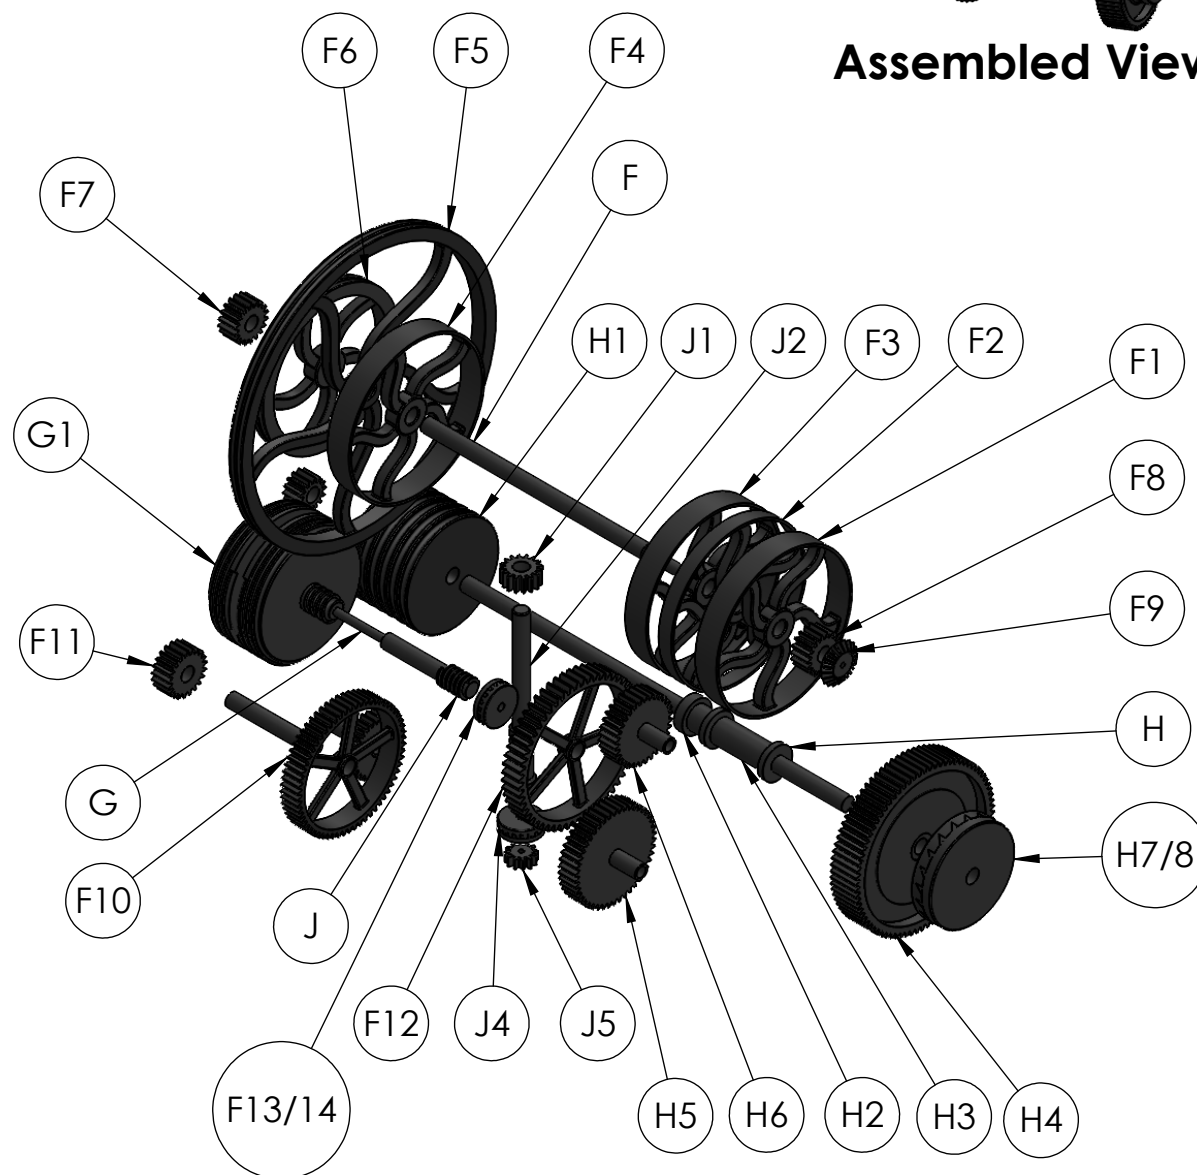

Assembled View