

Engine Coolant Concentration

19-22MY Jaguar E-PACE, F-PACE, F-TYPE, XE, XF, XJ
19-22MY Land Rover Discovery, Discovery Sport, Defender,
Range Rover, RR Sport, RR Evoque, RR Velar

Customer Voice:

- Customer reports that low coolant lamp on, coolant leak.


Technical Description:

- Previous cooling system related repair, coolant concentrations well below technical levels causing premature component failure.

Status:

- The engine cooling system must be maintained at the correct coolant concentration and specification to ensure cooling efficiency and prevent corrosion and frost damage.
- Failure to follow this instruction may result in damage to the engine, transmission and any other components within the cooling system.
- Please ensure when carrying out repairs that require the coolant to be fully/ partially drained or recycled, that the correct concentration of anti-freeze and water listed in the TOPIX Workshop Manual under Engine Cooling Specification for the appropriate vehicle derivative is achieved using the Refractometer / Hydrometer

SSM 75845 / 75846

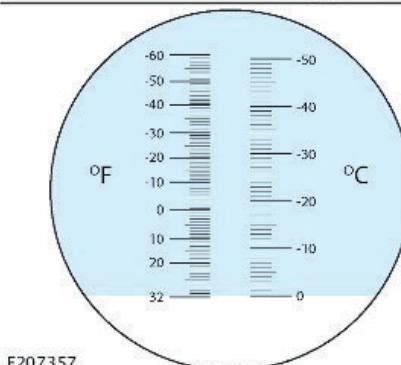

E207357