
NAVIGATION RECEIVER ASSY REPLACEMENT

6708Y_03

HINT:


COMPONENTS: See page 67-1

- 1. REMOVE AIR CONDITIONER CONTROL ASSEMBLY (See page 71–16)
- 2. REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB-ASSY CENTER (See page 71-16)

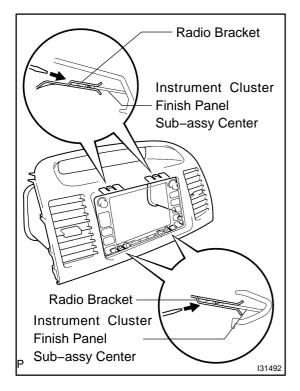


3. REMOVE NAVIGATION RECEIVER ASSY

(a) Insert a screwdriver at indicated point and remove the navigation receiver assy from instrument cluster finish panel sub–assy.

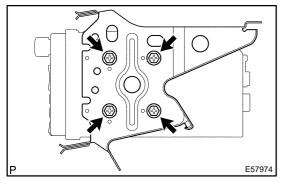

4. REMOVE RADIO BRACKET NO.1

(a) Remove the 4 screws and radio receiver bracket No.1.

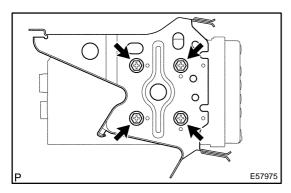

5. REMOVE RADIO BRACKET NO.2

(a) Remove the 4 screws and radio receiver bracket No.2.