
## RADIO RECEIVER ASSY REPLACEMENT

6709M 03

HINT:


COMPONENTS: See page 67-1

- 1. REMOVE AIR CONDITIONER CONTROL ASSEMBLY (See page 71–16)
- 2. REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB-ASSY CENTER (See page 71-16)

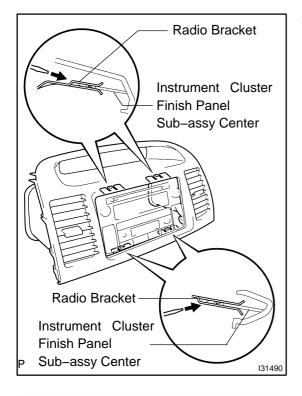


## 3. REMOVE RADIO RECEIVER ASSY

(a) Insert a screwdriver at indicated point and remove the radio receiver assy from instrument cluster finish panel sub-assy center.

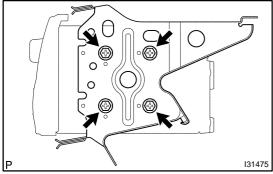

## 4. REMOVE RADIO BRACKET NO.1

(a) Remove the 4 screws and radio bracket No.1.

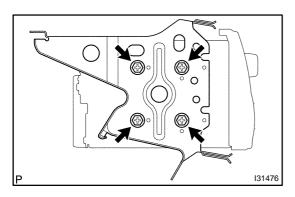

## 5. REMOVE RADIO BRACKET NO.2

(a) Remove the 4 screws and radio bracket No.2.