
## CLOCK ASSY REPLACEMENT

710EV 03

## HINT:

- COMPONENTS: See page 71-9.
- Installation is in the reverse order of removal.
- 1. REMOVE AIR CONDITIONER CONTROL ASSEMBLY (AUTO AIR CONDITIONING) (SEE PAGE 71-16)
- 2. REMOVE AIR CONDITIONING PANEL SUB-ASSY (MANUAL AIR CONDITIONING) (SEE PAGE 71-16)
- 3. REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB-ASSY CENTER (SEE PAGE 71-16)

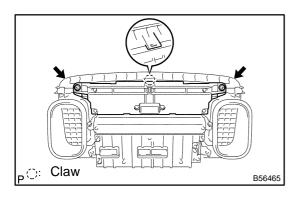

## 4. REMOVE CLOCK ASSY

- (a) Remove the 2 screws.
- (b) Disengage the claw and remove the clock assy.