
CLOCK ASSY REPLACEMENT

710ED 0

HINT:

COMPONENTS: See page 71-7

- 1. REMOVE AIR CONDITIONER CONTROL ASSEMBLY (See page 71-10)
- 2. REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB-ASSY CENTER (See[page[71-10)

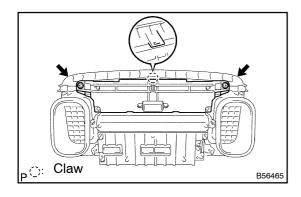

3. REMOVE CLOCK ASSY

- (a) Remove the 2 screws.
- (b) Disengage the claw and remove the clock assy.