

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 66070

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	IMAVERE
IMO Number:	9612325
DOC Company:	Grona Shipmanagement GmbH & Co KG
Place of Inspection:	Latvia, Riga
Name of Inspector:	Janis Zustars
Inspection Completion Date:	10/16/2025 12:00:00 AM
Operational Variant:	The vessel has an ice class notation, is currently navigating or intends to navigate in icy areas or possesses a polar water certificate

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.


Number of Findings: 19

Section 2: Certification and Personal Management

2.10 Are the limits of blood and breath alcohol contents in the drug and alcohol policy equal to, or less than the STCW mandatory alcohol limit? (V&M)

Findings: A zero-alcohol policy was implemented on board the vessels in the fleet. However, the same policy does allow ordering and serving alcohol on board (a stock list of light and strong alcoholic beverages was demonstrated). However, control of the distribution of alcohol available on board is not prescribed.

Attachments:

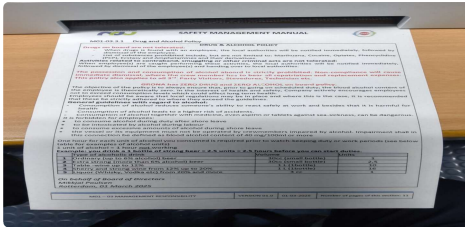

[Q210_1760597355467.jpg](#)

Section 3: Navigation

3.18 Can the master and watch-keeping officer demonstrate a familiarity with the use of ECDIS? (V)


Findings: The person in charge of navigation was not familiar with the function "Danger" for manually plotted objects, control of Navtex messages (numerous obsolete and erratic messages were found on charts), and the vertical datum for verification of vertical objects on ENC's.

Section 4: ISM System


4.4 Does the master periodically review the effectiveness of the onboard Safety Management System, report the findings to shore based management and receive feedback from them? (M)

Findings: The Master SMS review does not specify the manuals and procedures of the Company SMS. The checklist for SMS review includes log books, records, audits, drills, and crew knowledge. Thus, evidence of SMS review could not be verified during the inspection.

Attachments:

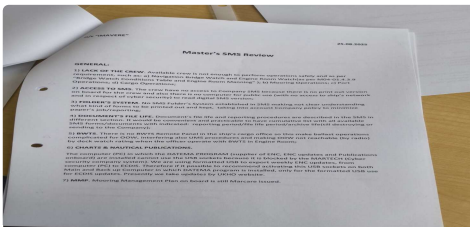

[Q404_1760598870351.jpg](#)

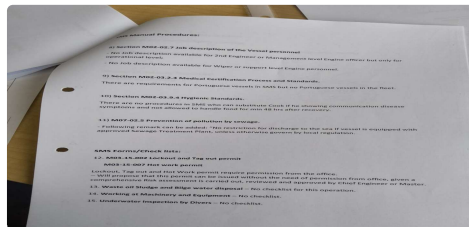

[Q404_1760598876851.jpg](#)


4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: The responsible person was not familiar with terms TLV, TWA, STEL, OEL and was not familiar with procedure for detection of the toxic gases.

4.7 Are procedures in place for the control of hot work, are they incorporated in the safety management system and is there documented evidence of compliance? (M)

Findings: The risk assessment associated with the recent hot works carried out on 26/Aug/2025, 11/Jan/2025 were not included hazards of fire or explosion. Also, the Risk assessments were completed by a single person and not the team; additionally the risks consequences and likelihood were pre-entered by the company and could not be amended by the ship's staff.

Attachments:

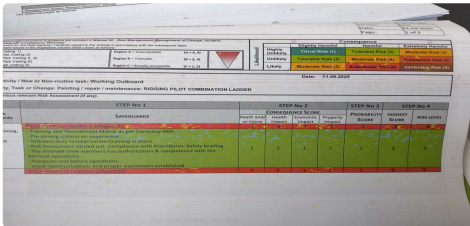

[Q407_1760603306895.jpg](#)

4.9 Is there a schedule of drills and exercises to address potential emergency shipboard situations and is it being conducted effectively? (V)

Findings: The records of launching or simulation launching drills for the free fall lifeboat were not available.

4.12 Are on-board safety meetings held regularly are they reviewed by the vessel's manager and feedback provided where necessary? (M)

Findings: The last three safety meetings were held on the navigational bridge while the vessel was located at anchor (during the navigational watch, disturbance to the OOW).


4.16 Are portable gas detectors suitable for atmosphere testing of enclosed spaces provided; in good condition; calibrated in accordance with the manufacturer's instructions, and are officers trained and competent with their operation? (V & M)

Findings: The span gas bottle was found empty during the test of the multiple gas analyser. Also, the Officer in charge was not aware of the password for entry to the calibration menu of gas analysers (calibration was performed only at the service company once per year).

4.17 Are the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

Findings: The pressure gauge and regulator were not available at the Acetylene line workshop side cabinet. Also, welding hoses were over 5 years old and, as required by the technical report, needed replacement. Spares were ordered, and the crew was waiting for the delivery.

Attachments:

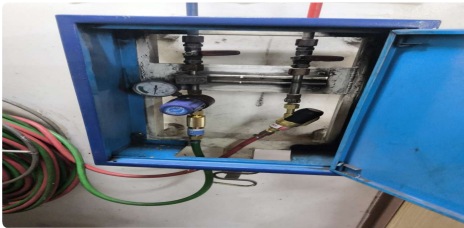


[Q417_1760609480744.jpg](#)


4.30 Are firemen's outfits including their equipment, two-way portable radiotelephone apparatus for fire-fighter's communication and breathing apparatus in good condition, fit for purpose and available for instant use? (V & M)

Findings: The Firemen's outfits available on board were not of the "Entry firefighting type" as required by EN469. The suits were made of light aluminium material and were suitable only for close-proximity firefighting. Therefore, the suits on board were not suitable for the entry and rescue of persons within the accommodation block, Engine Room space, etc., during the fire.

Attachments:

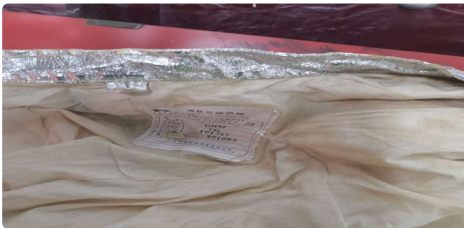

[Q430_1760532366282.jpg](#)

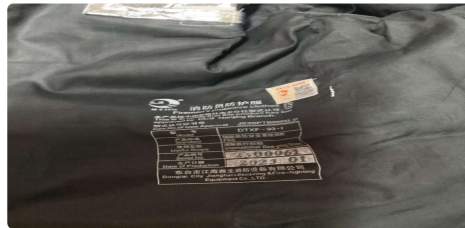


[Q430_1760532416179.jpg](#)

- 4.31 Is the operation and maintenance of the breathing apparatus air recharging system (where fitted) incorporated in the ship's safety management manual, and has the annual air quality check for breathing apparatus air recharging systems been carried out? (V & M)

Findings: The BA compressor air quality test was based on obsolete requirements of the industry and the latest requirements of EN12021:2014 (e.g., CO value, odour & taste missing).

Attachments:

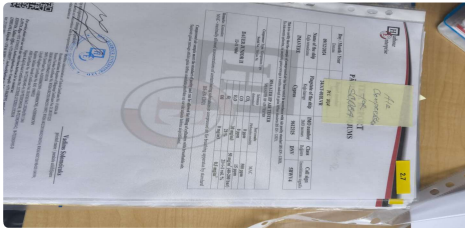

[Q431_1760604624942.jpg](#)

Section 5: Pollution Prevention and Control

- 5.9 Are the arrangements for detection and disposal of water from forecastle store and chain locker in good order, and are measures in place to prevent the accidental discharge of oil? (V)

Findings: The overboard valve at forecastle bilge system was not sealed to prevent accidental opening. Rectified during the inspection.

- 5.12 If ballast tanks are located adjacent to fuel oil tanks, or there is a possibility of contamination by hydraulic oil, are ballast tank contents being sampled to ensure there has been no contamination of the water by oil prior to discharge? (V)

Findings: The records was not available for the inspection of the water surface of the ballast tanks prior to deballasting. Hydraulic valves were installed within the tanks, also ballast tanks 2W and 1W were adjacent to the fuel tanks.

- 5.25 Is the ballast control panel, including the pressure gauges, draft gauges, remote control system for the ballast line and ballast valves in good order and maintained regularly?

Findings: The operating time of the hydraulically operated ballast valves was not regularly checked, and the manufacturer's guidance was not referred to for optimum opening and closing times of the ballast valves. The manufacturer's requirements were available on board.

Section 6: Ship's Structure

6.2 Does the SMS include procedures for regular inspection of cargo holds, ballast tanks, void spaces, trunks, duct keel and cofferdams by the ship's personnel and are records maintained? (V)

Findings: There were no requirements of the Company for inspection and records to be kept for cargo holds. As reported, the cargo holds were inspected after each discharge operation.

Section 7A: Fuel Management (Oil Fuel)

7A.5 Are there procedures for analysis of fuel, lubricating and hydraulic oils, and are oil sampling requirements aligned with equipment manufacturer's recommendations? (V & M)

Findings: The oil samples were not taken for hydraulic valves, lifeboat, and rescue boat davits, as per the history of analyses.

Section 11: Radio and Communication

11.1 Has a qualified person other than the master been designated to handle distress and safety radio communication? (V)

Findings: The person in charge of distress communication had demonstrated only one option ('Distress'push button) out of three methods for sending a distress message using the Sat-C unit.

Section 13: Machinery Space

13.14 Are the major components of the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

Findings: All cylinders of Aux. DG No. 2 were overdue (over 2300 hours) for a plunger assembly check due to missing spares. Spares were on order.

Attachments:



[Q1314_1760609196118.jpg](#)

13.17 Is the emergency equipment tested, in good condition and the result recorded? (V)

Findings: The risk assessment was not completed prior test of the emergency equipment as onload test of EDG, quick closing valves, emergency stops, etc.

Vessel's Master Name

Viktor Sotnykov

Vessel's Master Email Address

imavere@skyfile.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.


Vessel's Master Signature:

A handwritten signature in black ink, appearing to be 'Viktor Sotnykov', written over a horizontal line.

Inspector Name

Janis Zusters

Inspector's Signature:

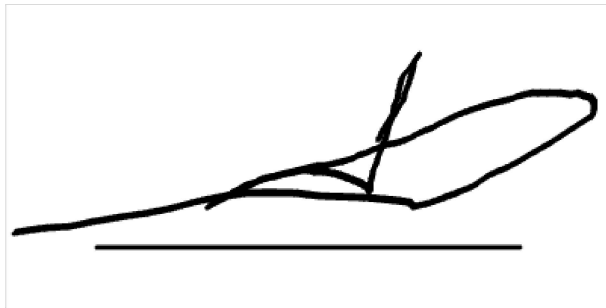A handwritten signature in black ink, appearing to be 'Janis Zusters', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.



www.rightship.com



dryinspections@rightship.com



RightShip

MELBOURNE

Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

+61 3 8686 5750

LONDON

4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

+44 203 872 5900

SINGAPORE

20 Cecil Street, PLUS,
#13-06
Singapore 049705

+65 3138 3855

HOUSTON

Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

+1 832 770 8200

MALTA

The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Ghawdex
VCT 2517, Malta