

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 70977

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	KIRAN ISTANBUL
IMO Number:	9576973
DOC Company:	Pasifik Gemi Isletmeciligi ve Ticaret AS
Place of Inspection:	Egypt, Damietta
Name of Inspector:	Ahmed Awad
Inspection Completion Date:	4/23/2026 12:00:00 AM
Operational Variant:	A bulk carrier that is carrying grain cargo - the cargo spaces had been fumigated at least once in the past 12 months

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

Number of Findings: 18

Section 2: Certification and Personal Management

2.1 Is the latest Class Survey Status available, are all Statutory Certificates listed within it valid, is the vessel free of any overdue Conditions of Class, and are all classification and statutory surveys up to date?


Findings: There was one Conditions of Class was recorded as follow : Master reported Cargo Hold No. 1 tanktop plating deformed and punctured between frames 199-203 and 209-215, IWO IL1-4. Remote survey requested to verify temporary repairs: Crack ends drilled to stop propagation. Doubling plates fitted: 1700x700x25mm, 2000x400x25mm. H-beam reinforcement (180x96x6.5x1230mm) on frames 212-213 between BL3 and IL3. Post-repair hydrostatic test on No.1 starboard DB tank showed no leaks; repairs effective meantime. Permanent repairs required under surveyor satisfaction by next ITSS.

Section 3: Navigation


3.6 Has the Master/Pilot information exchange been taking place effectively and is the standard pilot card being completed as required? (V)

Findings: There was no records that the when Master/Pilot information exchange was completed and the time of the transfer of conn between the Master and Pilot.

Attachments:

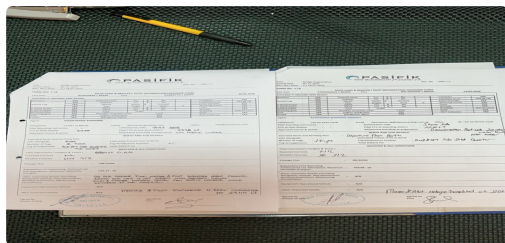

[Q306_10b588e0-1d25-423f-8ef7-ac77eb83e3ab.jpg](#)

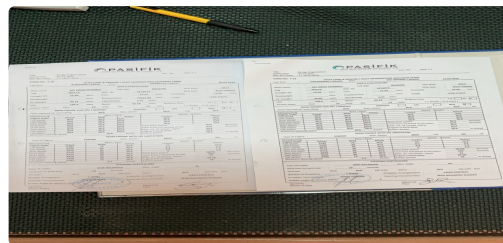


[Q306_fd46b667-f8f7-43f5-b505-bbb7a6c53fa1.jpg](#)

Section 4: ISM System


4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: The vessel was provided with three multi gas detector type xxxx. None of the interviewed senior officers were aware of the time required to clear the air from a 12m hose based on the pump airflow/suction capacity to ensure that the reading were a true representation of the atmosphere inside the space being measured. 2. There were no training records onboard to indicate that any of the crew members were trained/familiarized on the use of the multi gas detector onboard. 3.


Attachments:

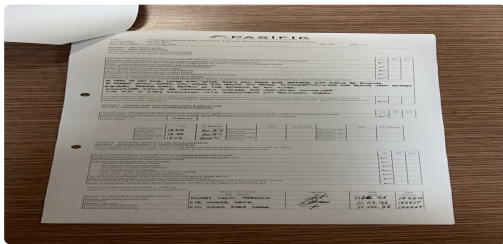

[Q405_127f7504-4d27-4eea-9245-d919dd74c095.jpg](#)

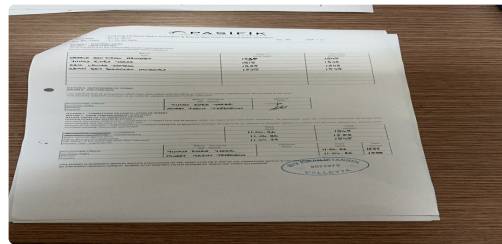

[Q405_609b8af3-fd71-40e0-a39b-9a37ecbbcd50.jpg](#)

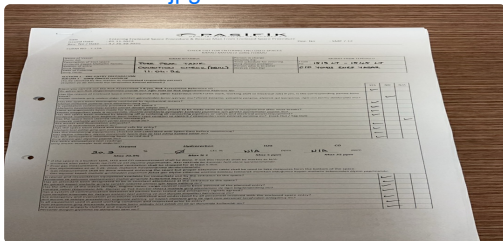


[Q405_fb1c00da-a707-40c6-b10a-6ef119e4e381.jpg](#)


4.7 Are procedures in place for the control of hot work, are they incorporated in the safety management system and is there documented evidence of compliance? (M)

Findings: The most recent Hot work permit was sighted. The permit did contain a description of the work, did not list all the job, nor the tools used or the methods being employed.

Attachments:

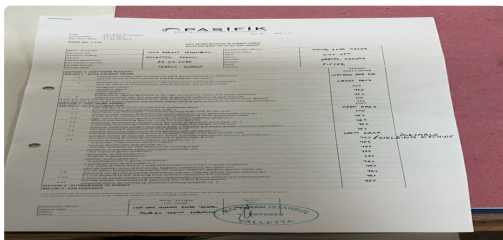

[Q407_57396245-af85-4aed-8960-9bcd081d84e0.jpg](#)

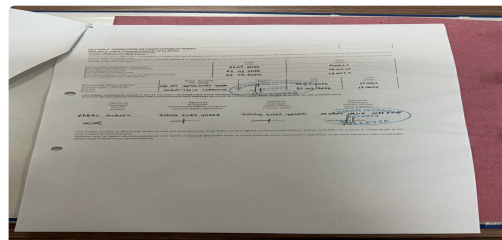


[Q407_e67f2a66-d442-421f-9527-ebc639e031f9.jpg](#)

4.11 Has a PPE Matrix for use of personal protective equipment been provided and is it being worn as required?

Findings: The use of the self retraceable fall arrestor was not included in the working aloft check list/permit. The crew member didn't utilize adequate personnel protective equipment during working aloft or in a great high.

Attachments:

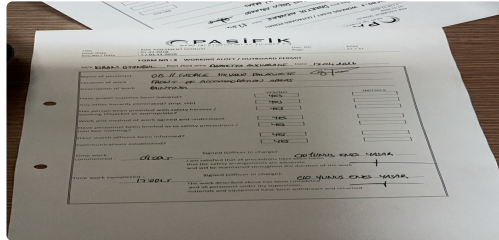

[Q411_516a3d67-20c3-42af-89d3-76be83de313a.jpg](#)

4.18 Are the lifeboats, rescue boat and davit-launched life raft their equipment and launching arrangements serviced periodically in good condition, and are the crew familiar with the launching procedure and operation?

Findings: The hydraulic hose fitting/coupling for the rescue boat davit, located between the outlet line and the hydraulic pump, was found to be wasted. There was no evidence that these flexible hydraulic hoses have been replaced within the past five years.


4.37 Are pilot ladders used for pilot transfer in good condition, and inspected regularly, clearly identified with tags or with permanent marking and are maintenance records available and, are crew members capable of demonstrating proper rigging of the pilot-ladder arrangement?

Findings: The Record of Approved Safety Equipment was not updated to reflect the material, manufacturer, and the standard to which the pilot ladder was made and tested.


Attachments:



[Q437_88cf813d-76fb-4988-85a3-8b4c298144ea.jpg](#)

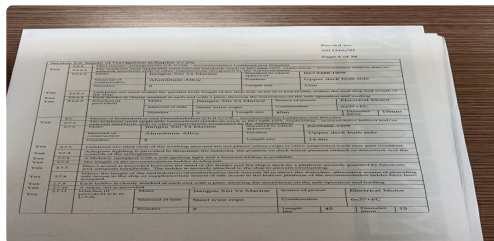

[Q437_8b7edb80-d0c6-4842-b930-9f8b2aa385cc.jpg](#)

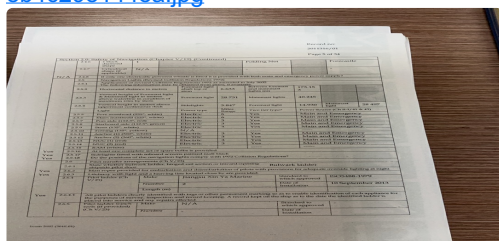

[Q437_fa895b5c-6c9b-407e-a0c7-bf7c1b0e665a.jpg](#)

Section 7A: Fuel Management (Oil)


7A.7 Are bunkering and oil fuel transfer procedures carefully planned and executed in accordance with industry standards, are the details of the last operation in accordance with industry standards, is the vessel equipped with a procedure for sampling the oil fuel used on board, and are bunker samples stored in a sheltered location? (V)

Findings: The vessel was utilizing Bunkering check list. However this check list didn't include the following: 1) vessel stability, list and trim during various stages of bunking. 2) Proper identification and Markings of the valves on bunker lines. 3) Emergency procedures. 4) A schematic diagram of the bunker system and proper valve line- up.

Attachments:



[Q7a07_20893eac-4ea7-44d0-8ee5-03f10b06cdb1.jpg](#)

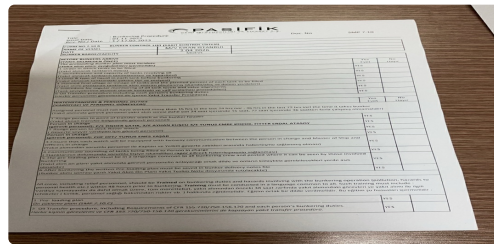

[Q7a07_4725230f-386d-4607-9c78-7185a43d12f7.jpg](#)

Section 9A: Hatch Cover and Lifting Appliances

9A.13 Are the following parts of the hatch covers, where applicable, all in good order and do they appear to be well maintained?

- Wheels/bearings or trackway
- Hydraulic system including hoses
- Chains
- Link pin and safety pin
- Cargo holds' ventilator on the side and end of hatch panel

Findings: Hatch covers No. 1 and 2 (forward and aft panels) were severely corroded with accumulated rust scaling and buildup, clearly visible.

9A.16 Are officers familiar with emergency hatch cover operation arrangements and is there evidence of effective training of personnel available on board?


Findings: The vessel was provided with portable electric pump for emergency hatch cover operation. However there was no available records that the effective training/ Drill was completed.

Section 10: Mooring Operations

10.1 Has the company established guidelines and procedures for the inspection, maintenance and wear zone management of the mooring lines and are they being implemented? (V & M)

Findings: There was no spare mooring lines available on board.

Attachments:

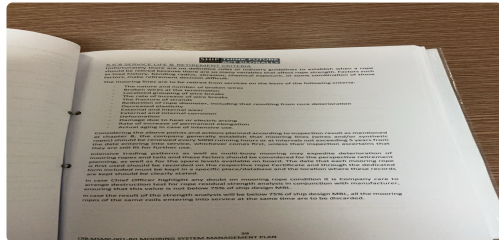

[Q1001_9853fa28-1bfb-440d-a1b3-216369f6b1d8.jpg](#)




[Q1001_b276035d-e02b-465b-a8a3-aa7418963f65.jpg](#)

10.5 Is there a procedure for testing the winch brake rendering setting and is it being tested regularly? (V & M)

Findings: Break holding capacity test was calculated based on the mooring ropes MBL and not the SDMBL (ship design MBL). Furthermore, none of the crew members was aware of the SDMBL. It was not referenced in the mooring line management plan.

Attachments:

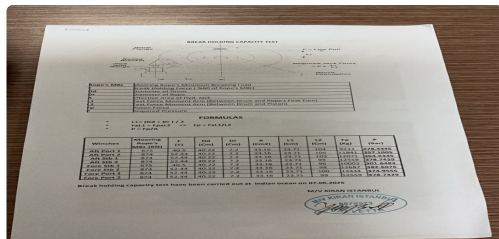

[Q1005_ec9521f4-b34a-4410-80bb-062088b945f8.jpg](#)

10.6 Are mooring lines correctly deployed and tended? (V)

Findings: . The ship utilized a combination of mooring lines at the stern with varying The ship utilized a combination of mooring lines at the stern with varying LDBF. Specifically, two stern lines were in use, one with LDBF 70.0 ton and other with 65.0 ton.

10.14 Are appropriate stoppers in use and are the mooring ropes turned up to bitts correctly? (V)

Findings: According to the certificates available on board for the stopper line has a Maximum breaking load (MBL) of 12.0 tons, whereas the mooring ropes have an MBL of 65.0 tons.

Section 13: Machinery Space

13.9 Is the engine room logbook, as well as other required records being properly maintained? (V)

Findings: 1. Record of soot blow for the boiler tube 2. Daily entry for all grade of fuel oil ROB 3. Running hour counter for important machinery 4. Fresh water log;

13.26 Is the workshop clean and tidy, and are the engine room workshop tools' protective guards, shields, and emergency stops in good condition? (V)

Findings: Lath machine was provided with a non-transparent cover (metal cover)

Section 14: General Appearance - Hull and Superstructure**14.6 Are the vents and air pipes on weather decks maintained in good order and are they clearly marked to indicate the compartment they serve? (V)**

Findings: The vent located on the aft mooring deck for the steering gear was found with the wire mesh wasted and holed.

14.10 Are portable and fixed cargo lights used for illumination of cargo holds inspected regularly and maintained in good condition? (V)

Findings: The type of portable cargo lights on board were conductive and didn't isolate the crew from electrical shock hazards.

Vessel's Master Name

MURAT YASİN TEPEOGLU

Vessel's Master Email Address

kiranistanbul@pasifikgemi.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

A handwritten signature in black ink, appearing to be 'M. Tepeoglu', written over a horizontal line.

Inspector Name

Ahmed Awad

Inspector's Signature:

A handwritten signature in black ink, appearing to be 'A. Awad', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta