

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 67139

A bulk carrier that is carrying grain cargo

Vessel Name:	AQUITANIA
IMO Number:	9611278
DOC Company:	Nordic Hamburg Shipmanagement (HK) Ltd
Place of Inspection:	China, Zhangjiagang
Name of Inspector:	Jonathan Fan
Inspection Completion Date:	
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.


Number of Findings: 23

Section 2: Certification and Personal Management

2.1 Is the latest Class Survey Status available and are all statutory certificates listed in the Class Survey Status valid, and is the vessel free of condition of class or significant recommendations? (M)

Findings: 1. The ship radio license stated the MF/HF was fitted on board with same as actual situation. However the safety radio certificate Form R indicates only MF was fitted. 2. The class of condition was mentioned "the ship emergency generator ESB auto start function was defective , however manual starting and manual putting on-load is possible , the vessel was allowed to operate until 29 October 2025" , a dispensation letter was issued from flag state.


Attachments:

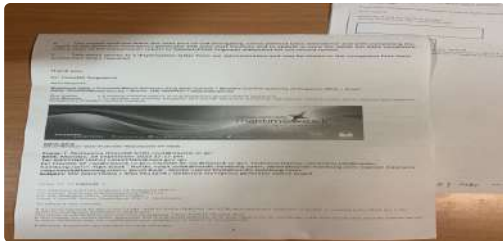

[Q201_2819289b-1902-4851-ae3f-a34d45f6065b.jpg](#)



[Q201_45bb9475-780e-4920-8910-9265206d36e5.jpg](#)

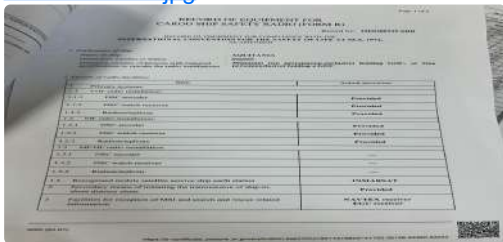


[Q201_77fd13c8-9021-4dc1-a7dc-643bafa51895.jpg](#)

Section 3: Navigation

3.3 Is the manoeuvring information for the vessel displayed on the bridge and are bridge logbooks, bell book, radar performance book, and Change of Watch at Sea check list being correctly maintained? (V)

Findings: The Shapoli was fitted on board and engine power was limited from 6900kw to 4871kw, however the manoeuvring poster not mentioned and updated accordingly. That was rectified before close meeting

Attachments:

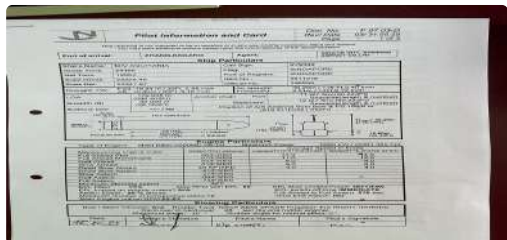

[Q303_15d2368e-ccbf-44e4-a83a-03a4a8c56dbc.jpg](#)



[Q303_ba6d778b-1e3e-46a4-827a-861cde6b8868.jpg](#)

3.5 Are there records indicating that routine tests and checks of bridge equipment are being undertaken regularly? (V)

Findings: There was no evidence to reflect that the manual steering be tested at least once per watch.

3.13 Where fitted are the standard magnetic compass, gyro compass and Global Navigation Satellite System compass, operational, adjusted and properly maintained? (V & M)

Findings: It was noted that the transmitting magnetic compass was fitted on the bridge, however the TMC outputs not be corrected for compass error.

Attachments:



[Q313_a65de9db-3578-4316-9885-a8b1d733183a.jpg](#)

Section 4: ISM System

4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: The enclosed space entry permit on 01 October 2025 and valid at 1030LT to 1200LT, however the master or responsible officer signed at 1115LT, 45 minutes earlier than permit starts, other permits were reviewed a similar systematic timing problem was noted.

Attachments:



[Q405_280025ed-fcc9-49bf-b4a7-3c94dfc75566.jpg](#)




[Q405_55ef4936-2195-429e-bd82-64eeb692cdaf.jpg](#)

4.8 Has a specific permit to work and effective Lock-Out/Tag-Out (LOTO) system been introduced for high-risk duties and are the permits being used effectively? (V)

Findings: Several working on electrical circuits permits were reviewed, it was noted that all permits section 3 was left blank which for lock-out and tag-out system.


Attachments:

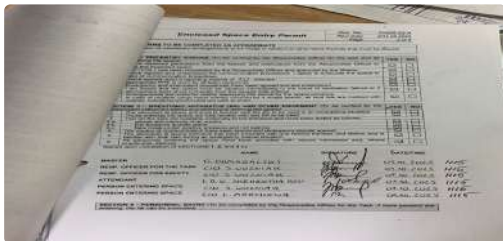

[Q408_280025ed-fcc9-49bf-b4a7-3c94dfc75566.jpg](#)



[Q408_55ef4936-2195-429e-bd82-64eeb692cdaf.jpg](#)

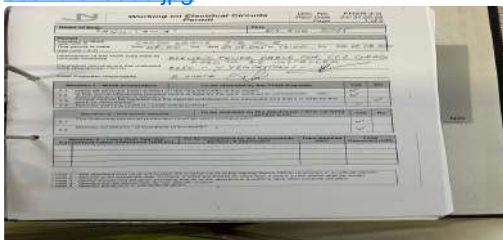

[Q408_d16f4e25-11da-436f-826b-0a72ef8d57c9.jpg](#)

4.17 Are the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

Findings: It was observed that the worm screw driver was used to secure the hose and hose tail in engine room workshop

Attachments:



[Q417_e60ed58d-03be-42fd-aadd-036df9a64e88.jpg](#)

4.22 Are IMO symbols to identify the location of life saving equipment, firefighting equipment and hazardous area displayed appropriately and in good condition? (V)

Findings: There was no IMO sticker for P/S side fire control plan watertight box.

Attachments:



[Q422_d162e9b7-65ac-4cfb-8be5-0c936eff64b3.jpg](#)

4.30 Are firemen's outfits including their equipment, two-way portable radiotelephone apparatus for fire-fighter's communication and breathing apparatus in good condition, fit for purpose and available for instant use? (V & M)

Findings: Donning fireman outfit was demonstrated by crew, it was observed that: 1. The fire fighter's ears and part of face still exposed 2. The cables of BA and communication apparatus were hanged outside of suit.

Attachments:



[Q430_55d71a5b-e7f1-4649-9c6e-b3e48d760511.jpg](#)



[Q430_7a554f56-5d02-4ad6-a711-376412a365cd.jpg](#)

4.37 Are pilot ladders used for pilot transfer in good condition and inspected regularly, clearly identified with tags or with permanent marking and are maintenance records available? (V)

Findings: The inspector asked deck crew to demonstrate pilot ladder rigging, however the fiber rope was used to secure pilot ladder side instead of Manila rope

Attachments:



[Q437_88b9fe80-75fb-4e5d-a527-745cbe84d54f.jpg](#)

Section 5: Pollution Prevention and Control

5.11 Is an approved ballast water and sediment management plan provided and complied with? (V)

Findings: The ballast water management plan which used on board was not updated according to MEPC.369 (80)-Changes to the new format of BWRB, and MEPC387(81) procedure from challenging water quality (CWP) .

Attachments:



[Q511_82f00f65-b7e1-46be-ada2-329d342c37e5.jpg](#)



[Q511_b702916f-c02b-4663-9678-5250044d39e4.jpg](#)

Section 8B: Cargo Operation - Bulk Grain


8B.7 Are the stresses, stability information and any limitations included in the cargo plan understood by the cargo watch officers and are conditions being monitored and maintained within design limits throughout cargo operations? (V)

Findings: There was no evidence to indicate that the stress and stability being monitored during cargo operation, the observed draft was left blank on cargo loading/discharging plan. Several plan was reviewed and a similar lake of records were noted.

Attachments:



[Q8b07_c78c445e-5ba6-4227-b5f1-1328e9a51c2d.jpg](#)

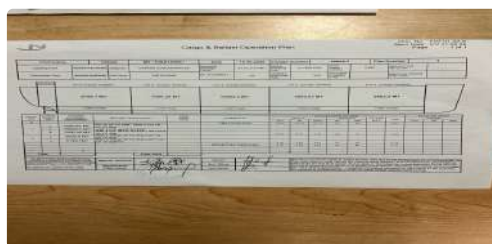

[Q8b07_e9b8ab5e-d3f7-4730-b903-ff952ee7cdc4.jpg](#)

Section 9A: Hatch Cover and Lifting Appliances

9A.2 Is there a procedure in place for the safe operation and inspection of hatch covers and, has the Master/Chief Officer received appropriate training in hatch cover inspection and maintenance?

Findings: It was noted that the Master and/or chief officer not received appropriate train in hatch cover inspection and maintenance.

9A.22 Are the loose gears of lifting appliances marked clearly and are the certificates of the loose gears available and traceable on board? (V)

Findings: The deck crane loose gears used for lifting appliances are not marked clearly with its a batch mark or number as per certificate

Attachments:



[Q9a22_1986e00a-6878-4545-890d-925810aeae5c.jpg](#)




[Q9a22_ffc9efbc-6efe-4d6f-bbd3-5ac86ccffcb2.jpg](#)

Section 10: Mooring Operations

10.1 Has the company established guidelines and procedures for the inspection, maintenance and wear zone management of the mooring lines and are they being implemented? (V & M)

Findings: The company established guidelines and procedures for the inspection, maintenance of mooring lines, but the PIC unable to provide the wear zone management section at time of inspection

Attachments:

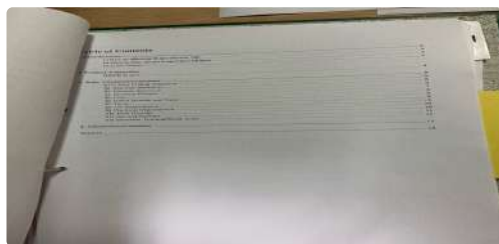

[Q1001_12fd75ea-c679-4ae5-b3b5-b927940349b6.jpg](#)

10.3 Are the certificates of mooring lines and mooring tails available on board? (V & M)

Findings: The ship's SDMBL was 490KN, however the breaking load was 790KN and 675KN of 4 mooring ropes used on board.


Attachments:



[Q1003_04e8e13a-d71c-4ef1-8942-4966d7505dab.jpg](#)



[Q1003_794ed66b-75f6-4136-8c51-ec7931c398ac.jpg](#)

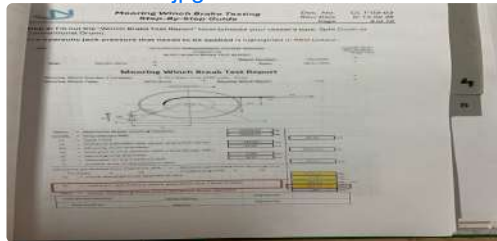

[Q1003_c9a06cae-3d97-403f-a259-6e9e2deae0d9.jpg](#)

10.15 Do controls, linkages, operating levers, brake drums, brake linings and pins of winches appear to be in good order? (V)

Findings: There were 2 brake linings of poop deck mooring winch were uneven in thickness, with the ends about 9mm, and the middle part only about 3mm

Attachments:



[Q1015_35030a92-9fe0-4c4e-a32a-3a81303238d3.jpg](#)



[Q1015_d9d9da5a-7622-4ac9-a134-2d6faccf04a0.jpg](#)

Section 11: Radio and Communication

11.7 Are survival craft portable VHF radios in good order and charged? (V)

Findings: It was observed that three sets of portable VHF without wrist or neck strap as per resolution MSC.515(105) performance standard for survival craft portable Two-way VHF radiotelephone, which located in the bridge.

Attachments:



[Q1107_a3e23158-5b7e-4e2d-8f1f-c0091429ef76.jpg](#)

Section 13: Machinery Space

13.4 If the vessel has been certified for periodically unattended machinery spaces (UMS), is the machinery space being operated in that mode? (V)

Findings: The vessel has been certified for UMS mode, however since 29 Sep 2025 the engine room was manned due to the emergency generator defective. And following flag authority requirement.

Attachments:



[Q1304_3f2d5143-7dc9-4e18-a070-0f017dba78bd.jpg](#)

13.33 Is the following machinery/equipment, where applicable, in good order and well maintained?
(V)Shaft generator and emergency generatorBoilers, including waste heat and domestic boilers
(Boilers should be operated in automatic mode where the automated boilers are installed)Boiler safety system and instrumentationBoiler water safety systemMain and emergency air compressorsPurifiers and fuel oil handling equipmentRefrigeration and air conditioning machineryStern tube sealing arrangementsIncineratorSewage systemAir condition and heating systemRefrigeration plantAccommodation service systems (i.e., Calorifiers, Portable water equipment, heating etc)Any other items of machinery, including stand-by machinery.Burners, tubes, uptakes, exhaust manifolds and spark arrestors.

Findings: It was found that approximately 15cm X 10cm coatings inside of incinerator had become detached.

Attachments:



[Q1333_0826cc2a-bde3-4b41-a3ea-74b5471c395f.jpg](#)

13.34 Is the pipe work in the machinery space, including but not limited to steam, fuel, lubricating oil, sewage, drain and air lines well maintained, in good condition and free of any temporary repair? (V)

Findings: It was observed that water dropping down from one of cooling pipe which rust and holed beside the No.2 auxiliary engine.

Attachments:



[Q1334_a8ad39de-d09a-408a-bad6-a956c06cd422.jpg](#)

Section 14: General Appearance - Hull and Superstructure

14.2 Are the following permanent markings on the ship's hull, where applicable, plainly visible and painted in a contrasting colour? (V) The vessel's name Port of registry Load lines Draft marks Thruster warnings Tug push points IMO number Bulbous bow mark

Findings: 1. The port side fwd draft mark from 8 -10 meters not visible. 2. It was observed that paint flake and rust scale on port side ship's hull approximately 1m x 2m between cargo hold 1&2.

Attachments:



[Q1402_3bfc0aab-3aeb-4a15-a276-30e073f95f3c.jpg](#)



[Q1402_4ec6fe64-51f4-4cc1-807b-eb2baf123783.jpg](#)

14.12 Are the explosion-proof lights in paint lockers, acetylene stores or similar spaces in good condition? (V)

Findings: The battery room ventilators are equipped with a closing device, these devices should be left open and a clear warning notice installed to prevent accidental closing: The closing device should be used only in an emergency.

Vessel's Master Name


Dariusz Domagalski

Vessel's Master Email Address

aquitania@bertling.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

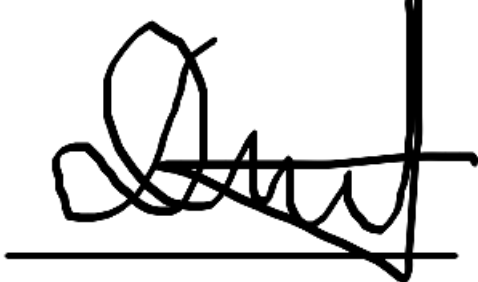A handwritten signature in black ink, appearing to be 'Dariusz Domagalski', written over a horizontal line.

Inspector Name

Jonathan Fan

Inspector's Signature:

A handwritten signature in black ink, appearing to be 'Jonathan Fan', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta