

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 73384

Vessel Type:	A bulk carrier that is carrying solid bulk cargo
Vessel Name:	ARUNA BERK
IMO Number:	9543689
DOC Company:	Aruna Shipping Ltd Corp (Aruna Denizcilik Ltd Sti)
Place of Inspection:	Lazaro Cardenas
Name of Inspector:	Jesus Guilarte
Inspection Completion Date	20/May/2026
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

Number of Findings: 10

Inspected Item	Response	Finding description
3.4 Have operational checks on navigational equipment been done and are checklists being effectively completed when preparing for sea and prior to port entry? (V)	No	During the inspection it was found that the preparation for arrival checklist for Lazaro Cardenas Anchorage area dated 11 May 2026 was missing
3.6 Has the Master/Pilot information exchange been taking place effectively and is the standard pilot card being completed as required? (V)	No	There was not record in the deck log book or in the bell book when the time of the transfer of conn between Master and Pilot has completed at the last departure time from San Juan Mexico on May 9th 2026
3.9 Does the manning level in the bridge at all stages of the voyage and anchor meet or exceed that required by the Bridge Manning Matrix and are lookout arrangements adequate? (V)	No	During inspection it was noted that the bridge watch matrix was posted on bridge however no records were available to demonstrate that bridge watch level had been change during the arrival at Lazaro Cardenas from end of sea passage until Lazaro Cardenas anchorage on May 11th 2026
3.14 Where manual steering is engaged, is the change over from auto steering, and vice versa, recorded? (V)	No	During the inspection it was noted that records of the time when autopilot and manual steering were engaged had been maintained, however there were no corresponding records indicating the vessel's position at the time of switching between autopilot and manual steering engaged and vice versa.

Inspected Item	Response	Finding description
4.44 Does the vessel manager have documented procedures in place to control stevedore activities onboard by identifying potential hazards and implementing appropriate mitigation measures? (V)	No	During the inspection was observed that the record indicated that tool box meeting with stevedors was conducted at San Juan, Mexico on May 6th 2026 however the meeting was not supported by corresponding vessel risk assessment and no documented evidence was available to demonstrate that the associated operations risk had been properly evaluated
5.8 Are suitable containment arrangements in place around the hydraulic components of deck machinery? (V)	No	Rescue Boat Crane have no hydraulic oil containment arrangements by design.
5.25 Are the ballast pumping systems, including their associated instruments, controls, valves, pipework, and the control panel (including pressure gauges, draft gauges, and the remote control system), in good working order and is there recorded evidence of regular inspection? (V)	No	It was noted the Ballast valves opening/closing time were not including in the vessel's PMS , furthermore there was not record of operating time of ballast the valves.
7A.2 Are bunker transfer systems hydrostatically tested to their Maximum Allowable Working Pressure (MAWP) on an annual basis and to 1.5 times their MAWP at least twice within any five years period? (M)	No	The bunker manifolds located on the port side accommodation. The Fuel oil manifold was fitted with bolts and nuts of different sizes and thread types
11.2 Is communication equipment, listed in the Record of Equipment attached to the Safety Radio Certificate or Safety Certificate (Form R or Form C), in good condition and has the <u>GMDSS</u> Logbook (the Radio Log) been maintained correctly and are daily, weekly and monthly tests being carried out? (V)	No	During inspection it was noted that weekly test for MF/HF was conducted with land station however no records of ack was found since november 17th 2025
13.2 Are the responsibilities of watch standing engineers and engine ratings well-defined and clearly posted in the Engine Control Room? Is there a manning matrix for engineers that takes into account both planned and unplanned changes? (V)	No	During the inspection it was noted that Manning Matrix for Engine Room Team is available on the SMS, however it was not posted at ECR

Vessel's Master Name

Kuldeep Singh Hooda


Vessel's Master Email Address

arunaberk@infinitymail.eu



By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

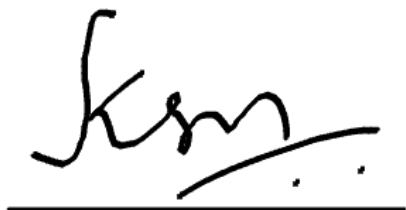

Inspector Name

Jesus Guilarte

Inspector's Signature:

A handwritten signature in black ink, appearing to be 'J. Guilarte', written over two horizontal lines.