


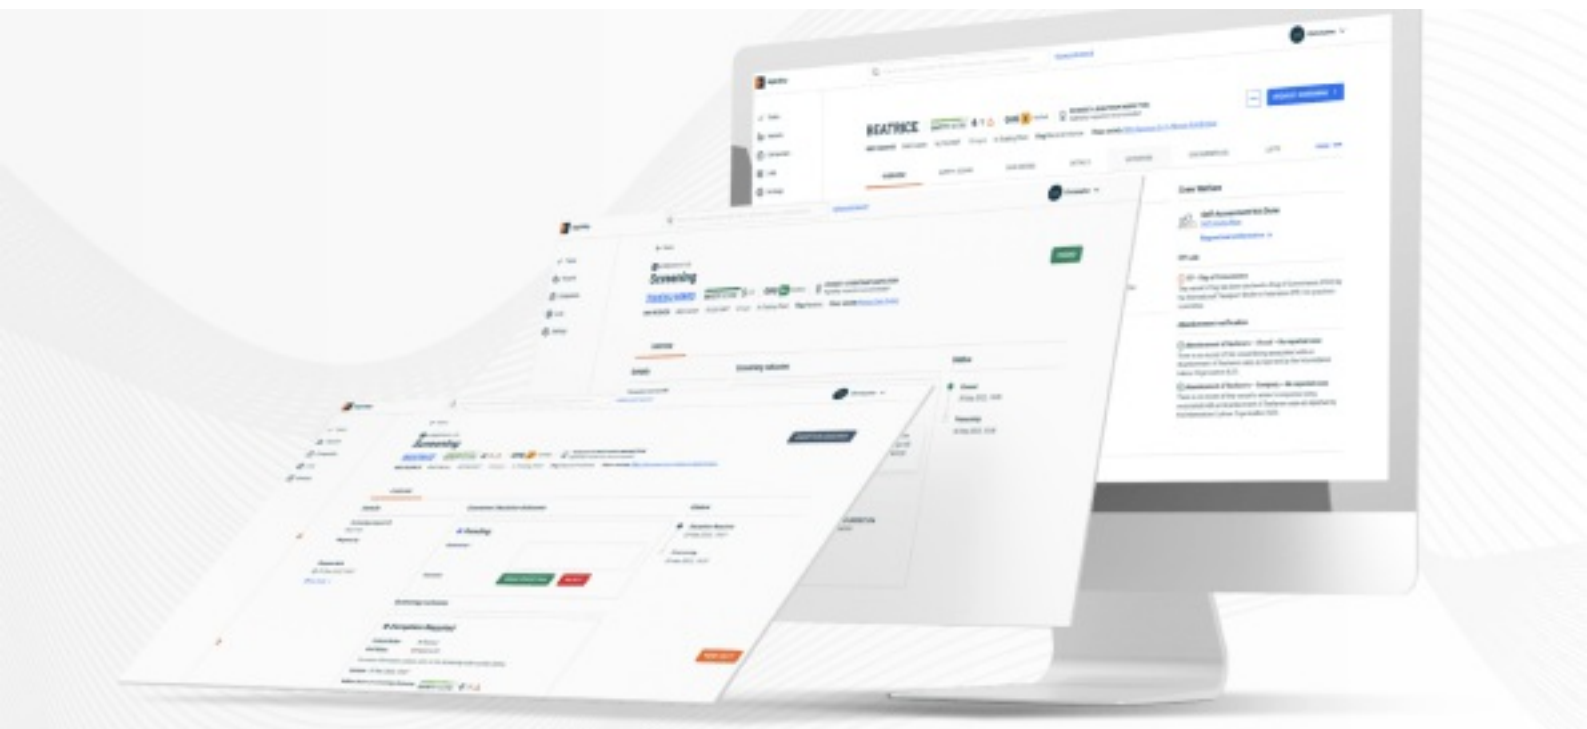

RightShip Inspection - Inspector Report

DIANE, 9492086

Date of inspection **06 JUN 2026**
Port of inspection **DONGGUAN**
Type of inspection **STANDARD**
Inspection ID **73476**

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

1. General information



Vessel Details

Vessel Name
DIANE

IMO
9492086

Maximum Deadweight
78992.00 TONNES

Flag
CYPRUS

Date Delivered
05/SEP/2011

Layup Date



Technical Specifications

Vessel Type **A BULK CARRIER THAT IS CARRYING GRAIN CARGO**

Current Operation **DISCHARGING**

Cargo being handled **BARLEY**

Hull Type **DOUBLE BOTTOM-SINGLE SKIN SIDE**



Certification & Classification

Port State Control
History (Last 12
Months)

LAST PSC INSPECTION WAS AT SURABAYA, INDONESIA ON 04/FEB/2026 WITH NIL DEFICIENCY ISSUED. 2ND LAST PSC INSPECTION WAS AT SAN LORENZO, ARGENTINA ON 12/DEC/2025 WITH NIL DEFICIENCY ISSUED. 3RD LAST PSC INSPECTION WAS AT MAPUTO, MOZAMBIQUE ON 18/JUL/2025 WITH NIL DEFICIENCY ISSUED.

INSPECTOR COMMENTS

Classification Society **IACS : LLOYDS REGISTER**

Class Certificate
Expiry **11/JUN/2029**

Last Special Survey **05/JUL/2024**

Last Routine Dry
Dock **05/JUL/2024**

Unscheduled Repair **N/A**

1. General information



Certification & Classification



Energy efficiency

EEDI 3.55

EEXI



Management information

Vessel Manager **CHARTERWELL MARITIME SA**

Manager Takeover Date **11/OCT/2024**

Last Manager Visits **12/MAY/2026 : MARINE AND TECHNICAL SUPERINTENDENT 13/DEC/2025 : MARINE AND TECHNICAL SUPERINTENDENT**

P&I Club **INTERNATIONAL : NORTHSTANDARD EU DAC**



Inspection details

Port of Inspection **DONGGUAN**

Inspector Arrival **05/JUN/2026 18:38 : 06/JUN/2026 08:07**

Inspector Departure **05/JUN/2026 22:06 : 06/JUN/2026 16:18**

Total Inspection Time **10.76**

Inspection Completed **06/JUN/2026**

Inspection ID **73476**

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

Section 4: ISM System

- 4.2 Has a safety officer been appointed and adequately trained, onboard safety meetings held regularly and acknowledged by the vessel's manager, with feedback provided where necessary, and are safety inspections of the main deck, machinery space, accommodation and forecandle store conducted at regular intervals in accordance with the company's procedures, and are health, safety, and environmental hazards effectively identified? (V) NO

⚠ FINDING

Although a safety inspection conducted by the safety officer at monthly intervals as per company's procedures, but the machinery space was not covered.


💬 INSPECTOR COMMENTS

C/O was the safety officer.

- 4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course? NO

⚠ FINDING

It was observed that measuring the gas CO2 was not included in the company enclosed space entry permit/safety checklist during pre-entry atmosphere test and repeating test when the space occupied.

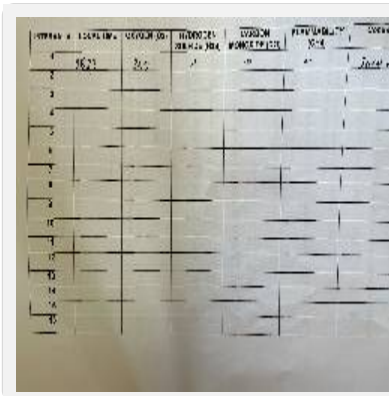

[Q405_1627c95c-934e-462d-b003-851e15eda17c.jpg](#)



[Q405_df9d8d7a-3813-4035-9559-e55afdd47045.jpg](#)


- 4.7 Are procedures in place for the control of hot work, are they incorporated in the safety management system and is there documented evidence of compliance? (M) NO

⚠ FINDING


The last two hot work permits issued for replacing platform at weather deck port side on 13/May/2026 and at cross deck iwo No.4 CH port side on 14/May/2026 had not been approved by the company before the tasks commenced.

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

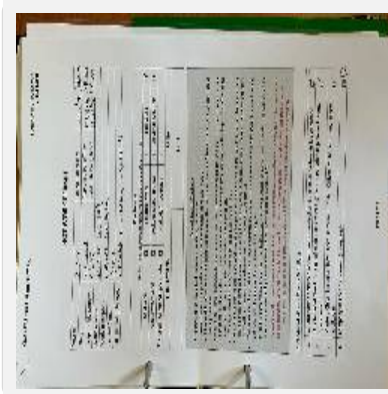

[Q407_9cddcf94-cc87-4909-afe7-cf3d666df482.jpg](#)

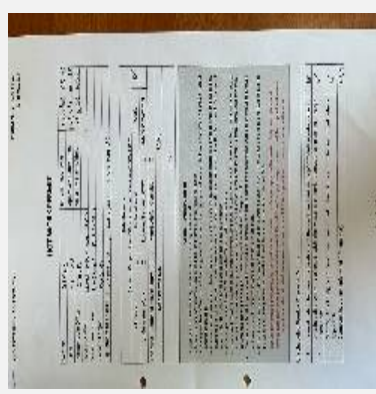

[Q407_9f64256b-e665-4254-9e59-aef03d8e7cc5.jpg](#)



[Q407_9f64256b-e665-4254-9e59-aef03d8e7cc5.jpg](#)

- 4.16 Are portable gas detectors suitable for atmosphere testing of enclosed spaces provided; in good condition; calibrated in accordance with the manufacturer's instructions, and are officers trained and competent with their operation?

NO

FINDING

Total five portable gas detectors were provided onboard for detecting four gases (O₂/H₂S/CO/CH₄), but none of them could detect gas CO₂.



[Q416_ad0149c0-9627-4927-899a-248868c61dd6.jpg](#)

- 4.17 Is the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

NO

FINDING

It was observed that the flanges were used for OX/AC gas distribution lines in their storage rooms at poop deck.

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)



[Q417_2e1f16a7-3cc6-4ae0-bfcc-1243b4042fbb.jpg](#)



[Q417_c56c5b77-9121-4f50-8fb4-1357af479b42.jpg](#)

- 4.25 Are the International Shore Connection fitting arrangements clearly marked and well maintained and are the crew aware of their location?

NO

FINDING

No suitable bolt spanner was provided for the International Shore Connection deployed near both side accommodation ladder.



[Q425_5630fc1f-ee07-4c3f-a78d-5760f8201a79.jpg](#)



[Q425_764fb4e5-3b5c-48d6-b81e-9bf77d5c02a9.jpg](#)

- 4.30 Are firemen's outfits including their equipment, two-way portable radiotelephone apparatus for fire-fighter's communication and breathing apparatus in good condition, fit for purpose and available for instant use?

NO

FINDING

The fireman's outfits in the fireman store at upper deck could not provide full protection from the heat and flames in fire scenario as parts of the ear, face and neck of the fireman were exposed with exposed areas approximately 3x5cm, 1x3cm and 2x5cm respectively.

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)



[Q430_b4aaaf5a-8573-4b87-bb2a-cac4ecd8a960.jpg](#)

- 4.39 If the vessel is provided with a helicopter operating area, does the area comply with the requirements of ICS guidelines, and is there a safe access from the hatch cover to deck? NO

△ FINDING

The height of the ship's name marked on the helicopter winching area was only 68cm, while it should be 1.5m as required.

□ INSPECTOR COMMENTS

No.5 CH hatch cover was designated as helicopter winch only area.



[Q439_05b93b9c-a6e6-433c-a31d-3a05c08061a8.jpg](#)



[Q439_5bbdacc1-8b55-4c99-97ef-87b3f1da4bad.jpg](#)



[Q439_9a10ea04-66ca-48c8-b129-1f39c6310d70.jpg](#)

Section 5: Pollution Prevention and Control

- 5.25 Are the ballast pumping systems, including their associated instruments, controls, valves, pipework, and the control panel (including pressure gauges, draft gauges, and the remote control system), in good working order and is there recorded evidence of regular inspection? NO

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

FINDING


Below were observed on the computer remote control system in the deck office: 1. Ballast stripping valves of No.3 WBT-P (Valve No. BWV123), No.3 WBT-S (Valve No. BWV124) and main ballast valves of No.4 CH heavy weather ballast hold (Valves No. BWV120 & BWV126) were indicating yellow (opening or closing), actually they were fully shut and should be indicated red. 2. Ballast valves of No.6 CH heavy weather ballast hold (in port use) (Valve No. BWV110) was indicating green (open), actually it was fully shut and should be indicated red. 3. No.6 CH starboard side bilge valve (Valve No. BGV105) and No.7 CH port side bilge valve (Valve No. BGV102) was indicating yellow (opening or closing), actually they were fully shut and should be indicated red. 4. Remote draft indicated were forward -1.174m and mid-ship (S) 2.588m, actually they were approximately 13.4m when observed locally.



[Q525_5742bcf5-7987-4032-949a-9afb35b2b9bd.jpg](#)



[Q525_ac033470-91dd-4b14-81d8-8f0380fcedbb.jpg](#)

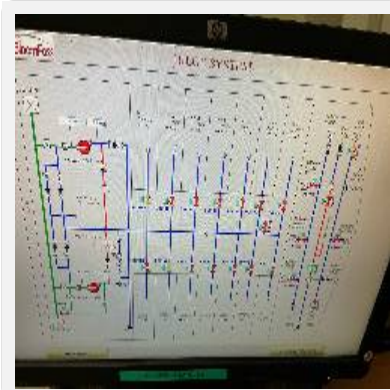

[Q525_b1a56da0-c840-4ae9-88ad-296ebdb43bf.jpg](#)

Section 8B: Cargo Operation - Bulk Grain

8B.6 Is a Class-approved loading computer or programme in use and has its operational accuracy been regularly tested? (V)

NO

FINDING

The loading computer last operational accuracy test verified by the class surveyor was on 11/Oct/2024 which had been over one year.



[Q8b06_6b8863c8-b8bf-44cf-9940-17b388ae406c.jpg](#)



[Q8b06_9fba9bc9-8dd3-4a5f-9d25-6145c9c08cdd.jpg](#)



[Q8b06_6b8863c8-b8bf-44cf-9940-17b388ae406c.jpg](#)

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

8B.13 Have hatch covers been ultrasonically tested for weather tightness before loading?

NO

FINDING

All hatch covers had not been ultrasonically tested before loading grain cargo this voyage.

Section 9A: Hatch Cover and Lifting Appliances

9A.2 Is there a procedure in place for the safe operation and inspection of hatch covers and, has the Master/Chief Officer received appropriate training in hatch cover inspection and maintenance?

NO

FINDING

The vessel manager did not establish a procedure to ensure that the clearance measurements of hatch cover components (Rubber packing, stoppers, locators, bearing pads, etc) to be carried out regularly every six months.

INSPECTOR COMMENTS

The Master and C/O completed training for hatch cover inspection and maintenance course (Side rolling type).

Section 10: Mooring Operations

10.14 Are appropriate stoppers in use and are the mooring ropes turned up to bitts correctly? (V)

NO

FINDING

The fore breast line and fore spring line at forecastle deck were not turned up to the bitts correctly as only one turn was taken directly around the first post of the bitts before the rope laid up in a figure eight around the bitts.



[Q1014_5c04ef03-18ee-41dd-8bd3-55c8f3a5e0a0.jpg](#)



[Q1014_70688d02-0a74-46bb-a188-1b87ea8682a4.jpg](#)

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

Section 13: Machinery Space

13.11 Is an effective and up to date planned maintenance system available and being followed on board the vessel? (V & M)

NO

FINDING

A computerized PMS (Danaos) was fitted onboard and all officer/engineers used the system for routine maintenance, but none of them had received any familiarisation training.



[Q1311_f3da8ec0-4e7b-46c7-a530-31cf7cbaace6.jpg](#)

13.18 Are engine room emergency stops for ventilation fans and the closing mechanism of ventilation supply and exhaust ducts clearly marked, in working condition, and do records indicate that they have been regularly tested? (V)

NO

FINDING


Several gaps between 2-5mm were observed on the funnel louvre vents when fully closed.



[Q1318_37b708ec-f245-49a9-89eb-8a076c307b8d.jpg](#)



[Q1318_394872dc-9e4a-4292-9fab-201787fa0ea6.jpg](#)

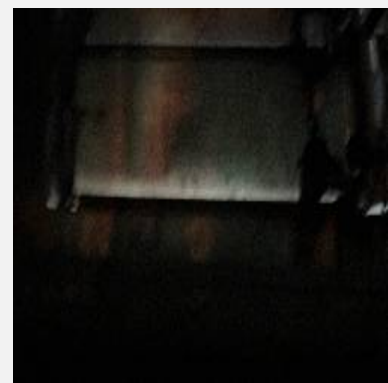

[Q1318_b4e42f32-2af2-46e3-9af0-4a55e1d7f143.jpg](#)

13.33 Is the following machinery/equipment, where applicable, in good order and well maintained? (V) Shaft generator and emergency generator Boilers, including waste heat and domestic boilers (Boilers should be operated in automatic mode where the automated boilers are installed) Boiler safety system and instrumentation Boiler water safety system Main and emergency air compressors Purifiers and fuel oil handling equipment Stern tube sealing arrangements Incinerator Sewage system Air condition and heating system Refrigeration plant Accommodation service systems (i.e., Calorifiers, Portable water equipment, heating etc) Any other items of machinery, including stand-by machinery. Burners, tubes, uptakes, exhaust manifolds and spark arrestors. Engine control console including the control and monitoring system Steering gear system Battery maintenance and renewal.

NO

ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 16 (6%)

FINDING


The incinerator in the engine room funnel was found out of order due to FX series PLC communication cable failed. Note: Spare parts requisition had been sent to office on 08/May/2026, but was not received before the closing meeting.




[Q1333_25ff30d9-8bc0-4c8e-b6b9-b4f50b705e20.jpg](#)




[Q1333_34273f6e-f376-415d-a20f-04b5f4c583f9.jpg](#)

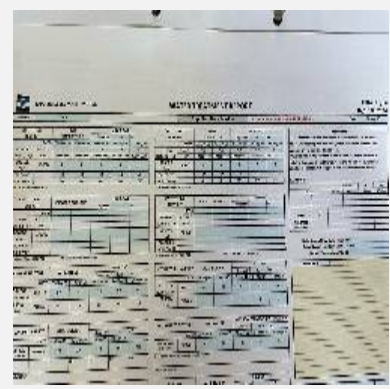

[Q1333_812e4fc8-9b32-4cf1-876e-483a2057e720.jpg](#)

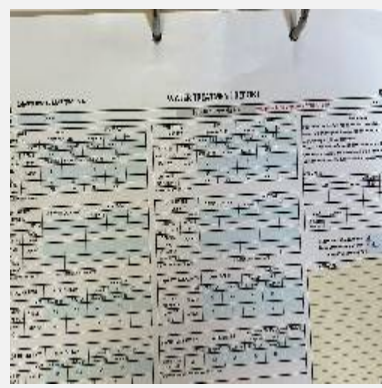

[Q1333_34273f6e-f376-415d-a20f-91b5f4c583f9.jpg](#)

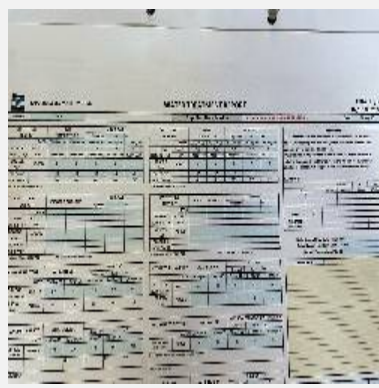

[Q1333_812e4fc8-9b32-4cf1-876e-483a2057e720.jpg](#)