


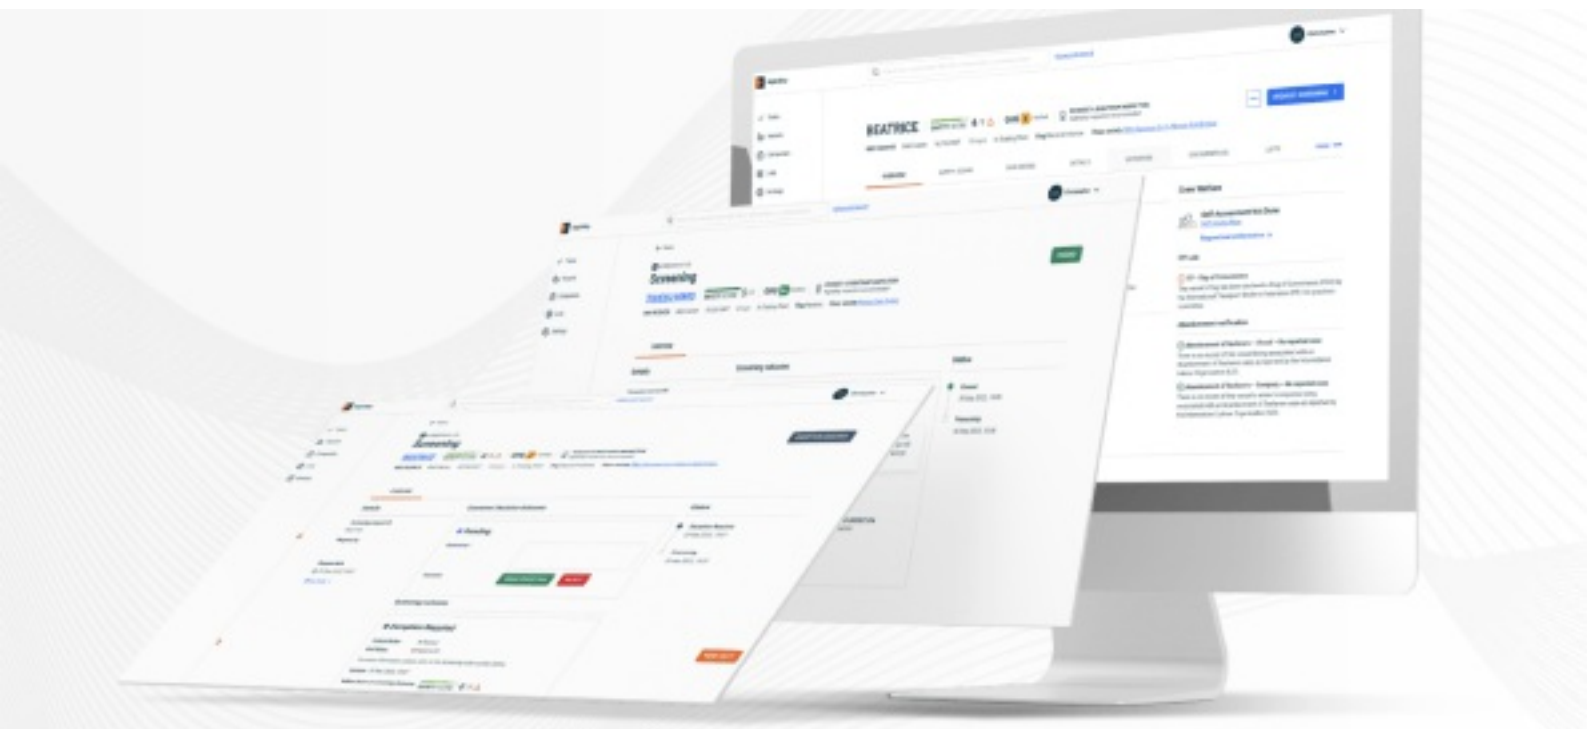

# RightShip Inspection - Inspector Report

## STAR TRADER, 9461142

Date of inspection **29 MAR 2026**  
Port of inspection **SINGAPORE**  
Type of inspection **STANDARD**  
Inspection ID **72267**

### DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

## 1. General information



### Vessel Details

Vessel Name  
**STAR TRADER**

IMO  
**9461142**

Maximum Deadweight  
**82181.00 TONNES**

Flag  
**BAHAMAS**

Date Delivered  
**28/JUN/2010**

Layup Date



### Technical Specifications

Vessel Type **A BULK CARRIER THAT IS CARRYING GRAIN CARGO**

Current Operation **BUNKERING**

Cargo being handled **WHEAT IN BULK**

Hull Type **DOUBLE BOTTOM-SINGLE SKIN SIDE**



### Certification & Classification

Port State Control  
History (Last 12  
Months) **NO CODE 30 FINDINGS IN PAST 24 MONTHS.**

INSPECTOR COMMENTS

Classification Society **IACS : NIPPON KAIJI KYOKAI**

Class Certificate  
Expiry **20/JUL/2029**

Last Special Survey **23/AUG/2024**

Last Routine Dry  
Dock **23/AUG/2024**

Unscheduled Repair **N/A**

## 1. General information



### Certification & Classification



### Energy efficiency

EEDI

EEXI



### Management information

Vessel Manager **CHARTERWELL MARITIME SA**Manager Takeover  
Date **19/MAR/2020**Last Manager Visits **21/MAR/2026 : TECHNICAL AND MARINE SUPERINTENDENTS 23/MAR/2025 : TECHNICAL AND MARINE SUPERINTENDENTS**P&I Club **INTERNATIONAL : NORTHSTANDARD EU DAC**

### Inspection details

Port of Inspection **SINGAPORE**

Inspector Arrival

Inspector Departure **29/MAR/2026 20:10**Total Inspection Time **11.46**Inspection Completed **29/MAR/2026**Inspection ID **72267**

## ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 8 (3%)

## Section 4: ISM System

- 4.17 Is the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

NO

⚠ FINDING

There was no objective evidence that electric arc welding equipment inspected and maintained.

- 4.37 Are pilot ladders used for pilot transfer in good condition, and inspected regularly, clearly identified with tags or with permanent marking and are maintenance records available and, are crew members capable of demonstrating proper rigging of the pilot-ladder arrangement?

NO

⚠ FINDING

The vessel carried two pilot ladders, there was no objective evidence that authenticity of these pilot ladders certificates were verified by the managers of the vessel. The record of approved safety equipment was also not updated for these ladders.

## Section 8B: Cargo Operation - Bulk Grain

- 8B.13 Have hatch covers been ultrasonically tested for weather tightness before loading?

NO

⚠ FINDING

The hatch covers were not ultrasonically tested before loading present grain cargo.

## Section 10: Mooring Operations

- 10.3 Are the certificates of mooring lines and mooring tails available on board? (V & M)

NO

⚠ FINDING

Mooring rope mill Certificates were on board, there was no objective evidence that type approval certificate issued by one of the IACS members.

## Section 13: Machinery Space

- 13.28 Are all spare parts and loose gear in the machinery spaces, stores and steering compartment properly secured? (V)

NO

## ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 8 (3%)

## FINDING

The vessel's manager did not identified potentially hazardous manual handling operations, including the development and implementation of procedures for storing, securing and manual handling of spare parts and steel plates.

[Q1328\\_100\\_2576.JPG](#)

13.37 If the starting source of the emergency generator relies on a single starter motor, has a spare starter motor been provided? (V)

NO

## FINDING

There was no objective evidence that spare starter motor for emergency generator was tested every quarter.

[Q1337\\_100\\_2408.JPG](#)

## Section 14: General Appearance - Hull and Superstructure

14.2 Are the following permanent markings on the ship's hull, where applicable, plainly visible and painted in a contrasting colour? (V) The vessel's name Port of registry Load lines Draft marks Thruster warnings Tug push points IMO number Bulbous bow mark

NO

## FINDING

Load line marked midship(S) was faded and not clearly painted in contrasting colours.

## ANSWERED NO WITH COMMENTS AND/OR ATTACHMENTS

Total: 8 (3%)

[Q1402\\_100\\_2329.JPG](#)[Q1402\\_100\\_2331.JPG](#)

14.10 Are portable and fixed cargo lights used for illumination of cargo holds inspected regularly and maintained in good condition? (V)

NO

 FINDING

The lamp holders, drip shields, and shades of portable cargo lights were not, non-conductive.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## Section 2: Certification and Personal Management

- 2.1 Is the latest Class Survey Status available, are all Statutory Certificates listed within it valid, is the vessel free of any overdue Conditions of Class, and are all classification and statutory surveys up to date?

YES

Attachment Image

[Q201\\_Survey\\_Status\\_2026.03.23\\_STAR\\_TRADER.pdf](#)

- 2.3 Can all crew communicate effectively in the working language of the ship? (V)

YES

INSPECTOR COMMENTS

English was the working language. The vessel was manned by multinationals crew. The level of English proficiency of the crew on board the vessel was fair.

- 2.4 Is the vessel's manning in compliance with the Safe Manning Certificate? (V)

YES

INSPECTOR COMMENTS

The minimum safe manning document required 06 officers and 07 ratings. The actual manning level was 08 officers, 10 ratings, Cook, mess man and a deck Cadet.

- 2.7 Have officers and ratings responsible for cargo handling on ships carrying dangerous and hazardous substances in solid form in bulk, undergone formal training? (V)

YES

INSPECTOR COMMENTS

Computer based training was provided.

- 2.9 Has an SMS policy and procedure been established to enforce the STCW Convention and Code requirements for the purpose of preventing drug and alcohol abuse? (V & M)

YES

INSPECTOR COMMENTS

The BAC was 0.04 % The most recent alcohol test was carried out on 20 Mar 2026. The drug and alcohol tested by external agency on 18 Feb 2026.

- 2.13 Is the officer matrix accurately completed and does it reflect the information on officers and engineers on board the vessel at the time of inspection?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

Attachment Image



[Q213\\_1adb01dc-1abd-461d-afd2-28df491537f7.pdf](#)

- 2.14 If ECDIS is fitted on board, has the Master and Navigation Officers been familiarised with the ECDIS equipment installed on board, and were objective evidences of this familiarisation available?

YES

## INSPECTOR COMMENTS

Type specific ECDIS, online training completed by all deck officers before joining vessel.

## Section 3: Navigation

- 3.1 Is practical guidance on navigational safety incorporated in the vessel manager's navigation instruction / procedures and are officer's familiar with the company's navigation procedures? (V)

YES

## INSPECTOR COMMENTS

EPL(Electrical) was fitted. On board management manual was provided.



[Q301\\_3ed3ca4b-5286-44a8-992b-3270627bf95f.jpg](#)



[Q301\\_3ed3ca4b-5286-44a8-992b-3270627bf95f.jpg](#)

- 3.4 Have operational checks on navigational equipment been done and are checklists being effectively completed when preparing for sea and prior to port entry? (V)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

The arrival checklist for Singapore and departure checklist for last port were reviewed.

3.7 Has the vessel's manager produced a guideline for under keel clearance and air draft clearance? (M)


YES

## INSPECTOR COMMENTS

A software was in use to calculate UKC.

3.10 Is navigation equipment in good order?


YES

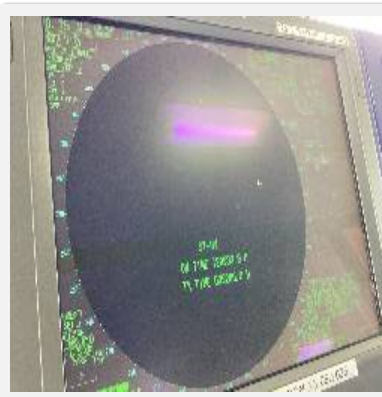

[Q310\\_dd5bedc9-ca92-461b-b18e-34e6a5cb5e4b.jpg](#)



[Q310\\_ea6dd55f-2d6a-4e2b-a842-c036746f6e9d.jpg](#)

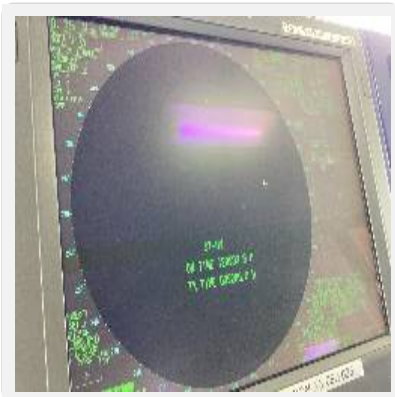

[Q310\\_dd5bedc9-ca92-461b-b18e-34e6a5cb5e4b.jpg](#)



[Q310\\_ea6dd55f-2d6a-4e2b-a842-c036746f6e9d.jpg](#)

3.11 Are navigation lights, emergency navigation lights, shapes and signalling equipment in working order?

YES

## INSPECTOR COMMENTS

The navigation lights power failure alarm was tested by pulling out a fuse.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q311\\_97ee3f40-c761-41eb-945e-ce11fa616573.jpg](#)

- 3.12 Are navigation officers familiar with the company procedure for the use of the Bridge Navigational Watch Alarm System (BNWAS), were records available to demonstrate that it had been operated when the ship was underway and at anchor, and tested in accordance with the procedure?

YES

## INSPECTOR COMMENTS

BNWAS power failure alarm was tested.



[Q312\\_d002bb7c-9058-4270-a2c1-a17704a12764.jpg](#)

- 3.13 Where fitted are the standard magnetic compass, gyro compass and Global Navigation Satellite System compass, operational, adjusted and properly maintained?

YES

## INSPECTOR COMMENTS

The Master Gyrocompass annual service was carried out on 23 May 2025. The magnetic compass was free of air bubbles. Deviation curve was drawn by certified compass adjuster.

- 3.15 Are deck officers familiar with the procedure to preserve the VDR data in the event of an incident and is there a company policy within the SMS relating to the playback of VDR data?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q315\\_8d97430b-d672-4ccc-af78-d329d26ff9c1.jpg](#)




[Q315\\_8d97430b-d672-4ccc-af78-d329d26ff9c1.jpg](#)

3.17 Were appropriate charts and publication used for the previous voyage?


YES

## INSPECTOR COMMENTS


Nautical publications were available as soft copies and some as hard copies.

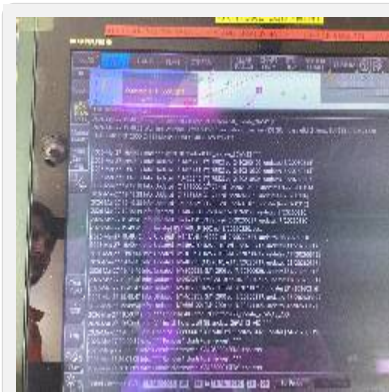

[Q317\\_7c2a64cb-f339-4cef-985f-4c92e41277c9.jpg](#)

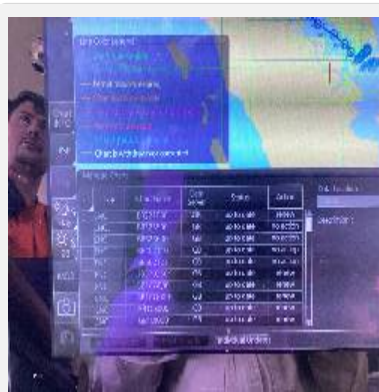

[Q317\\_e396f877-928d-47f5-ba30-116bfd4f4d89.jpg](#)

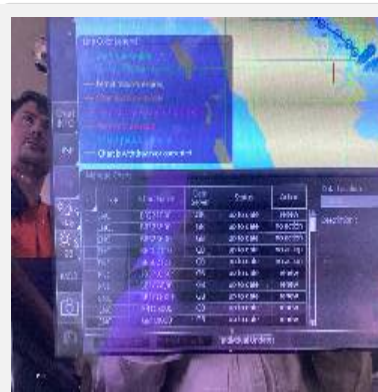

[Q317\\_e396f877-928d-47f5-ba30-116bfd4f4d89.jpg](#)

3.18 Is the ECDIS of an approved type, compliant with SOLAS requirements, and can the Master and watch keeping officers demonstrate familiarity with its use?

YES

## INSPECTOR COMMENTS

The AC power to the ECDIS was switched off and the back up power from each UPS was tested. The UPS provided power to the CPU and the screen.



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q318\\_929203b3-cf2c-4f42-a9e4-52974a8a7cbb.jpg](#)



[Q318\\_929203b3-cf2c-4f42-a9e4-52974a8a7cbb.jpg](#)

3.20 Are T&P NMs and navigation warnings being used correctly in voyage planning and monitoring?

YES

INSPECTOR COMMENTS

AIO was fitted.



[Q320\\_63b55403-3260-4b1e-a1b4-fc3f203c2260.jpg](#)



[Q320\\_cc9a9711-95f9-422a-b6b4-f62d87e46f3d.jpg](#)




[Q320\\_cc9a9711-95f9-422a-b6b4-f62d87e46f3d.jpg](#)

3.21 Has the vessel been safely navigated in compliance with international and inland regulations?

YES



[Q321\\_52304862-e9eb-4ab2-9310-02bdb313c397.jpg](#)

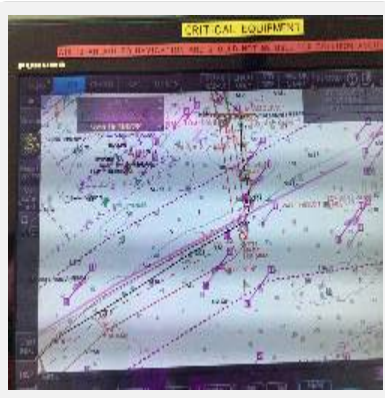

[Q321\\_b7c4ce46-10eb-497e-8622-7029ee84d712.jpg](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

- 3.22 Are records available to show that the echo-sounder recorder is being switched on prior to each approach to shallow water, port entry and departure and has the echo sounder remained in operation while the vessel has been transiting in shallow waters?

YES

## INSPECTOR COMMENTS

Echo sounder shallow water alarm was tested.



[Q322\\_99f3ff08-f171-4f8a-9470-8abd91af2a.jpg](#)

- 3.23 Was the berth-to-berth passage plan of the previous voyage comprehensive and approved by the Master?

YES

## INSPECTOR COMMENTS

A software was in use for making the berth-to-berth passage plans.



[Q323\\_b719dd86-2441-4d97-9a21-e0f963e968a8.jpg](#)




[Q323\\_b719dd86-2441-4d97-9a21-e0f963e968a8.jpg](#)

- 3.24 Was the ship's track monitored at sea and during pilotage, and were parallel indexing techniques used to monitor the passage in coastal and pilotage waters, particularly during restricted visibility or nighttime conditions?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS


Total: 139 (51%)

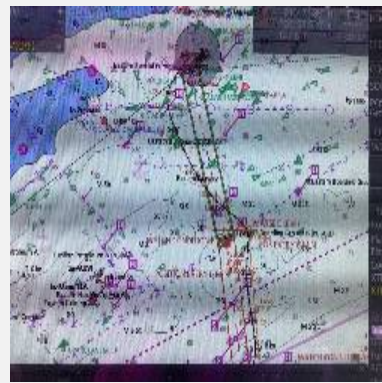

[Q324\\_7a37905b-f3b0-4b7c-85b4-88420ecbb0a1.jpg](#)



[Q324\\_af9b857a-b612-4e7f-aac1-fa01957d6833.jpg](#)

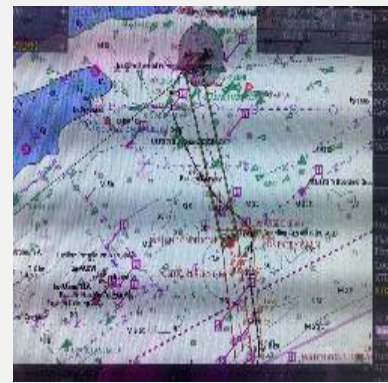

[Q324\\_7a37905b-f3b0-4b7c-85b4-88420ecbb0a1.jpg](#)



[Q324\\_af9b857a-b612-4e7f-aac1-fa01957d6833.jpg](#)

## Section 4: ISM System

4.1 Has the vessel's manager established a documented system for personnel to effectively implement the ISM Code? (V)

YES

☐ INSPECTOR COMMENTS

The DOC was issued by class BV on 30 Sept 2022. The SMC was issued by class BV on 17 July 2025.

4.2 Has a safety officer been appointed and adequately trained, onboard safety meetings held regularly and acknowledged by the vessel's manager, with feedback provided where necessary, and are safety inspections of the main deck, machinery space, accommodation and forecastle store conducted at regular intervals in accordance with the company's procedures, and are health, safety, and environmental hazards effectively identified? (V)

YES

☐ INSPECTOR COMMENTS

The Chief officer was the designated safety officer.

4.3 Are the latest shipboard internal and external audits, as well as the superintendent inspection reports, available? Are corrective actions being taken in response to recorded non-conformances?

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

The most recent internal audit was carried out on 23 Mar 2026. The external audit was carried out by class BV on 17 July 2025.

- 4.4 Does the Master periodically review the effectiveness of the onboard Safety Management System, report the findings to shore based management and receive feedback from them? (M)

YES

## INSPECTOR COMMENTS

The last Master review was completed on 30 May 2025. The shore management feedback was provided on 10 Jun 2025.

- 4.10 Are procedures for reporting, investigating, and closing out non-conformities, incidents, and hazardous situations available and being followed and, is an incident investigation report or a summarised lessons learned bulletin available for each reported incident?

YES

## INSPECTOR COMMENTS

12 near miss reported in past one year. No accident and Incident reported.

- 4.11 Has a PPE Matrix for use of personal protective equipment been provided and is it being worn as required?

YES



[Q411\\_a1050926-23a5-4f59-8186-a75ae376ef63.jpg](#)



[Q411\\_a6707f91-ef18-4c33-ab9f-b83479885404.jpg](#)



[Q411\\_a6707f91-ef18-4c33-ab9f-b83479885404.jpg](#)

- 4.14 Are water ingress detector systems (WIDS) and alarms maintained in good condition and are the records of tests being maintained?

YES

## INSPECTOR COMMENTS

Test record was sighted.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q414\\_b6645646-a729-424f-89b8-2dfd3b1cba84.jpg](#)



[Q414\\_b6645646-a729-424f-89b8-2dfd3b1cba84.jpg](#)

4.15 Has a smoking policy been implemented; is it being followed and are designated smoking areas adequately identified?

YES




[Q415\\_6270ed76-c6dd-4fad-83ce-bd83c5bd84fd.jpg](#)



[Q415\\_6270ed76-c6dd-4fad-83ce-bd83c5bd84fd.jpg](#)

4.16 Are portable gas detectors suitable for atmosphere testing of enclosed spaces provided; in good condition; calibrated in accordance with the manufacturer's instructions, and are officers trained and competent with their operation?

YES

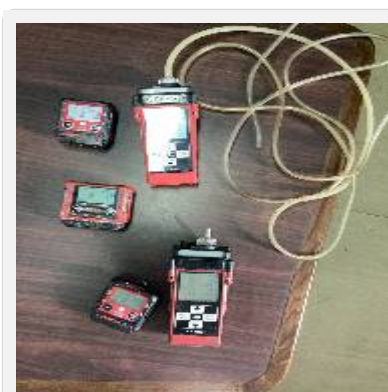

[Q416\\_9232805a-9124-4c2d-b6d5-fc4c854fb93c.jpg](#)

4.18 Are the lifeboats, rescue boat and davit-launched life raft their equipment and launching arrangements serviced periodically in good condition, and are the crew familiar with the launching procedure and operation?

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

Free fall lifeboat engine and rescue boat engine were tested. Davit for launching rescue boat and life rafts was swung under emergency power.

[Q418\\_100\\_2360.JPG](#)[Q418\\_100\\_2386.JPG](#)[Q418\\_100\\_2399.JPG](#)


4.19 Are life rafts in good order and are hydrostatic release units maintained and installed correctly?

YES

[Q419\\_100\\_2393.JPG](#)[Q419\\_100\\_2394.JPG](#)

4.20 Are life jackets in good condition, allocated as per the plan and donning instructions clearly displayed?

YES

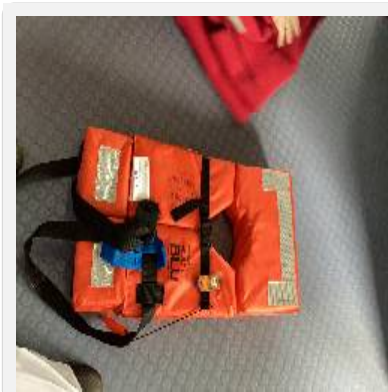[Q420\\_498fad2a-9bfd-4b4e-9f2a-847eb7562357.jpg](#)[Q420\\_498fad2a-9bfd-4b4e-9f2a-847eb7562357.jpg](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

4.21 Are immersion suits in good condition, allocated as per the fire and safety plan and donning instructions clearly displayed?

YES

## INSPECTOR COMMENTS

Immersion suits leak test was carried out by external agency on 23 May 2025.

[Q421\\_82de0ae1-0ba8-49dd-8546-14479c51571b.jpg](#)

4.23 Has a sample of foam compound, applicable to both fixed and portable systems, been sent for regular testing and is evidence of satisfactory results available?

YES

## INSPECTOR COMMENTS

Fixed foam system for engine room was fitted, the last analysis report was dated 26 May 2025.

4.24 Are fire mains and associated isolation valves, fire boxes, hoses, nozzles, applicators, and spanners regularly inspected and maintained and found to be in a satisfactory operating condition?

YES

## INSPECTOR COMMENTS

Main fire line isolation valve located inside fire control station was lubricated.

[Q424\\_100\\_2376.JPG](#)[Q424\\_100\\_2413.JPG](#)

4.25 Are the International Shore Connection fitting arrangements clearly marked and well maintained and are the crew aware of their location?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q425\\_100\\_2423.JPG](#)[Q425\\_100\\_2424.JPG](#)

- 4.26 Are records available to show that fixed fire detection and fire alarm systems have been tested at regular intervals and maintained in good condition?

YES

## INSPECTOR COMMENTS

Weekly test record for sensor was maintained.

[Q426\\_bbcba09a-062d-48df-bce5-09d8790a9f74.jpg](#)[Q426\\_bbcba09a-062d-48df-bce5-09d8790a9f74.jpg](#)

- 4.27 Are the fixed fire extinguishing systems (where fitted) inspected, tested and in good order?

YES

## INSPECTOR COMMENTS

Fixed foam system and water mist system were inspected by external agency on 23 May 2025

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q427\\_100\\_2547.JPG](#)[Q427\\_100\\_2549.JPG](#)

4.28 Is the emergency fire pump being regularly tested, in good operational condition and are starting instructions clearly posted?

YES

## INSPECTOR COMMENTS

The emergency fire pump was tested using two hoses.

4.29 Are portable fire extinguishers being maintained in good order, and ready for immediate use in an emergency?

YES

## INSPECTOR COMMENTS

The portable fire extinguisher was inspected by external agency on 23 May 2025.

4.31 Is the operation and maintenance of the breathing apparatus air recharging system (where fitted) incorporated in the ship's safety management manual, and has the annual air quality check for breathing apparatus air recharging systems been carried out?

YES

[Q431\\_100\\_2417.JPG](#)

4.32 Are records available to show that Emergency Escape Breathing Devices (EEBDs) in the accommodation and engine room are being inspected, in good condition and are available for instant use?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q432\\_100\\_2541.JPG](#)

- 4.33 Are ventilation fire dampers clearly marked with open/close positions and space served and is there evidence of regular testing and maintenance?

YES

[Q433\\_100\\_2397.JPG](#)

- 4.35 Is a safe means of access to the vessel being provided?

YES

## INSPECTOR COMMENTS

Pilot ladder was used at anchorage.

[Q435\\_100\\_2337.JPG](#)



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

4.36 Are accommodation ladders and gangways maintained in good condition, marked clearly, and inspected regularly

YES


[Q436\\_100\\_2443.JPG](#)


4.39 If the vessel is provided with a helicopter operating area, does the area comply with the requirements of ICS guidelines, and is there a safe access from the hatch cover to deck?

YES

## INSPECTOR COMMENTS

No. 4 hatch cover was the helideck.


[Q439\\_95d7c6ed-b1ca-4134-bf82-633c8736b06c.jpg](#)

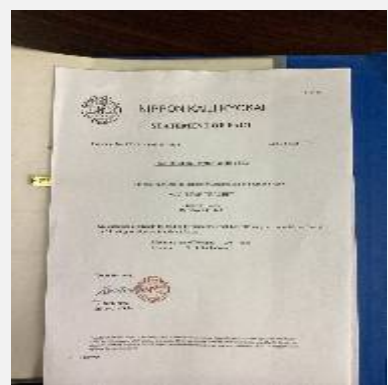[Q439\\_efeca329-3614-495b-9c84-a8aee092930f.jpg](#)

[Q439\\_95d7c6ed-b1ca-4134-bf82-633c8736b06c.jpg](#)

4.41 Are the crew familiar with the helicopter operation at sea, and are records available to show that the proper communication, shipboard helicopter safety checklist and specific risk assessment conducted prior to helicopter operation?

YES

## INSPECTOR COMMENTS

Helicopter operation drill carried out every quarter.

4.42 Are the lifebuoys, related equipment, and pyrotechnics in good working order?

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q442\\_100\\_2343.JPG](#)[Q442\\_100\\_2372..JPG](#)

## Section 5: Pollution Prevention and Control

5.5 Is the vessel free from any visible bulkhead leakage? (V)

YES

## INSPECTOR COMMENTS

The engine room bulkhead was checked.

5.9 Are the emergency arrangements to pump out the spaces forward of the collision bulkhead in the event of flooding in good order, and are these arrangements prominently marked? (V)

YES

[Q509\\_45edb795-cc43-40d9-80db-bd9fe5946a95.jpg](#)[Q509\\_45edb795-cc43-40d9-80db-bd9fe5946a95.jpg](#)

5.13 Are the emergency bilge suction and emergency overboard discharge valves in the engine room in good order and clearly identified with a notice warning against accidental opening and, is the area around the bilge injection suction bellmouth clear of debris and clean?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q513\\_100\\_2626.JPG](#)

- 5.15 Are the engineering officers familiar with the company procedures for operating the oil filtering equipment, and was the equipment in satisfactory condition and used in compliance with company procedures, the manufacturer's instructions, and MARPOL Annex I?

YES

## INSPECTOR COMMENTS

The 15 ppm alarm and automatic stopping device of the oily water separator were tested.

[Q515\\_100\\_2612.JPG](#)[Q515\\_100\\_2617.JPG](#)

- 5.19 Has a Garbage Management Plan been provided and is the Garbage Record Book (GRB) being correctly maintained?

YES

[Q519\\_100\\_2401.JPG](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

5.21 Has a ship-specific Energy Efficiency Management Plan been provided to the vessel?

YES

## INSPECTOR COMMENTS

The vessel rating was B for year 2024.

5.25 Are the ballast pumping systems, including their associated instruments, controls, valves, pipework, and the control panel (including pressure gauges, draft gauges, and the remote control system), in good working order and is there recorded evidence of regular inspection?

YES

## INSPECTOR COMMENTS

Ballast control panel and draft gauges were not fitted.

[Q525\\_100\\_2559.JPG](#)[Q525\\_100\\_2560.JPG](#)[Q525\\_100\\_2604.JPG](#)

5.26 Are bunker and ballast tank manholes maintained in good condition?

YES

[Q526\\_100\\_2347.JPG](#)[Q526\\_100\\_2349.JPG](#)

5.27 Are the crew members familiar with the operation and maintenance of the sewage treatment plant, and is the sewage treatment plant, including its associated piping, discharge pumps, and air blowers, in good condition?

YES

## INSPECTOR COMMENTS

The sewage treatment plant, high level alarm was tested.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q527\\_100\\_2538.JPG](#)

## Section 6: Ship's Structure

6.1 Is the vessel free of any hull repairs unreported to class? (V)

YES

[Q601\\_100\\_2326.JPG](#)[Q601\\_100\\_2335.JPG](#)

6.3 Is the Enhanced Survey report file adequately maintained and does the condition evaluation report confirm the fitness of the ship for its intended service for the next five years? (M)

YES

## INSPECTOR COMMENTS

The Condition Evaluation report recorded all ballast tanks condition as good.

6.8 Are cargo hold ventilation systems being maintained in good condition? (V)

YES

## INSPECTOR COMMENTS

Natural ventilation was fitted.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q608\\_100\\_2459.JPG](#)

## Section 7A: Fuel Management (Oil)

7A.1 Is adequate manifold spill containment provided under the bunker manifolds, and are they clean and empty? (V)

YES

[Q7a01\\_100\\_2452.JPG](#)[Q7a01\\_100\\_2453.JPG](#)

7A.4 Are save-alls fitted around all fuel, diesel, and lubricating oil tank vents; are they clean and empty, and is the drain plug secured with a strap chain to a save-all? (V)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q7a04\\_100\\_2451.JPG](#)

7A.9 Are ship-specific procedures to control the change from residual to low-sulphur / distillate fuels and vice versa provided, and is the fuel oil change over logbook and data collection system being maintained correctly? (V & M)

YES

## INSPECTOR COMMENTS

FOBAS calculator was in use.

7A.10 Are the Quick Closing Valves serving fuel and lubricating oil systems being regularly tested and in good order?

YES

## INSPECTOR COMMENTS

Weekly inspection record was sighted.

7A.11 Are high pressure fuel delivery pipes of diesel engines protected with a jacketed piping and alarm system, and is the alarm system being tested regularly and in good order?

YES

## INSPECTOR COMMENTS

Fuel oil leak off alarms of main engine and no.3 auxiliary engine were tested.

7A.12 Are purifier rooms and fuel and lubricating oil handling areas ventilated, free of oil leaks and clean?

YES

[Q7a12\\_100\\_2582.JPG](#)[Q7a12\\_100\\_2587.JPG](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

7A.13 Is the reserve fuel tank of the emergency generator filled with sufficient fuel of a suitable type for at least 18 hours operation?

YES

[Q7a13\\_100\\_2410.JPG](#)

## Section 8B: Cargo Operation - Bulk Grain

8B.6 Is a Class-approved loading computer or programme in use and has its operational accuracy been regularly tested? (V)

YES

## INSPECTOR COMMENTS

The loading computer accuracy tested every month by chief officer. The last class verification was carried out in May 2025.

8B.9 Are there guidelines and procedures for hold cleaning in place (V)

YES

## INSPECTOR COMMENTS

The vessel carried two high pressure washing machines, Combi Gun, brooms, shovels, scaffolding's.

8B.24 Has the Master informed the appropriate authorities of the country of destination about the fumigation?

YES

## INSPECTOR COMMENTS

The vessel was at Singapore for bunkering and storing, Master has already informed discharge port about cargo fumigation.

## Section 9A: Hatch Cover and Lifting Appliances

9A.2 Is there a procedure in place for the safe operation and inspection of hatch covers and, has the Master/Chief Officer received appropriate training in hatch cover inspection and maintenance?

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

The Master and Chief officer completed an online training course for hatch cover inspection and maintenance.

- 9A.3 Are adequate procedures in place for carrying out hose and / or ultrasonic testing of hatch covers and is documented evidence of such testing available? (V)

YES

## INSPECTOR COMMENTS

The last hose test of hatch covers was carried out on 05 Feb 2026.

- 9A.6 Are quick-acting cleats and crutches all in place and in good working condition with the rubber washers flexible and free from paint and cracks? (V)

YES



Q9a06\_100\_2462.JPG



Q9a06\_100\_2464.JPG

- 9A.13 Are the following parts of the hatch covers, where applicable, all in good order and do they appear to be well maintained?<ul><li>Wheels/bearings or trackway</li><li>Hydraulic system including hoses</li><li>Chains</li><li>Link pin and safety pin</li><li>Cargo holds' ventilator on the side and end of hatch panel</li></ul>

YES



Q9a13\_100\_2340.JPG



Q9a13\_100\_2461.JPG

- 9A.16 Are officers familiar with emergency hatch cover operation arrangements and is there evidence of effective training of personnel available on board?

YES

## INSPECTOR COMMENTS

The last hatch covers emergency operation training was carried out on 05 Feb 2026.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q9a16\\_100\\_2509.JPG](#)

## Section 10: Mooring Operations

- 10.1 Has the company established guidelines and procedures for the inspection, maintenance and wear zone management of the mooring lines and are they being implemented? (V & M)

YES

## INSPECTOR COMMENTS

Five spare mooring ropes were carried on board.

[Q1001\\_100\\_2384.JPG](#)[Q1001\\_100\\_2497.JPG](#)

- 10.4 Do mooring lines and mooring tails comply with industry guidelines and are they in good order? (V & M)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1004\\_100\\_2433.JPG](#)[Q1004\\_100\\_2490.JPG](#)

10.5 Is there a procedure for testing the winch brake rendering setting and is it being tested regularly? (V & M)

YES

[Q1005\\_100\\_2432.JPG](#)

10.15 Are the controls, linkages, operating levers, brake drums, brake linings, and pins of the winches, as well as the working access arrangement to the winches, in good working order?

YES

[Q1015\\_100\\_2436.JPG](#)[Q1015\\_100\\_2498.JPG](#)

10.16 Are the pedestal fairleads, roller fairleads and other rollers free of grooving, well-greased and free to turn? (V)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1016\\_100\\_2439.JPG](#)[Q1016\\_100\\_2492.JPG](#)

10.17 Are the fairleads, rollers, bitts, chocks and other items of mooring equipment clearly marked with the relevant SWL? (V)

YES

[Q1017\\_100\\_2441.JPG](#)[Q1017\\_100\\_2491.JPG](#)

10.18 Are the windlasses, anchors, locking bars, and cables, as well as the working access arrangement, in good working order and are they maintained as part of the plan maintenance system? (V)

YES

[Q1018\\_100\\_2494.JPG](#)[Q1018\\_100\\_2495.JPG](#)

10.19 Have the anchors been tightly secured in the hawse pipe? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1019\\_100\\_2323.JPG](#)

10.20 Are the chain locker doors firmly battened down and are the bitter end securing arrangements located outside the chain locker and accessible? (V)

YES

[Q1020\\_100\\_2505.JPG](#)[Q1020\\_100\\_2506.JPG](#)

## Section 11: Radio and Communication

11.2 Is communication equipment, listed in the Record of Equipment attached to the Safety Radio Certificate or Safety Certificate (Form R or Form C), in good condition and has the GMDSS Logbook (the Radio Log) been maintained correctly and are daily, weekly and monthly tests being carried out? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q1102\\_62f02be6-6aa8-48c7-b1ee-01416a9a6832.jpg](#)



[Q1102\\_90e3f5d1-3353-4bb7-87e6-eae9b778f9a8.jpg](#)



[Q1102\\_62f02be6-6aa8-48c7-b1ee-01416a9a6832.jpg](#)

## 11.3 Has the Satellite EPIRB been correctly installed, tested and maintained? (V &amp; M)

YES



[Q1103\\_45be3335-e1d4-4bb8-8d93-483c9635a85c.jpg](#)



[Q1103\\_ffb5054f-db6f-42d6-bd55-52bf0fc557f6.jpg](#)



[Q1103\\_45be3335-e1d4-4bb8-8d93-483c9635a85c.jpg](#)



[Q1103\\_ffb5054f-db6f-42d6-bd55-52bf0fc557f6.jpg](#)

## 11.6 Are Search and Rescue Radar Transponders (SARTs) in good order and tested regularly? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q1106\\_f8ddbba8-f87c-442f-ac9c-af008daee293.jpg](#)

11.7 Are survival craft portable VHF radios in good order and charged? (V)

YES



[Q1107\\_64a79736-838a-4489-8106-588d856a2f7c.jpg](#)



[Q1107\\_64a79736-838a-4489-8106-588d856a2f7c.jpg](#)

11.8 Is the AIS static, dynamic and voyage data up to date and has an AIS annual test been performed and the record available on board? (V & M)

YES



[Q1108\\_ffdd2c9-e027-40a1-8c92-b02ab054eee0.jpg](#)



[Q1108\\_ffdd2c9-e027-40a1-8c92-b02ab054eee0.jpg](#)

11.9 Is there a Shore-Based Maintenance Agreement in place to fulfil the maintenance requirements? (M)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

The GMDSS Shore-Based Maintenance Agreement was valid until 17 Jan 2028.

## Section 12: Security

- 12.2 Has a Ship Security Officer (SSO) been appointed and trained adequately to perform the duties of SSO and have all crew received security-related training and instructions? (V)

YES

## INSPECTOR COMMENTS

Master was the Ship security officer

## Section 13: Machinery Space

- 13.1 Are adequate engineering procedures, instructions and guidelines included in the SMS? (V)

YES

## INSPECTOR COMMENTS

Electrical OPL(Over rideable power limiter was fitted) On board management manual was provided.



[Q1301\\_b3dfb96f-8ca6-41b0-99cc-156ab68dfc3f.jpg](#)



[Q1301\\_100\\_2536.JPG](#)



[Q1301\\_b3dfb96f-8ca6-41b0-99cc-156ab68dfc3f.jpg](#)

- 13.3 Has the Chief Engineer prepared specific standing orders, night and day orders, and have these orders been read, understood, and signed by the watch standing engineers, engine crew, and electrical engineer, where applicable? (V & M)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1303\\_100\\_2544.JPG](#)

- 13.4 If the vessel has been certified for periodically unattended machinery spaces operation (UMS), is the machinery space being operated in that mode? (V)

YES

[Q1304\\_100\\_2545.JPG](#)

- 13.8 Is an engineer's calling alarm system fitted and is it tested regularly, in good order and the results recorded? (V)

YES

## INSPECTOR COMMENTS

The engineer's calling alarm system was tested.

[Q1308\\_c9131b6f-d213-43ac-8c5b-23922d7025b8.jpg](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

13.9 Is the engine room logbook, as well as other required records being properly maintained? (V)

YES



[Q1309\\_05afa60f-8ea3-4947-a233-610849717e54.jpg](#)



[Q1309\\_94514ba9-6ccd-4730-9726-12a3536d90ed.jpg](#)



[Q1309\\_05afa60f-8ea3-4947-a233-610849717e54.jpg](#)

13.13 Is the main engine maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

YES



[Q1313\\_100\\_2552.JPG](#)

13.14 Are the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept?(V)

YES



[Q1314\\_100\\_2551.JPG](#)




[Q1314\\_100\\_2566.JPG](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

- 13.15 Are all areas of the machinery space well illuminated, emergency escape routes clearly marked, unobstructed and are ship's crew familiar with the escape routes? (V)

YES

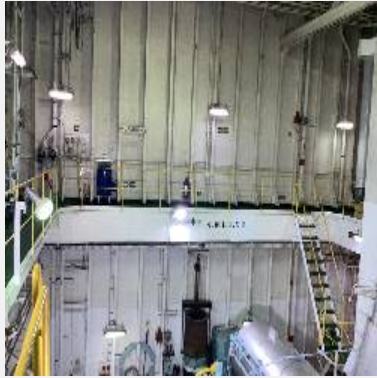

[Q1315\\_15da68e8-c43d-4b6c-a581-aa321ad70b65.jpg](#)



[Q1315\\_7dd5ec82-1f66-452a-b4bb-64875ef86d17.jpg](#)



[Q1315\\_7dd5ec82-1f66-452a-b4bb-64875ef86d17.jpg](#)

- 13.18 Are engine room emergency stops for ventilation fans and the closing mechanism of ventilation supply and exhaust ducts clearly marked, in working condition, and do records indicate that they have been regularly tested? (V)

YES

## INSPECTOR COMMENTS

Funnel fire dampers and engine room blowers fire dampers were tested,



[Q1318\\_100\\_2379.JPG](#)



[Q1318\\_100\\_2388.JPG](#)

- 13.19 Are engine exhausts and other hot surfaces effectively shielded against oil spray and are flanges and connections of flammable liquid pipelines adequately protected with guards and spray tape? (V)

YES

## INSPECTOR COMMENTS

The main engine and auxiliary engine fuel leak off alarms were tested.



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)


[Q1319\\_100\\_2563.JPG](#)

[Q1319\\_100\\_2593.JPG](#)

13.20 Is the lagging and insulation in good condition and free of oil impregnation? (V)

YES


[Q1320\\_100\\_2586.JPG](#)

[Q1320\\_100\\_2590.JPG](#)

13.21 Are the main engine bearing temperature monitors or crankcase oil mist detector(s) in good condition and tested on a regular basis as specified by the manufacturer, and are engineers familiar with the procedure to follow in the event of oil mist in the crankcase? (V)

YES

## INSPECTOR COMMENTS

The main engine crankcase oil mist detector was tested.


[Q1321\\_b563953f-65b2-4a71-a31c-ee143b3c18b7.jpg](#)

[Q1321\\_fbe600ea-0dba-4c47-b4dc-7beaa4af3a49.jpg](#)


[Q1321\\_fbe600ea-0dba-4c47-b4dc-7beaa4af3a49.jpg](#)

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

13.22 Were the electrical switchboards surrounded by suitable deck insulation, and was the insulation in good order? (V)

YES

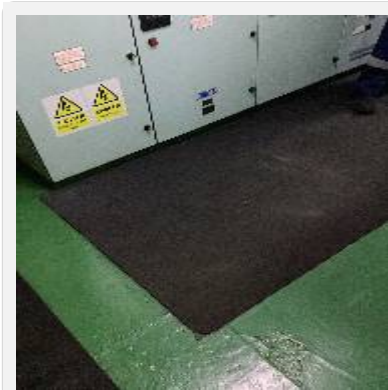


[Q1322\\_580d59bf-be56-4b99-862a-9827d13a57e0.jpg](#)



[Q1322\\_756c884c-0483-44da-9e3c-debe2d9fba46.jpg](#)

13.23 Are the spring-loaded drain valves and gauge glass self-closing valves/ cocks being maintained and in good order? (V)

YES

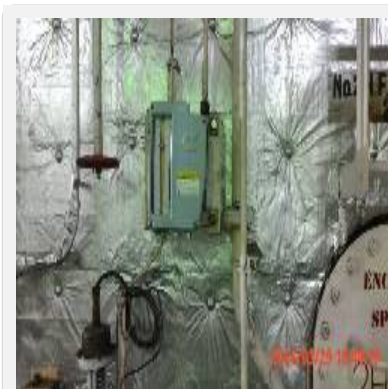

[Q1323\\_100\\_2585.JPG](#)

13.26 Is the workshop clean and tidy, and are the engine room workshop tools' protective guards, shields, and emergency stops in good condition? (V)

YES



[Q1326\\_100\\_2557.JPG](#)



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

13.27 Is the engine room crane, other lifting equipment, and hydraulic tools inspected, tested, and maintained on a regular basis? (V &amp; M)

YES

[Q1327\\_100\\_2532.JPG](#)[Q1327\\_100\\_2571.JPG](#)

13.29 Is the standard of housekeeping in the machinery space and steering gear room satisfactory, are these areas clean, free from obvious leaks, and is the engine room bilge clean and free of oil and sediment? (V)

YES

[Q1329\\_100\\_2565.JPG](#)[Q1329\\_100\\_2611.JPG](#)

13.31 Is the bilge high level alarm system in good order, regularly tested and are records of test maintained? (V)

YES

## INSPECTOR COMMENTS

Engine room bilges high level alarms were tested.

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1331\\_100\\_2602.JPG](#)[Q1331\\_100\\_2620.JPG](#)


- 13.32 Are the sea chests, seawater pumps, and associated seawater lines and valves in good working order, with no leaks, hard rust, or temporary repairs?

YES

[Q1332\\_100\\_2561.JPG](#)[Q1332\\_100\\_2600.JPG](#)

- 13.34 Is the pipe work in the machinery space, including but not limited to steam, fuel, lubricating oil, sewage, drain and air lines well maintained, in good condition and free of temporary repair and leakage? (V)

YES

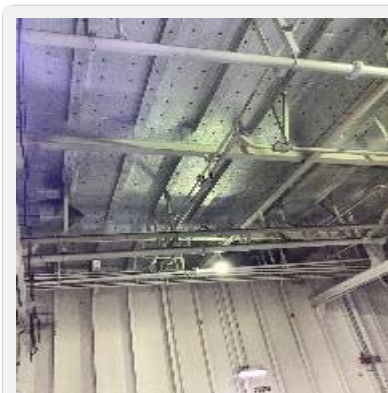[Q1334\\_bce333e9-d03f-4745-a2ae-7e0bcac8042d.jpg](#)[Q1334\\_100\\_2598.JPG](#)

- 13.35 Are engineers familiar with operation of the main engine from the local manoeuvring control position? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## INSPECTOR COMMENTS

The most recent training for main engine from the local manoeuvring control was carried out on 17 Feb 2026.

[Q1335\\_100\\_2631.JPG](#)

13.36 Are crew familiar with the starting procedure for the emergency generator and how to put power on the emergency switch board? (V)

YES

## INSPECTOR COMMENTS

Emergency generator was tested by two batteries.

[Q1336\\_100\\_2403.JPG](#)

13.39 Is the main and emergency switchboard earth fault monitoring equipment operational with no earthing faults indicated? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q1339\\_641c5c14-320f-452c-928f-e3ea104de317.jpg](#)



[Q1339\\_6ea27ff7-4a80-401b-b484-5b4799592613.jpg](#)



[Q1339\\_6ea27ff7-4a80-401b-b484-5b4799592613.jpg](#)

13.40 Is an emergency steering gear drill being carried out every three months? (V)

YES

## INSPECTOR COMMENTS

Emergency steering was tested.



[Q1340\\_57d9af7f-28a6-4b7c-aabb-6e5670fa02e2.jpg](#)

13.41 Is the emergency reserve tank of the steering gear system fully charged and is the manual transfer pump operational?? (V)

YES

## INSPECTOR COMMENTS

The low level alarm of the steering system tank was tested.



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q1341\\_4851993c-f6ec-4347-a2a0-ce957e848bda.jpg](#)



[Q1341\\_4851993c-f6ec-4347-a2a0-ce957e848bda.jpg](#)

13.42 Is a heading indicator and communication system provided in the steering gear room and are they in good order? (V)

YES



[Q1342\\_571d6587-e540-448c-93cd-42ed17e3b297.jpg](#)

13.43 Is the rudder angle indicator at the emergency steering position in good order, and is the display clearly legible? (V)

YES



[Q1343\\_403cc1d9-9f58-4b9b-8054-e28a81d9bbc0.jpg](#)



[Q1343\\_e3f06bd5-c311-4f67-9abc-f97c71d31b44.jpg](#)

13.45 Are suitable handrails, gratings or other non-slip surfaces provided for the steering gear compartment? (V)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)



[Q1345\\_7879cbcd-c5cd-43c3-85a4-9d4db5293250.jpg](#)

## Section 14: General Appearance - Hull and Superstructure

14.1 Is the ship's hull clean, free of significant corrosion, extensive coating breakdown and marine growth? (V)

YES



[Q1401\\_100\\_2323.JPG](#)



[Q1401\\_100\\_2325.JPG](#)

14.3 Are the weather decks free of loose rust scale and maintained in a satisfactory condition? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1403\\_100\\_2341.JPG](#)[Q1403\\_100\\_2465.JPG](#)



14.4 Are the pipes on deck free of significant corrosion, pitting, soft patches, leakage or temporary repair and maintained in good condition? (V)

YES

[Q1404\\_100\\_2485.JPG](#)[Q1404\\_100\\_2514.JPG](#)

14.5 Are all watertight doors (where fitted), fire doors, weathertight doors, portholes and wheelhouse windows maintained in good order? (V)

YES

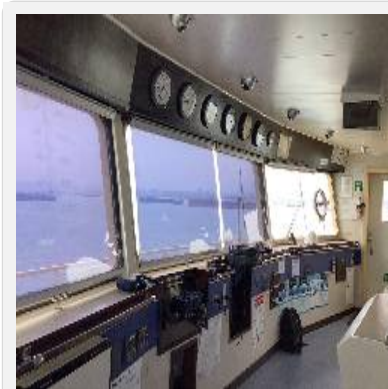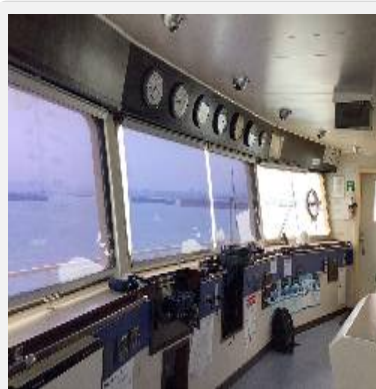[Q1405\\_0cadd385-2407-4438-9698-be4da60441a4.jpg](#)[Q1405\\_0cadd385-2407-4438-9698-be4da60441a4.jpg](#)

14.6 Are the vents and air pipes on weather decks maintained in good order and are they clearly marked to indicate the compartment they serve? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1406\\_100\\_2344.JPG](#)[Q1406\\_100\\_2455.JPG](#)

14.8 Are the hatch numbers clearly indicated and correctly placed? (V)

YES

[Q1408\\_100\\_2368.JPG](#)

14.9 Are the mast heads and their fittings, including but not limited to wire stays, as well as the flood lights, deck lights, emergency lights, and hold lights (if installed), in good working order? (V)

YES

[Q1409\\_c9797b09-6f5f-4886-97ec-867daeeba6fa.jpg](#)[Q1409\\_100\\_2364.JPG](#)

14.12 Are the chemicals and gases stored correctly, and are the paint locker, battery room, oxygen and acetylene rooms, and other flammable lockers and storage spaces equipped with ventilation systems, explosion-proof lights, and other fittings in good working order? (V)

YES

## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1412\\_100\\_2374.JPG](#)[Q1412\\_100\\_2448.JPG](#)

14.13 Are the stores located inside the accommodation and on the weather decks clean and tidy? (V)

YES

[Q1413\\_100\\_2511.JPG](#)[Q1413\\_100\\_2523.JPG](#)

14.15 Are galley appliances, audio-visual equipment, and other electrical equipment inside the accommodation in good order? (V)

YES

[Q1415\\_100\\_2516.JPG](#)[Q1415\\_100\\_2519.JPG](#)

14.16 Are the door seals, catches and alarm system of the refrigerated space in good order? (V)

YES



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

[Q1416\\_100\\_2521.JPG](#)

14.18 If provided, is the ship's hospital properly equipped, clean, hygienic and for medical use only? (V &amp; M)

YES

[Q1418\\_100\\_2421.JPG](#)[Q1418\\_100\\_2422.JPG](#)

14.19 Are the ship's guard rails, walkways, and access ladders, as well as the steps and railings, maintained and in good working order, and are the securing arrangements for deck cargoes on the deck also maintained and in satisfactory condition?(V)

YES

[Q1419\\_100\\_2342.JPG](#)



## ANSWERED YES WITH COMMENTS AND/OR ATTACHMENTS

Total: 139 (51%)

## Section 15: Health and Welfare of Seafarers

- 15.1 Do the Seafarer Employment Agreements (SEA) comply with the requirements of MLC 2006, do crew salaries meet or exceed the current ILO Minimum Wage Scale, and are individual monthly statements provided to all seafarers on board, detailing their wages and any authorised deductions, such as allotments? (V & M)

YES

## INSPECTOR COMMENTS

The contract period of officers was six months, plus/ minus one month. The contract period of ratings was eight months, plus/ minus one month

- 15.2 Are the accommodation spaces safe, provided to a respectable level of health and hygiene and regularly inspected, including checks of ventilation, noise, heating, lighting, and sanitation? (V)

YES

[Q1502\\_100\\_2357.JPG](#)[Q1502\\_100\\_2519.JPG](#)

- 15.3 Are the ship's staff provided with adequate recreational facilities on board, and has the Master been allocated a monthly welfare budget? (V)

YES

## INSPECTOR COMMENTS

The internet was free of charge to all crew members, 10 GB per person per month. The welfare budget was USD 100 per month. The most recent B.B.Q party was held end of Feb 2026.

- 15.5 Are seafarers being provided with sufficient food and water free of charge and does the cook hold appropriate qualifications? (V)

YES

## INSPECTOR COMMENTS

The food budget was USD 9.50 per person per day.

- 15.6 Are ship's staff provided with appropriate medical care and access to health promotion programs, and is there evidence that visits to a qualified medical doctor or dentist are arranged without delay in ports of call, when required? (V)

YES

## INSPECTOR COMMENTS

Posters were displayed.

## ANSWERED YES WITHOUT COMMENTS OR ATTACHMENTS

Total: 89 (33%)

|                                                          |                                                                                                                                                                    |
|----------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Section 2: Certification and Personal Management         | 2.2, 2.5                                                                                                                                                           |
| Section 3: Navigation                                    | 3.2, 3.3, 3.5, 3.6, 3.8, 3.9, 3.14, 3.16, 3.26, 3.27, 3.28                                                                                                         |
| Section 4: ISM System                                    | 4.5, 4.6, 4.7, 4.8, 4.9, 4.13, 4.30, 4.34, 4.38, 4.43, 4.44                                                                                                        |
| Section 5: Pollution Prevention and Control              | 5.1, 5.2, 5.3, 5.6, 5.7, 5.8, 5.10, 5.12, 5.14                                                                                                                     |
| Section 6: Ship's Structure                              | 6.2, 6.7                                                                                                                                                           |
| Section 7A: Fuel Management (Oil)                        | 7A.2, 7A.3, 7A.5, 7A.7                                                                                                                                             |
| Section 8B: Cargo Operation - Bulk Grain                 | 8B.2, 8B.4, 8B.7, 8B.8, 8B.10, 8B.11, 8B.12, 8B.14, 8B.15, 8B.16, 8B.17, 8B.18, 8B.19, 8B.20, 8B.21, 8B.22, 8B.23, 8B.26, 8B.27, 8B.30, 8B.31, 8B.32, 8B.34, 8B.35 |
| Section 9A: Hatch Cover and Lifting Appliances           | 9A.15                                                                                                                                                              |
| Section 10: Mooring Operations                           | 10.12, 10.13, 10.14, 10.21, 10.22                                                                                                                                  |
| Section 11: Radio and Communication                      | 11.4, 11.5                                                                                                                                                         |
| Section 12: Security                                     | 12.1, 12.3, 12.5, 12.7, 12.8                                                                                                                                       |
| Section 13: Machinery Space                              | 13.2, 13.6, 13.10, 13.11, 13.17, 13.24, 13.25, 13.33                                                                                                               |
| Section 14: General Appearance - Hull and Superstructure | 14.11                                                                                                                                                              |
| Section 15: Health and Welfare of Seafarers              | 15.9, 15.10, 15.11, 15.14                                                                                                                                          |

## ANSWERED N/A WITH COMMENTS OR ATTACHMENTS

Total: 23 (8%)

## Section 2: Certification and Personal Management

2.6 Has the Master been provided with relevant ship handling training? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

The Master had more than 36 months of command experience.

2.8 Have officers and ratings responsible for cargo handling on ships carrying dangerous and hazardous substances in packaged form, undergone formal training (V)?

NOT APPLICABLE

INSPECTOR COMMENTS

The vessel was classed as a bulk carrier.

## Section 5: Pollution Prevention and Control

5.18 Has a declaration been provided by the shipper as to whether the cargo is harmful to the marine environment (HME)?

NOT APPLICABLE

INSPECTOR COMMENTS

The vessel loading grain cargoes in past 12 months.

5.23 If the vessel has an Exhaust Gas Cleaning System (scrubber system), is it in good working order, are the engineers familiar with its safe operation, and have procedures been incorporated into the Safety Management System?

NOT APPLICABLE

INSPECTOR COMMENTS

Not fitted.

## Section 6: Ship's Structure

6.6 If the vessel has a duct keel, is the access, mechanical ventilator, and lighting adequate and is it free of water? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

No duct keel was fitted.

## Section 8B: Cargo Operation - Bulk Grain

## ANSWERED N/A WITH COMMENTS OR ATTACHMENTS

Total: 23 (8%)

8B.5 If the document of authorisation was not provided, can the Master demonstrate the compliance of the ship's stability with the Grain Code? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

Document of authorisation was provided.

8B.25 Did the vessel receive a fumigant gas-free certificate issued by the fumigator-in-charge at or prior to the discharge port or, in the absence of a gas-free certificate did the Master implement appropriate safety measures to manage potential residual fumigant risks before and during discharge operations?

NOT APPLICABLE

INSPECTOR COMMENTS

The vessel was at bunkering port.

8B.29 Is ventilation of cargo holds, where required, being carried out and recorded?

NOT APPLICABLE

INSPECTOR COMMENTS

No ventilation of grain cargo was carried out.

8B.33 Do records on board verify that cargo lights in holds, where fitted, were properly isolated before cargo was loaded?

NOT APPLICABLE

INSPECTOR COMMENTS

No lights fitted in cargo holds.

## Section 9A: Hatch Cover and Lifting Appliances

9A.14 Are cross-joint wedges and their wedge bridge (where fitted) in place, operational and effective?

NOT APPLICABLE

INSPECTOR COMMENTS

Not fitted.

9A.17 Has a thorough examination and load test of lifting appliances been carried out and is the record of the test and examination being maintained properly?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

9A.18 Are the hoist and luffing wires of cranes, where fitted, reported in good order and is there recorded evidence of regular inspection and maintenance?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

## ANSWERED N/A WITH COMMENTS OR ATTACHMENTS

Total: 23 (8%)

9A.19 Are the main structures, foundation structures and mountings of the cargo cranes free of apparent defect or damage?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

9A.20 Is the cargo crane's machinery and operator's cab, including the operator's cab controls, in good working order and inspected, tested, and maintained in accordance with manufacturer's recommendations?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

9A.21 Are the ship's grabs being maintained as per manufacturer recommendations and have the maintenance requirements been incorporated in the PMS?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

9A.22 Are the loose gears of lifting appliances clearly marked and are the certificates of the loose gears available and traceable on board?

NOT APPLICABLE

INSPECTOR COMMENTS

This is a gear-less vessel

## Section 10: Mooring Operations

10.9 On split drum winches, have the split drums been set up correctly after the completion of mooring operation? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

No split drums were fitted.

10.10 If mooring tails are used, have they properly connected to the main mooring lines in accordance with industry guidance? (V &amp; M)

NOT APPLICABLE

INSPECTOR COMMENTS

No mooring tails in use.

## Section 12: Security



## ANSWERED N/A WITH COMMENTS OR ATTACHMENTS

Total: 23 (8%)

- 12.6 Have preventive measures been taken by the Master and crew during the stay in port and prior to departure to prevent stowaways? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

The vessel never transited an area of high risk of piracy.

## Section 13: Machinery Space

- 13.5 If the engine room is not being operated in UMS mode, are there sufficient engineers and crew on board for safe operation of the machinery space? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

Engine room operated in UMS mode.

- 13.7 If an engine room dead man alarm (personnel alarm) is provided, is it correctly set and in good order? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

Dead man alarm was not fitted.

- 13.38 If an emergency generator is not fitted, are engine room emergency batteries in good order, fully charged and capable of supplying the designed power load up to a minimum 18 hours? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

Emergency generator was fitted

## Section 14: General Appearance - Hull and Superstructure

- 14.17 Is the elevator, where fitted, inspected, tested and in good order? (V)

NOT APPLICABLE

INSPECTOR COMMENTS

No elevator was fitted.

ANSWERED N/A WITHOUT COMMENTS OR ATTACHMENTS

Total: 0 (0%)

...

## ANSWERED N/V WITH COMMENTS OR ATTACHMENTS

Total: 13 (5%)

## Section 6: Ship's Structure

- 6.4 Are the access points to cargo holds, ballast tanks, and void spaces including vertical ladders, spiral ladders, rungs, stations, and platforms being maintained and in good order? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat in bulk.

- 6.5 Are the air pipes and sounding pipes in the cargo holds and void spaces in good condition? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat in bulk.

## Section 9A: Hatch Cover and Lifting Appliances

- 9A.1 Are the cargo holds, including the underside of hatch covers, free of loose rust scale and paint flakes? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

- 9A.4 Are the compression bars and the coaming tops' water channels clean, free of corrosion and maintained in good condition? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

- 9A.5 Are the drain holes of coamings clean, the inboard coamings faces free from any vertical rust staining and are the non-return valves in good condition? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

- 9A.7 If the hatch panel side and end plates are in steel-to-steel contact with the coaming tops when closed, are the coaming tops free from grooving or wear? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

- 9A.8 If the hatch covers are supported by bearing pads, are they free from wear or damage? (V)

NOT APPLICABLE

## ANSWERED N/V WITH COMMENTS OR ATTACHMENTS

Total: 13 (5%)

## INSPECTOR COMMENTS

The hatch covers were sealed with ramnek tape all around.

9A.9 Are the side and cross-joint rubber seals in good condition? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

9A.10 Are hatch cover panels free of misalignment?

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

9A.11 Are seal retaining channels in good condition and free of corrosion?

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

9A.12 Are the cross-joint seal retaining channels and the cross-joint compression bar straight, free of corrosion and damage, and are the channel supports and brackets in good condition?

NOT APPLICABLE

## INSPECTOR COMMENTS

All holds were full of wheat cargo and cargo spaces were fumigated. No hatch cover could be opened.

## Section 10: Mooring Operations

10.6 Are mooring lines correctly deployed and tended? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

The vessel was at anchor.

10.8 Are all mooring lines on winches correctly reeled on drums, and if made fast ashore, are winch brakes secured and winches out of gear? (V)

NOT APPLICABLE

## INSPECTOR COMMENTS

The vessel was at anchor.

ANSWERED N/V WITHOUT COMMENTS OR ATTACHMENTS

Total: 0 (0%)

...



## IMAGE GALLERY

Total: 196



13.28

[Q1328\\_100\\_2576.JPG](#)

NO



13.37

[Q1337\\_100\\_2408.JPG](#)

NO



14.2

[Q1402\\_100\\_2329.JPG](#)

NO



14.2

[Q1402\\_100\\_2331.JPG](#)

NO

## IMAGE GALLERY

Total: 196

Attachment Image

2.1

YES

[Q201\\_Survey\\_Status\\_2026.03.23\\_STAR\\_TRADER.pdf](#)

Attachment Image

2.13

YES

[Q213\\_1adb01dc-1abd-461d-afd2-28df491537f7.pdf](#)

3.1

YES

[Q301\\_3ed3ca4b-5286-44a8-992b-3270627bf95f.jpg](#)

3.1

YES

[Q301\\_3ed3ca4b-5286-44a8-992b-3270627bf95f.jpg](#)

## IMAGE GALLERY

Total: 196



3.10

[Q310\\_dd5bedc9-ca92-461b-b18e-34e6a5cb5e4b.jpg](#)

YES



3.10

[Q310\\_ea6dd55f-2d6a-4e2b-a842-c036746f6e9d.jpg](#)

YES



3.10

[Q310\\_dd5bedc9-ca92-461b-b18e-34e6a5cb5e4b.jpg](#)

YES



3.10

[Q310\\_ea6dd55f-2d6a-4e2b-a842-c036746f6e9d.jpg](#)

YES

## IMAGE GALLERY

Total: 196



3.11

[Q311\\_97ee3f40-c761-41eb-945e-ce11fa616573.jpg](#)

YES



3.12

[Q312\\_d002bb7c-9058-4270-a2c1-a17704a12764.jpg](#)

YES



3.15

[Q315\\_8d97430b-d672-4ccc-af78-d329d26ff9c1.jpg](#)

YES



3.15

[Q315\\_8d97430b-d672-4ccc-af78-d329d26ff9c1.jpg](#)

YES



## IMAGE GALLERY

Total: 196



3.17

YES

[Q317\\_7c2a64cb-f339-4cef-985f-4c92e41277c9.jpg](#)


3.17

YES

[Q317\\_e396f877-928d-47f5-ba30-116bfd4fd89.jpg](#)


3.17

YES

[Q317\\_e396f877-928d-47f5-ba30-116bfd4fd89.jpg](#)


3.18

YES

[Q318\\_929203b3-cf2c-4f42-a9e4-52974a8a7cbb.jpg](#)



## IMAGE GALLERY


Total: 196



3.18

[Q318\\_929203b3-cf2c-4f42-a9e4-52974a8a7cbb.jpg](#)

YES

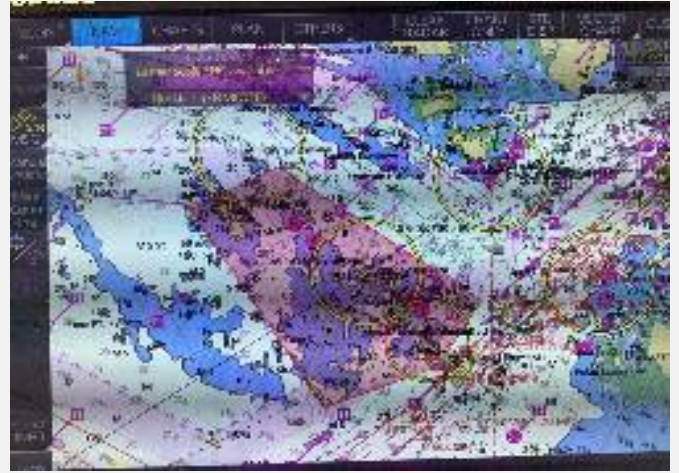

3.20

[Q320\\_63b55403-3260-4b1e-a1b4-fc3f203c2260.jpg](#)

YES



3.20

[Q320\\_cc9a9711-95f9-422a-b6b4-f62d87e46f3d.jpg](#)

YES



3.20

[Q320\\_cc9a9711-95f9-422a-b6b4-f62d87e46f3d.jpg](#)

YES

## IMAGE GALLERY

Total: 196



3.21

[Q321\\_52304862-e9eb-4ab2-9310-02bdb313c397.jpg](#)

YES



3.21

[Q321\\_b7c4ce46-10eb-497e-8622-7029ee84d712.jpg](#)

YES



3.22

[Q322\\_99f3ff08-f171-4f8a-9470-8abdad91af2a.jpg](#)

YES



3.23

[Q323\\_b719dd86-2441-4d97-9a21-e0f963e968a8.jpg](#)

YES



## IMAGE GALLERY


Total: 196



3.23

[Q323\\_b719dd86-2441-4d97-9a21-e0f963e968a8.jpg](#)


YES

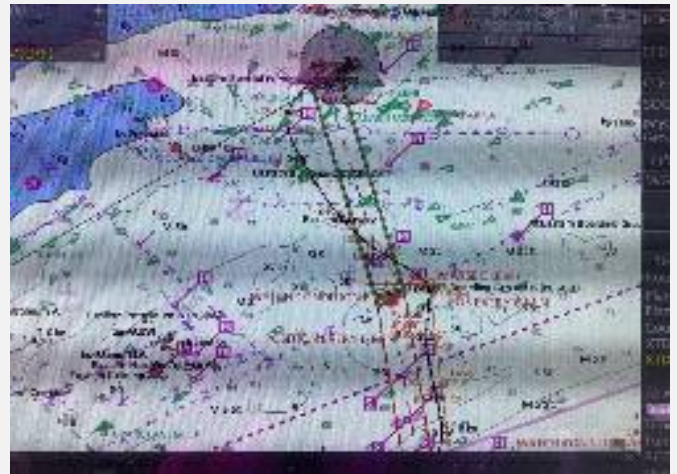

3.24

[Q324\\_7a37905b-f3b0-4b7c-85b4-88420ecbb0a1.jpg](#)


YES

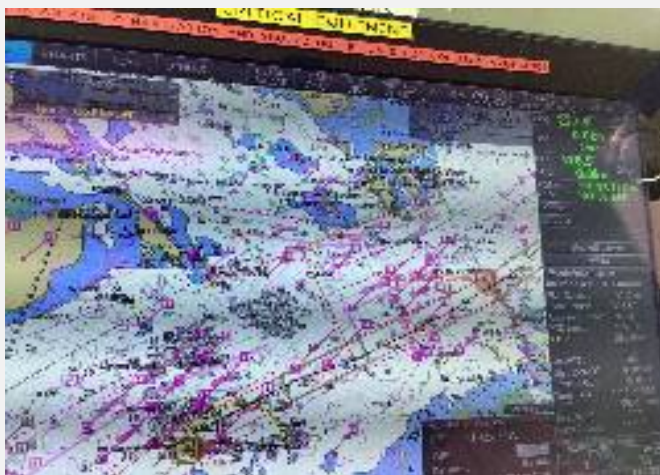

3.24

[Q324\\_af9b857a-b612-4e7f-aac1-fa01957d6833.jpg](#)

YES

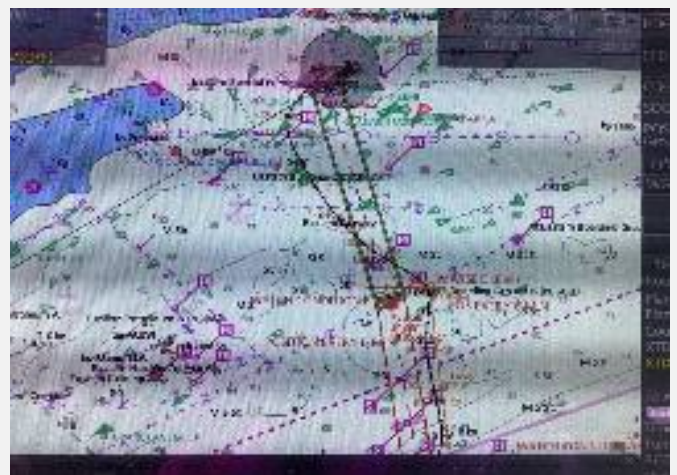


3.24

[Q324\\_7a37905b-f3b0-4b7c-85b4-88420ecbb0a1.jpg](#)

YES

## IMAGE GALLERY

Total: 196

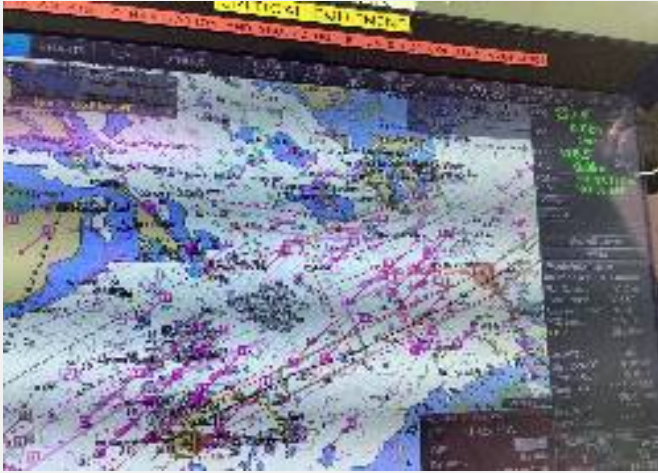

3.24

[Q324\\_af9b857a-b612-4e7f-aac1-fa01957d6833.jpg](#)

YES



4.11

[Q411\\_a1050926-23a5-4f59-8186-a75ae376ef63.jpg](#)

YES



4.11

[Q411\\_a6707f91-ef18-4c33-ab9f-b83479885404.jpg](#)

YES



4.11

[Q411\\_a6707f91-ef18-4c33-ab9f-b83479885404.jpg](#)

YES

## IMAGE GALLERY

Total: 196



4.14

[Q414\\_b6645646-a729-424f-89b8-2dfd3b1cba84.jpg](#)

YES



4.14

[Q414\\_b6645646-a729-424f-89b8-2dfd3b1cba84.jpg](#)

YES



4.15

[Q415\\_6270ed76-c6dd-4fad-83ce-bd83c5bd84fd.jpg](#)

YES



4.15

[Q415\\_6270ed76-c6dd-4fad-83ce-bd83c5bd84fd.jpg](#)

YES



## IMAGE GALLERY

Total: 196



4.16

[Q416\\_9232805a-9124-4c2d-b6d5-fc4c854fb93c.jpg](#)

YES



4.18

[Q418\\_100\\_2360.JPG](#)

YES



4.18

[Q418\\_100\\_2386.JPG](#)

YES



4.18

[Q418\\_100\\_2399.JPG](#)

YES

## IMAGE GALLERY

Total: 196



4.19

[Q419\\_100\\_2393.JPG](#)

YES



4.19

[Q419\\_100\\_2394.JPG](#)

YES



4.20

[Q420\\_498fad2a-9bfd-4b4e-9f2a-847eb7562357.jpg](#)

YES



4.20

[Q420\\_498fad2a-9bfd-4b4e-9f2a-847eb7562357.jpg](#)

YES

## IMAGE GALLERY

Total: 196



4.21

[Q421\\_82de0ae1-0ba8-49dd-8546-14479c51571b.jpg](#)

YES



4.24

[Q424\\_100\\_2376.JPG](#)

YES



4.24

[Q424\\_100\\_2413.JPG](#)

YES



4.25

[Q425\\_100\\_2423.JPG](#)

YES

## IMAGE GALLERY

Total: 196



4.25

[Q425\\_100\\_2424.JPG](#)

YES



4.26

[Q426\\_bbcba09a-062d-48df-bce5-09d8790a9f74.jpg](#)

YES



4.26

[Q426\\_bbcba09a-062d-48df-bce5-09d8790a9f74.jpg](#)

YES



4.27

[Q427\\_100\\_2547.JPG](#)

YES

## IMAGE GALLERY

Total: 196



4.27

[Q427\\_100\\_2549.JPG](#)

YES



4.31

[Q431\\_100\\_2417.JPG](#)

YES



4.32

[Q432\\_100\\_2541.JPG](#)

YES



4.33

[Q433\\_100\\_2397.JPG](#)

YES



## IMAGE GALLERY

Total: 196



4.35

[Q435\\_100\\_2337.JPG](#)

YES



4.36

[Q436\\_100\\_2443.JPG](#)

YES



4.39

[Q439\\_95d7c6ed-b1ca-4134-bf82-633c8736b06c.jpg](#)

YES



4.39

[Q439\\_efeca329-3614-495b-9c84-a8aee092930f.jpg](#)

YES

## IMAGE GALLERY

Total: 196



4.39

[Q439\\_95d7c6ed-b1ca-4134-bf82-633c8736b06c.jpg](#)

YES



4.42

[Q442\\_100\\_2343.JPG](#)

YES



4.42

[Q442\\_100\\_2372.JPG](#)

YES



5.9

[Q509\\_45edb795-cc43-40d9-80db-bd9fe5946a95.jpg](#)

YES

## IMAGE GALLERY

Total: 196



5.9

[Q509\\_45edb795-cc43-40d9-80db-bd9fe5946a95.jpg](#)

YES



5.13

[Q513\\_100\\_2626.JPG](#)

YES



5.15

[Q515\\_100\\_2612.JPG](#)

YES



5.15

[Q515\\_100\\_2617.JPG](#)

YES

## IMAGE GALLERY

Total: 196



5.19

[Q519\\_100\\_2401.JPG](#)

YES



5.25

[Q525\\_100\\_2559.JPG](#)

YES



5.25

[Q525\\_100\\_2560.JPG](#)

YES



5.25

[Q525\\_100\\_2604.JPG](#)

YES

## IMAGE GALLERY

Total: 196



5.26

[Q526\\_100\\_2347.JPG](#)

YES



5.26

[Q526\\_100\\_2349.JPG](#)

YES



5.27

[Q527\\_100\\_2538.JPG](#)

YES



6.1

[Q601\\_100\\_2326.JPG](#)

YES



## IMAGE GALLERY

Total: 196



6.1

[Q601\\_100\\_2335.JPG](#)

YES



6.8

[Q608\\_100\\_2459.JPG](#)

YES



7A.1

[Q7a01\\_100\\_2452.JPG](#)

YES



7A.1

[Q7a01\\_100\\_2453.JPG](#)

YES

## IMAGE GALLERY

Total: 196



7A.4

[Q7a04\\_100\\_2451.JPG](#)

YES



7A.12

[Q7a12\\_100\\_2582.JPG](#)

YES



7A.12

[Q7a12\\_100\\_2587.JPG](#)

YES



7A.13

[Q7a13\\_100\\_2410.JPG](#)

YES

## IMAGE GALLERY

Total: 196



9A.6

[Q9a06\\_100\\_2462.JPG](#)

YES



9A.6

[Q9a06\\_100\\_2464.JPG](#)

YES



9A.13

[Q9a13\\_100\\_2340.JPG](#)

YES



9A.13

[Q9a13\\_100\\_2461.JPG](#)

YES

## IMAGE GALLERY

Total: 196



9A.16

[Q9a16\\_100\\_2509.JPG](#)

YES



10.1

[Q1001\\_100\\_2384.JPG](#)

YES



10.1

[Q1001\\_100\\_2497.JPG](#)

YES



10.4

[Q1004\\_100\\_2433.JPG](#)

YES

## IMAGE GALLERY

Total: 196



10.4

[Q1004\\_100\\_2490.JPG](#)

YES



10.5

[Q1005\\_100\\_2432.JPG](#)

YES



10.15

[Q1015\\_100\\_2436.JPG](#)

YES



10.15

[Q1015\\_100\\_2498.JPG](#)

YES



## IMAGE GALLERY

Total: 196



10.16

[Q1016\\_100\\_2439.JPG](#)

YES



10.16

[Q1016\\_100\\_2492.JPG](#)

YES



10.17

[Q1017\\_100\\_2441.JPG](#)

YES



10.17

[Q1017\\_100\\_2491.JPG](#)

YES

## IMAGE GALLERY

Total: 196



10.18

[Q1018\\_100\\_2494.JPG](#)

YES



10.18

[Q1018\\_100\\_2495.JPG](#)

YES



10.19

[Q1019\\_100\\_2323.JPG](#)

YES



10.20

[Q1020\\_100\\_2505.JPG](#)

YES

## IMAGE GALLERY

Total: 196



10.20

[Q1020\\_100\\_2506.JPG](#)

YES



11.2

[Q1102\\_62f02be6-6aa8-48c7-b1ee-01416a9a6832.jpg](#)

YES



11.2

[Q1102\\_90e3f5d1-3353-4bb7-87e6-eae9b778f9a8.jpg](#)

YES



11.2

[Q1102\\_62f02be6-6aa8-48c7-b1ee-01416a9a6832.jpg](#)

YES

## IMAGE GALLERY

Total: 196



11.3

YES

[Q1103\\_45be3335-e1d4-4bb8-8d93-483c9635a85c.jpg](#)

11.3

YES

[Q1103\\_ffb5054f-db6f-42d6-bd55-52bf0fc557f6.jpg](#)

11.3

YES

[Q1103\\_45be3335-e1d4-4bb8-8d93-483c9635a85c.jpg](#)

11.3

YES

[Q1103\\_ffb5054f-db6f-42d6-bd55-52bf0fc557f6.jpg](#)



## IMAGE GALLERY

Total: 196



11.6

[Q1106\\_f8ddbba8-f87c-442f-ac9c-af008daee293.jpg](#)

YES



11.7

[Q1107\\_64a79736-838a-4489-8106-588d856a2f7c.jpg](#)

YES



11.7

[Q1107\\_64a79736-838a-4489-8106-588d856a2f7c.jpg](#)

YES



11.8

[Q1108\\_ffdd2c9-e027-40a1-8c92-b02ab054eee0.jpg](#)

YES



## IMAGE GALLERY

Total: 196



11.8

[Q1108\\_ffdd2c9-e027-40a1-8c92-b02ab054eee0.jpg](#)

YES



13.1

[Q1301\\_b3dfb96f-8ca6-41b0-99cc-156ab68dfc3f.jpg](#)

YES



13.1

[Q1301\\_100\\_2536.JPG](#)

YES



13.1

[Q1301\\_b3dfb96f-8ca6-41b0-99cc-156ab68dfc3f.jpg](#)

YES

## IMAGE GALLERY

Total: 196



13.3

[Q1303\\_100\\_2544.JPG](#)

YES



13.4

[Q1304\\_100\\_2545.JPG](#)

YES



13.8

[Q1308\\_c9131b6f-d213-43ac-8c5b-23922d7025b8.jpg](#)

YES



13.9

[Q1309\\_05afa60f-8ea3-4947-a233-610849717e54.jpg](#)

YES

## IMAGE GALLERY

Total: 196



13.9

YES

[Q1309\\_94514ba9-6ccd-4730-9726-12a3536d90ed.jpg](#)

13.9

YES

[Q1309\\_05afa60f-8ea3-4947-a233-610849717e54.jpg](#)

13.13

YES

[Q1313\\_100\\_2552.JPG](#)

13.14

YES

[Q1314\\_100\\_2551.JPG](#)

## IMAGE GALLERY

Total: 196



13.14

[Q1314\\_100\\_2566.JPG](#)

YES



13.15

[Q1315\\_15da68e8-c43d-4b6c-a581-aa321ad70b65.jpg](#)

YES



13.15

[Q1315\\_7dd5ec82-1f66-452a-b4bb-64875ef86d17.jpg](#)

YES



13.15

[Q1315\\_7dd5ec82-1f66-452a-b4bb-64875ef86d17.jpg](#)

YES



## IMAGE GALLERY

Total: 196



13.18

[Q1318\\_100\\_2379.JPG](#)

YES



13.18

[Q1318\\_100\\_2388.JPG](#)

YES



13.19

[Q1319\\_100\\_2563.JPG](#)

YES



13.19

[Q1319\\_100\\_2593.JPG](#)

YES



## IMAGE GALLERY

Total: 196



13.20

[Q1320\\_100\\_2586.JPG](#)

YES



13.20

[Q1320\\_100\\_2590.JPG](#)

YES



13.21

[Q1321\\_b563953f-65b2-4a71-a31c-ee143b3c18b7.jpg](#)

YES



13.21

[Q1321\\_fbe600ea-0dba-4c47-b4dc-7beaa4af3a49.jpg](#)

YES

## IMAGE GALLERY

Total: 196



13.21

[Q1321\\_fbe600ea-0dba-4c47-b4dc-7beaa4af3a49.jpg](#)

YES



13.22

[Q1322\\_580d59bf-be56-4b99-862a-9827d13a57e0.jpg](#)

YES



13.22

[Q1322\\_756c884c-0483-44da-9e3c-debe2d9fba46.jpg](#)

YES



13.23

[Q1323\\_100\\_2585.JPG](#)

YES

## IMAGE GALLERY

Total: 196



13.26

[Q1326\\_100\\_2557.JPG](#)

YES



13.27

[Q1327\\_100\\_2532.JPG](#)

YES



13.27

[Q1327\\_100\\_2571.JPG](#)

YES



13.29

[Q1329\\_100\\_2565.JPG](#)

YES

## IMAGE GALLERY

Total: 196



13.29

[Q1329\\_100\\_2611.JPG](#)

YES



13.31

[Q1331\\_100\\_2602.JPG](#)

YES



13.31

[Q1331\\_100\\_2620.JPG](#)

YES



13.32

[Q1332\\_100\\_2561.JPG](#)

YES

## IMAGE GALLERY

Total: 196



13.32

[Q1332\\_100\\_2600.JPG](#)

YES



13.34

[Q1334\\_bce333e9-d03f-4745-a2ae-7e0bcac8042d.jpg](#)

YES



13.34

[Q1334\\_100\\_2598.JPG](#)

YES



13.35

[Q1335\\_100\\_2631.JPG](#)

YES



## IMAGE GALLERY

Total: 196



13.36

[Q1336\\_100\\_2403.JPG](#)

YES



13.39

[Q1339\\_641c5c14-320f-452c-928f-e3ea104de317.jpg](#)

YES



13.39

[Q1339\\_6ea27ff7-4a80-401b-b484-5b4799592613.jpg](#)

YES



13.39

[Q1339\\_6ea27ff7-4a80-401b-b484-5b4799592613.jpg](#)

YES

## IMAGE GALLERY

Total: 196



13.40

YES

[Q1340\\_57d9af7f-28a6-4b7c-aabb-6e5670fa02e2.jpg](#)

13.41

YES

[Q1341\\_4851993c-f6ec-4347-a2a0-ce957e848bda.jpg](#)

13.41

YES

[Q1341\\_4851993c-f6ec-4347-a2a0-ce957e848bda.jpg](#)

13.42

YES

[Q1342\\_571d6587-e540-448c-93cd-42ed17e3b297.jpg](#)

## IMAGE GALLERY

Total: 196



13.43

[Q1343\\_403cc1d9-9f58-4b9b-8054-e28a81d9bbc0.jpg](#)

YES



13.43

[Q1343\\_e3f06bd5-c311-4f67-9abc-f97c71d31b44.jpg](#)

YES



13.45

[Q1345\\_7879cbcd-c5cd-43c3-85a4-9d4db5293250.jpg](#)

YES



14.1

[Q1401\\_100\\_2323.JPG](#)

YES

## IMAGE GALLERY

Total: 196



14.1

[Q1401\\_100\\_2325.JPG](#)

YES



14.3

[Q1403\\_100\\_2341.JPG](#)

YES



14.3

[Q1403\\_100\\_2465.JPG](#)

YES



14.4

[Q1404\\_100\\_2485.JPG](#)

YES



## IMAGE GALLERY

Total: 196



14.4

[Q1404\\_100\\_2514.JPG](#)

YES



14.5

[Q1405\\_0cadd385-2407-4438-9698-be4da60441a4.jpg](#)

YES



14.5

[Q1405\\_0cadd385-2407-4438-9698-be4da60441a4.jpg](#)

YES



14.6

[Q1406\\_100\\_2344.JPG](#)

YES



## IMAGE GALLERY

Total: 196



14.6

[Q1406\\_100\\_2455.JPG](#)

YES



14.8

[Q1408\\_100\\_2368.JPG](#)

YES



14.9

[Q1409\\_c9797b09-6f5f-4886-97ec-867daeeba6fa.jpg](#)

YES



14.9

[Q1409\\_100\\_2364.JPG](#)

YES

## IMAGE GALLERY

Total: 196



14.12

[Q1412\\_100\\_2374.JPG](#)

YES



14.12

[Q1412\\_100\\_2448.JPG](#)

YES



14.13

[Q1413\\_100\\_2511.JPG](#)

YES



14.13

[Q1413\\_100\\_2523.JPG](#)

YES

## IMAGE GALLERY

Total: 196



14.15

[Q1415\\_100\\_2516.JPG](#)

YES



14.15

[Q1415\\_100\\_2519.JPG](#)

YES



14.16

[Q1416\\_100\\_2521.JPG](#)

YES



14.18

[Q1418\\_100\\_2421.JPG](#)

YES

## IMAGE GALLERY

Total: 196



14.18

[Q1418\\_100\\_2422.JPG](#)

YES



14.19

[Q1419\\_100\\_2342.JPG](#)

YES



15.2

[Q1502\\_100\\_2357.JPG](#)

YES



15.2

[Q1502\\_100\\_2519.JPG](#)

YES

## CONTACT US

If you're interested and would like to know more, get in touch with our team today.



[www.rightship.com](http://www.rightship.com)



[dryinspections@rightship.com](mailto:dryinspections@rightship.com)



RightShip

### MELBOURNE

📍 Level 8/ 550 Bourke Street,  
Melbourne VIC 3000,  
Australia

☎ +61 3 8686 5750

### LONDON

📍 4th Floor, 6 Dowgate Hill,  
London EC4R 2SU, United  
Kingdom

☎ +44 203 872 5900

### SINGAPORE

📍 20 Cecil Street, PLUS,  
#13-06  
Singapore 049705

☎ +65 3138 3855

### HOUSTON

📍 Suite 140 14141  
Southwest Freeway,  
Sugar Land TX 77478,  
United States of America

☎ +1 832 770 8200

### MALTA

📍 The Tower, 3rd Floor,  
Fortunato Mizzi Street,  
Ir-Rabat Għawdex  
VCT 2517, Malta